


FastMig

MXP 37 Pipe Steel

MXP 37 Pipe Stainless

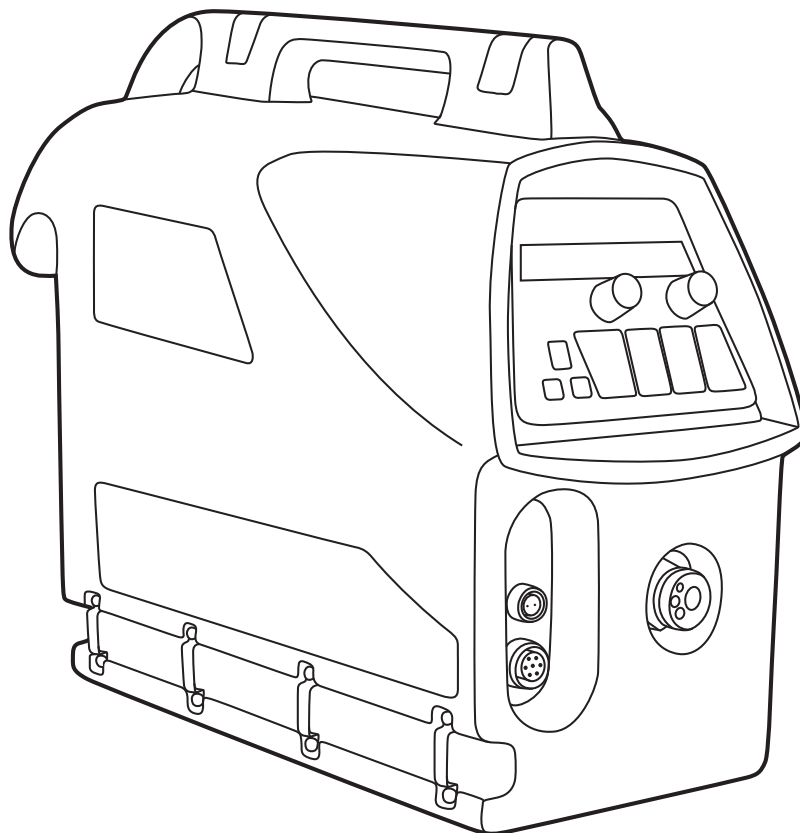

Operating manual **EN**

Bruksanvisning **DA**

Gebrauchsanweisung **DE**

Manual de instrucciones **ES**

Käyttöohje **FI**

Manuel d'utilisation **FR**

Manuale d'uso **IT**

Gebruiksaanwijzing **NL**

Brugsanvisning **NO**

Instrukcja obsługi **PL**

Manual de utilização **PT**

Инструкции по эксплуатации **RU**

Bruksanvisning **SV**

操作手册 **ZH**

OPERATING MANUAL

English

CONTENTS

1.	Introduction.....	3
1.1	General	3
1.2	About FastMig MXP 37 Pipe.....	3
2.	Installation.....	4
2.1	Machine introduction: MXP 37 Pipe.....	4
2.2	Connecting cables	5
2.3	Assembly of MIG/MAG system	6
2.4	Accessories corresponding to wire diameter	7
2.5	Welding gun selection.....	7
2.6	Mounting and locking of wire spool.....	7
2.7	Loading the filler wire and automatic feed	8
2.8	GT04 wire feed mechanism.....	8
2.9	Adjustment of pressure arms.....	10
2.10	Adjustment of spool brake	10
2.11	Burn back time	10
2.12	Earth return cable.....	10
2.13	Shielding gas.....	11
2.14	Main switch I/O	12
2.15	Operation of cooling unit, FastCool 10	12
2.16	Hanging kit	12
3.	XF 37 control panel	12
3.1	Connecting and mounting.....	12
3.2	Layout	13
3.3	Button functions.....	13
3.4	Welding software	16
4.	Basic troubleshooting	18
5.	Maintenance	20
5.1	Daily maintenance.....	20
5.2	Periodic maintenance.....	20
5.3	Service Workshop maintenance.....	20
6.	Disposal of the machine	21
7.	Ordering codes.....	21
8.	Technical data.....	24

1. INTRODUCTION

1.1 General

Congratulations on choosing the FastMig MXP welding equipment. Used correctly, Kemppi products can significantly increase the productivity of your welding, and provide years of economical service.

This operating manual contains important information on the use, maintenance and safety of your Kemppi product. The technical specifications of the equipment can be found at the end of the manual.

Please read the operating manual and the safety instructions booklet carefully before using the equipment for the first time. For your own safety and that of your working environment, pay particular attention to the safety instructions in the manual.

For more information on Kemppi products, contact Kemppi Oy, consult an authorised Kemppi dealer, or visit the Kemppi web site at www.kemppi.com.

The specifications presented in this manual are subject to change without prior notice.

Important notes

Items in the manual that require particular attention in order to minimise damage and personal harm are indicated with the '**NOTE!**' notation. Read these sections carefully and follow their instructions.

EN

1.2 About FastMig MXP 37 Pipe

Kemppi FastMig MXP 37 Pipe is a wire feeder designed for demanding professional use. It is equipped with the WiseRoot+™ welding process, developed especially for efficient root welding on pipes and plates.

FastMig MXP 37 Pipe wire feeder can be used with FastMig X 450 and FastMig Pulse power sources. However, WiseRoot+™ special welding process is only available when used with FastMig X 450 power source.



Operation of the wire feeder is controlled and adjusted by microprocessor. By adding an optional synchronization unit (MXF Sync 65), SuperSnake sub-feeder device may be connected to MXP 37 Pipe wire feeder.

Disclaimer

While every effort has been made to ensure that the information contained in this guide is accurate and complete, no liability can be accepted for any errors or omissions. Kemppi reserves the right to change the specification of the product described at any time without prior notice. Do not copy, record, reproduce or transmit the contents of this guide without prior permission from Kemppi.


2. INSTALLATION

2.1 Machine introduction: MXP 37 Pipe

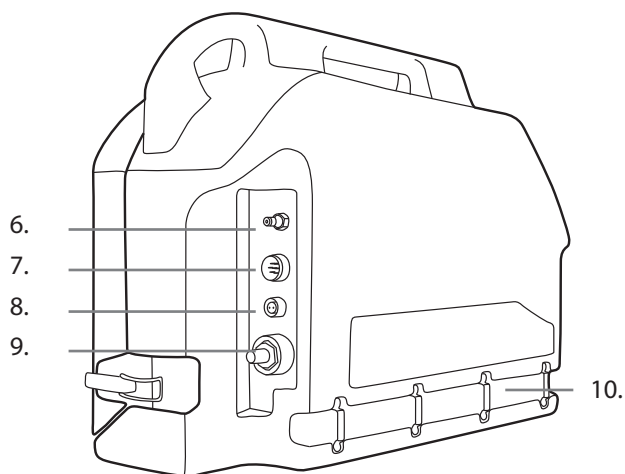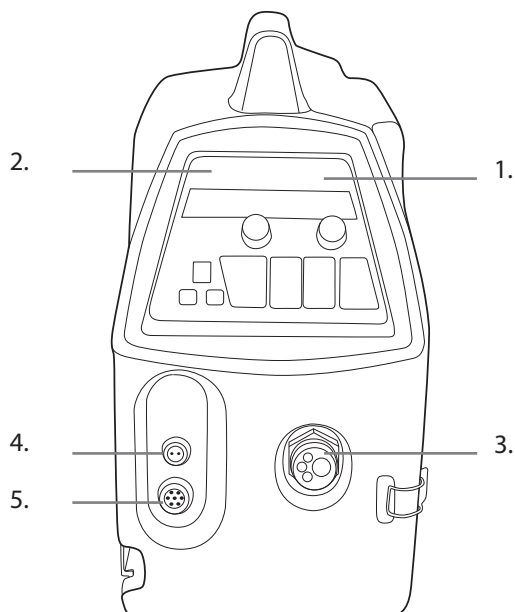

2.2 Connecting cables


2.2.1 Water-cooled system: FastMig X 450 + MXP + FastCool 10

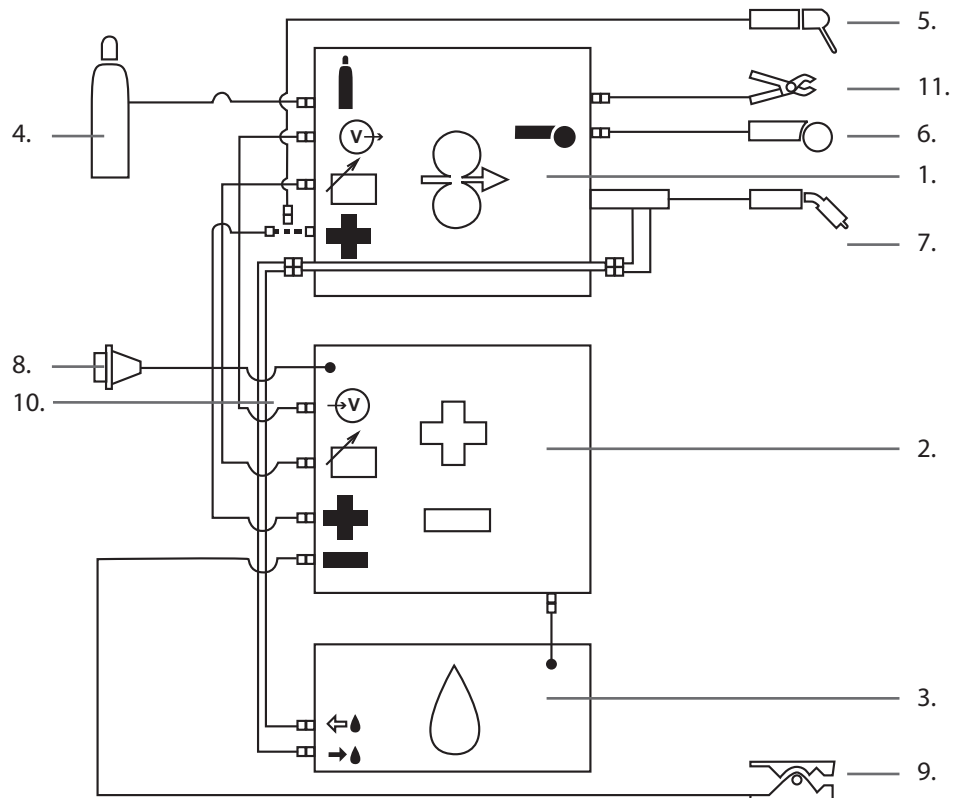

1. Wire feed unit
2. FastMig X 450 power source
3. FastCool cooling unit and power connection
4. Gas supply
5. MMA electrode holder
6. Remote control device
7. Water-cooled welding gun
8. Power cable
9. Earth return cable and clamp
10. Measurement cable (from power source to wire feeder)
11. Voltage sensing cable (from wire feeder to work piece)

NOTE! MXP 37 Pipe wire feeder can also be used with FastMig Pulse power source, but in that case measurement cable and voltage sensing cable will not be used.

2.2.2 Air-cooled system: FastMig X 450 + MXP 37 Pipe

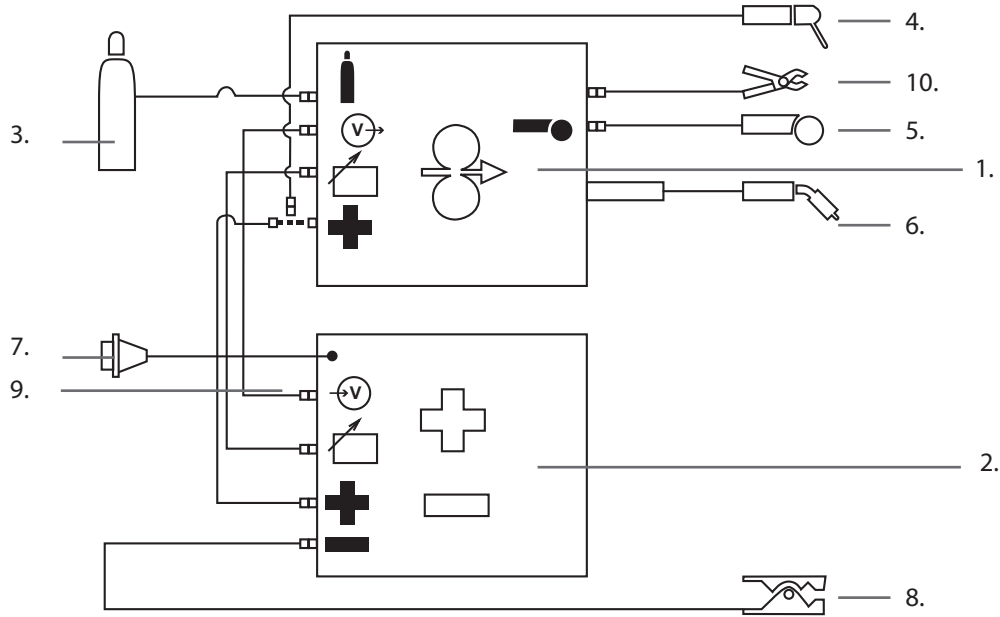

1. Wire feed unit
2. FastMig X 450 power source
3. Gas supply
4. MMA electrode holder
5. Remote control device
6. Air-cooled welding gun
7. Power cable
8. Earth return cable and clamp
9. Measurement cable (from power source to wire feeder)
10. Voltage sensing cable (from wire feeder to work piece)

NOTE! MXP 37 Pipe wire feeder can also be used with FastMig Pulse power source, but in that case measurement cable and voltage sensing cable will not be used.

2.3 Assembly of MIG/MAG system

Assemble the units in the order mentioned below. Follow the additional mounting and operation instructions delivered with each package.

1. Installation of power source

Read and follow the installation instructions given in the FastMig power source operating manual.

2. Mounting of power sources to transport cart

Read and follow the instructions given in the transport cart assembly instructions.

3. Mounting the FastMig MXP 37 Pipe wire feed unit to the power source

Remove the cover sticker on top of the power source. Screw the fastening pivot into the power source – hand tighten only. Place the supplied plastic spacers over the pivot. Lift the MXP wire feeder into place, locating over the pivot.

4. Connecting cables

Connect the cables in accordance with the equipment notes provided in this manual.

The polarity of the welding wire (+ or –) can be selected by connecting the wire feed unit to either the positive or negative power source terminals.

Most MIG/MAG applications run the wire feed unit connected to the positive terminal of the power source.

5. Mounting FastMig wire feed units to boom and swing arms

When mounting wire feed units to boom and swing arms, the unit must be electrically isolated from both.

Suspension angle of wire feed unit can be changed by moving the fixing point in handle.

2.4 Accessories corresponding to wire diameter

Colour coded wire feed rolls and guide tubes are available to suit a variety of filler wire types and sizes. Feed roll groove geometry and design vary depending on the application. Further details are available in the spare parts tables.

Please ensure you select the correct drive rolls and guide tubes from the table to suit your particular welding application.


2.5 Welding gun selection

Please ensure that the welding gun selected is suitable for the target application. Kemppi welding gun products are designed to meet many different applications. Special wire liners and contact tips are available for different wire types and sizes.

For FastMig X 450 and MXP 37 Pipe setup Kemppi offers the PMT MN welding gun model, which is specially designed for welding root and fill passes on pipe. The neck is replaceable, so you can select just the right bending angle for different work stages.

Distance wire feeding is accommodated with WeldSnake and SuperSnake products in either air or water cooled models.

2.6 Mounting and locking of wire spool

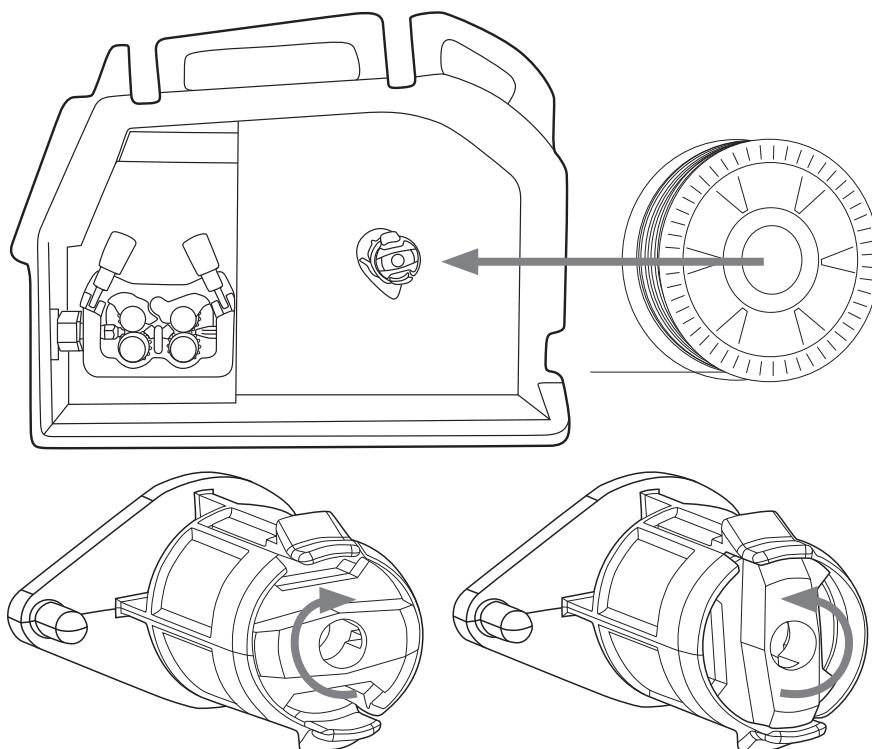

NOTE! Check that in filler wire spool is correctly mounted and locked into position. Ensure the spool is not damaged or deformed in such a way that it can rub or chaff against the internal surface of the wire feed unit chassis or door. This may result in increased drag, impacting on weld quality. This may also result in long term wire feed unit damage, rendering the unit unserviceable or unsafe to use.

2.7 Loading the filler wire and automatic feed

Automatic wire feed makes wire spool changes faster. When changing the wire spool, the pressure of feed rolls need not be released.

Simply ensure that the groove of the feed roll matches the diameter of filler wire used. Release the wire end from the spool and cut off any deformed section. Be careful that the wire does not spill from the spool sides.


Straighten about 20 cm of filler wire and ensure the tip has no sharp edges. File if necessary, as a sharp wire edge may damage the wire gun liner - particularly softer plastic liners.

Present the filler wire tip to the back of the wire feed rolls and press the wire inch switch on the wire feeder panel. Feed the wire to the gun contact tip and prepare to weld.

NOTE! Smaller diameter filler wires may need to be loaded manually and with the feed roll pressure arms released. This is because it is easy to over estimate the pressure required to feed these smaller filler wires. Too high feed roll pressures can easily deform filler wires and contribute to later feeding problems.

2.8 GT04 wire feed mechanism


Wire guide tubes					
	ø mm		outlet tube	middle tube	inlet tube
Al, Ss (Fe, Mc, Fc) plastic	0.6		W007285	W007273	W007293
	0.8 – 0.9		W007286	W007274	W007294
	1.0		W007287	W007275	W007295
	1.2		W007288	W007276	W007296
	1.4		W007289	W007277	W007297
	1.6		W007290	W007278	W007298
	2.0		W007291	W007279	W007299
	2.4		W007292	W007280	W007300
Fe, Mc, Fc metal	0.8 – 0.9		W007454		W007536
	1.0		W007455		W007537
	1.2		W007456		W007538
	1.4 – 1.6		W007458		W007539
	2.0		W007459		W007540
	2.4		W007460		W007541

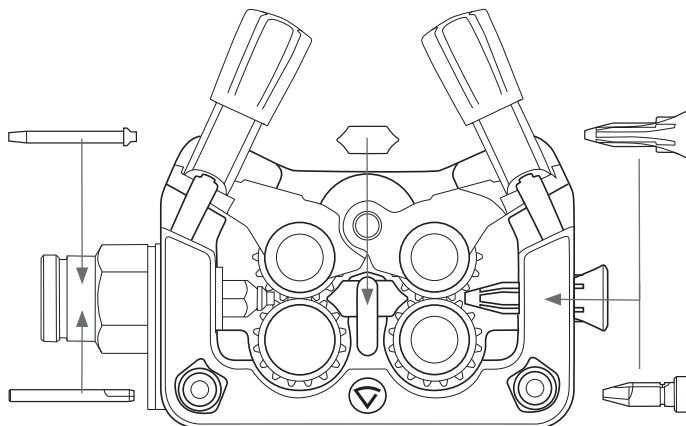

Wire feed rolls, plastic				
	ø mm		lower	upper
Fe, Ss, (Al, Mc, Fc) V-groove V	0.6		W001045	W001046
	0.8 – 0.9		W001047	W001048
	1.0		W000675	W000676
	1.2		W000960	W000961
	1.4		W001049	W001050
	1.6		W001051	W001052
	2.0		W001053	W001054
	2.4		W001055	W001056
Fc, Mc, (Fe) V-groove, knurled V≡	1.0		W001057	W001058
	1.2		W001059	W001060
	1.4 – 1.6		W001061	W001062
	2.0		W001063	W001064
	2.4		W001065	W001066
Al, (Fc, Mc, Ss, Fe) U-groove U	1.0		W001067	W001068
	1.2		W001069	W001070
	1.6		W001071	W001072

Wire feed rolls, metal			
	ø mm	lower	upper
Fe, Ss, (Al, Mc, Fc) V-groove V	0.8 – 0.9	W006074	W006075
	1.0	W006076	W006077
	1.2	W004754	W004753
	1.4	W006078	W006079
Fc, Mc, (Fe) V-groove, knurled V≡	1.0	W006080	W006081
	1.2	W006082	W006083
	1.4 – 1.6	W006084	W006085
	2.0	W006086	W006087
Fc, Mc, Ss, Fe U-groove U	1.0	W006088	W006089
	1.2	W006090	W006091
	1.6	W006092	W006093

NOTE! Mount the lower feed roll, ensuring that the pin on the shaft fits in the cut on the feed roll.

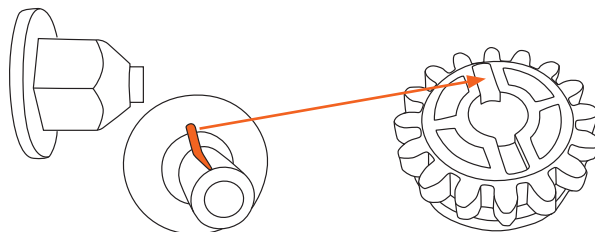

2.9 Adjustment of pressure arms


Adjust the drive pressure to the filler wire with the thumb screws mounted over the pressure arms. Notice the graduated scales indicating load. The load applied should be sufficient to overcome a light braking force applied by hand to the filler wire, as it exits the welding gun contact tip.

For smaller diameter and soft filler wires, less feed pressure is required. It should be possible to apply a light braking force to the filler wire by hand, as it exits the gun contact tip. But slightly more wire flow restriction should render the drives rolls to slip slightly over the filler wire without deforming the wire.

NOTE! Excessive pressure causes flattening of the filler wire and damage to coated or cored filler wires. It also causes undue wear of the feed rolls and increases gearbox load, so reducing service life.

2.10 Adjustment of spool brake

Brake force is adjusted through the hole behind the locking clip. Remove the locking clip by hand, and adjust the tension and pressure to the friction pads mounted inside with a screw driver. See diagram and location A.

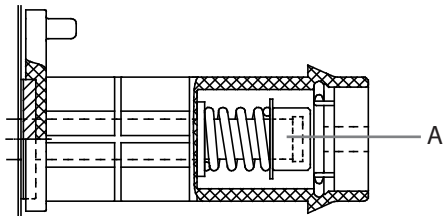

The load applied varies depending on the size and weight of the filler wire and spool, but also the filler wire feed speed set. The heavier the wire spool and the faster the feed speed, the greater the need to increase the braking load. Adjust the pressure, secure the locking clip, set the wire feed speed and check that the braking force is enough to ensure the filler wire does not spill from the spool on overrun.

NOTE! Too much or unnecessary loads can impact welding quality, load and wear to the wire feed system.

2.11 Burn back time

FastMig electronics controls the burn back time. When welding stops an automatic sequence ensures that the filler wire does not stick to the work piece and that no ball is formed at the wire tip, ensuring reliable re-ignition. This system works regardless of the wire feed speed.

2.12 Earth return cable

Preferably the earth return cable and clamp should be connected directly to the welding material.


Always use a good quality, 70 mm² heavy copper cable, and if possible a screw type 600 A clamp. Ensure that the surface contact to the work piece is clean of metal oxide and or paint. Make sure the clamp is firmly secured.

2.13 Shielding gas

NOTE! Handle shielding gas bottle with care. Assess the risks associated with handling and using compressed gas. Always use a cylinder transport carriage and secure the cylinder safely.

There are many different suppliers of quality shielding gases for welding. Please ensure that you are selecting the correct gas for your application. FastMig products use welding programs for synergic and pulsed welding. These programs are created and recommend against a particular shielding gas.

Shielding gas effects welding performance and is a fundamental component to overall weld quality.

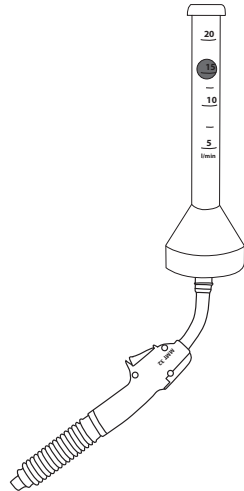


NOTE! Shielding gas flow rate from the welding gun is set according to the application, weld joint, gas type and gas nozzle shape and size. The flow rate should be measured at the welding gun nozzle before welding via a rotameter, and normally measure's between 10 – 20 litres per minute for many welding applications.

2.13.1 Installing gas bottle

Always fasten the gas bottle properly in the vertical position, in a special holder against the wall or on a cylinder carriage. Remember to close gas bottle valve after welding.

Parts of gas flow regulator

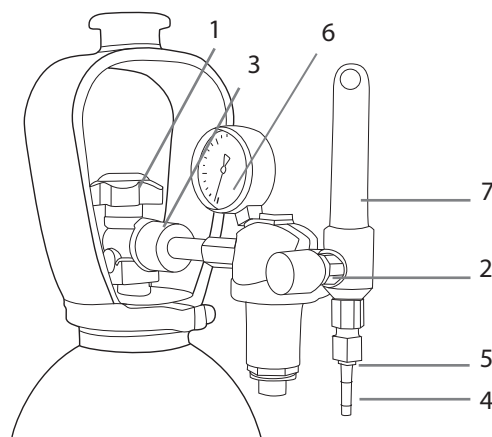

1. Gas bottle valve
2. Flow regulation screw
3. Connecting nut
4. Hose tail
5. Hose tail nut
6. Gas bottle pressure gauge
7. Shielding gas flow meter

2.14 Main switch I/O

When you turn the main switch of the FastMig power source into I-position, the pilot lamp closest to this switch will illuminate, indicating the power source is ready for welding. The equipment will return to the same operation state where it was before the last shutdown. Always start and switch off the machine with the main switch, never use the mains plug as a switch.

2.15 Operation of cooling unit, FastCool 10


When water cooling unit FastCool 10 is connected to the FastMig power source for the first time, the cooler function is normally active. To deselect the cooler function, follow the instructions stated in the FastCool 10 operating manual.

2.16 Hanging kit


The MXP 37 Pipe wire feed units can be mounted on a welding boom using the KFH 1000 hanging device available as an accessory. This allows the wire feed unit to be suspended above the work area.

3. XF 37 CONTROL PANEL


3.1 Connecting and mounting

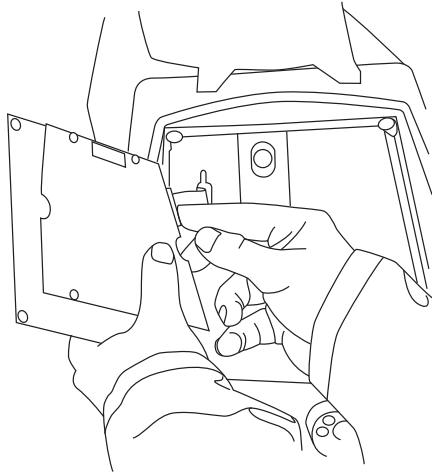

Fasten the ribbon cable connector from the MXP 37 Pipe wire feed unit to the control panel. Attach the yellow-green earth lead into the fork connector on the XF 37 control panel.

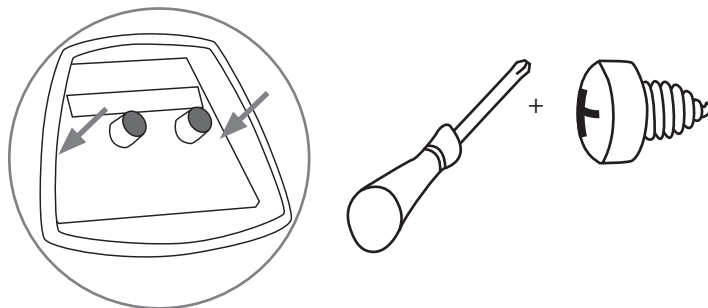

3.2 Layout

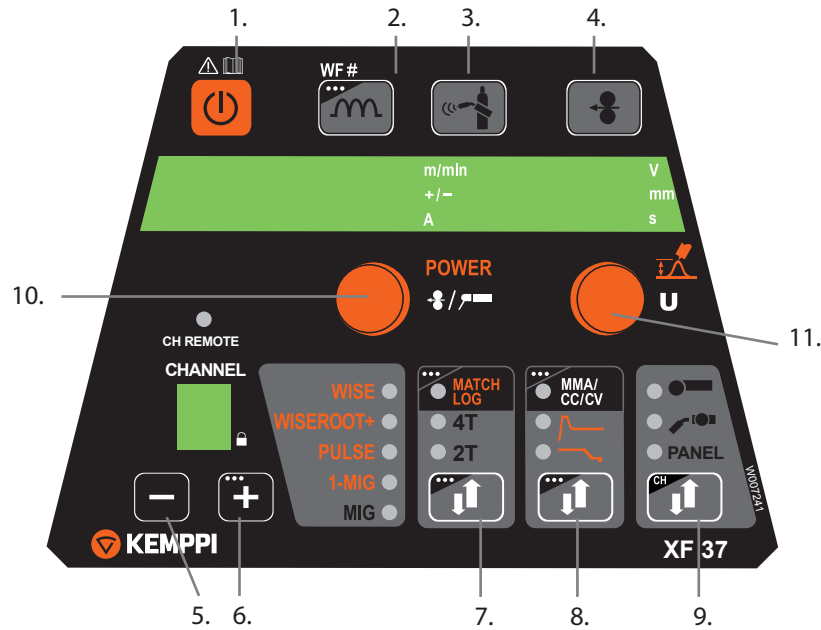

1. Main switch (long press)
2. Activates MIG welding dynamics (short press)
Selects the active wire feeder, if several wire feeders exist (long press)
3. Gas test
4. Wire inch
5. Selects the previous memory channel
6. Selects the next memory channel (short press)
Locks selected memory channel (long press)
7. Selects welding gun trigger mode (short press) or turns MatchLog function ON/OFF
8. Selects crater fill, hot start (short press) or MMA/CC/CV (long press)
9. Selects panel control, gun control unit or hand-held control unit (short press).
Turns memory channel remote selection ON/OFF (long press).
10. Power control knob
11. Arc length and voltage control knob.

Automatic weld data display

Last recorded welding values are displayed post welding.

3.3 Button functions

3.3.1 ON/OFF button (1)



Short press: XF 37 panel returns to initial display.

Long press: XF 37 panel is turned ON or OFF.

NOTE! When wire feeder XF 37 control panel is turned ON, also the power source control panel X 37 turns on and links automatically to this wire feeder.

3.3.2 Dynamics button (2)



Short press: Dynamics setting for 1-MIG, synergic MIG and CC/CV. ArcForce setting for MMA.

Long press: Wire feeder number selection. If there is more than one wire feeder connected to the system, you can select which of them is active. Each wire feeder has its own number (1–3).

NOTE! Wire feeder number is not available in MMA, CC and CV processes.

3.3.3 Gas test button (3)



This button displays the gas test time. You can change it with the control knob.

Gas test starts when the time adjustment is made, after a short delay.

You can stop gas test by pressing any button.

3.3.4 Wire inch button (3)



This button starts feeding the wire with the default speed of 5 m/min. The wire feed stops when you release the button.

You can change the wire feed speed with the control knob. The changed speed is used if you press the button again.

3.3.5 Channel down button (5)



This button selects the previous memory channel that can be found.


3.3.6 Channel up button (6)



Short press: Selects the next memory channel that can be found.

Long press: Locks or unlocks the selected memory channel. No parameter changes are allowed to a locked memory channel.

3.3.7 2T/4T button (7)

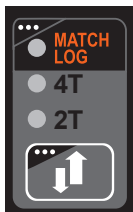

Short press: Toggles between 2T or 4T gun trigger mode.

Long press: Turns MatchLog ON/OFF. This can be either MatchChannel or Minilog functionality, depending on which one is defined in the selected memory channel. If neither one is defined, this selection is unavailable.


3.3.8 Extra functions button (8)



Short press: Selects Crater fill or Hot start function.

Long press: Turns MMA/CC/CV mode ON/OFF.

3.3.9 Remote Selection Button (9)

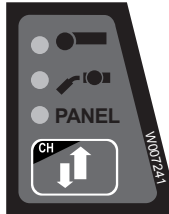

Short press: Toggles the control between the control panel, gun remote control unit and hand-held remote control unit.

NOTE! If RemoteAutoRecog setting is ON in X 37 control panel, you can select only those remote controls, which can be found in the system.

Long press: Turns the memory channel remote selection ON/OFF. This is available only if you have selected either gun remote control unit or hand-held remote control unit. Not available in MMA/CC/CV mode.

3.3.10 Power control knob (10)



This control knob adjusts

- wire feed speed or power in MIG/MAG processes (before or during welding)
- MMA/CC current level (before or during welding)
- selected parameter values.

3.3.11 Arc length and voltage control knob (11)



This control knob adjusts the arc length, voltage or selected parameter values before or during welding.

3.4 Welding software

The FastMig MXP 37 Pipe wire feeder is compatible with the following modified welding processes and functions:

Factory-installed

- **WiseRoot+™** is a modified welding process for open gap root welding without backing. It is factory-installed in the MXP 37 Pipe wire feeder.
- **WiseFusion™** is a welding function for ensuring consistent weld quality in all positions. It is factory-installed in MXP 37 Pipe wire feeder (both Pipe Stainless and Pipe Steel versions).
- **WisePulseMig™** is a licence that allows pulsed MIG welding. This is factory-installed in Pipe Stainless version of MXP 37 Pipe wire feeder and optional extra in Pipe Steel package.
- Either **Pipe Stainless** or **Pipe Steel** welding program package is factory-installed in MXP 37 Pipe wire feeder. You can select either one according to your welding application. Each package contains a selection of welding programs.

Optional extras

- **WisePenetration™** is a welding function for delivering constant welding power regardless of changes in the stick out length. It is an optional feature, which can be purchased through Kemppi DataStore.
- **MatchLog™** contains MiniLog™ function and the MatchChannel™ function for quickly changing welding parameters on the run. It is an optional feature, which can be purchased through Kemppi DataStore.
- If your welding needs change and you wish to update your system in the future, you can order additional welding programs or other welding software and load them to your system with Kemppi DataGun field programming device.

For further information about the available welding programs, modified processes and special enhanced arc performance solutions, visit Kemppi web site at www.kemppi.com or contact the local Kemppi dealer.

PIPE STAINLESS PACK

Material	Wire ø (mm)	Shielding gas	Process	Number
CrNiMo-19-12	0.8	Ar+2%CO ₂	WiseRoot+	S01
CrNiMo-19-12	0.9	Ar+2%CO ₂	WiseRoot+	S02
CrNiMo-19-12	1.0	Ar+2%CO ₂	WiseRoot+	S03
CrNiMo-19-12	1.2	Ar+2%CO ₂	WiseRoot+	S04
CrNiMo-19-12	0.8	Ar+2%CO ₂	1-MIG	S01
CrNiMo-19-12	0.9	Ar+2%CO ₂	1-MIG	S02
CrNiMo-19-12	1.0	Ar+2%CO ₂	1-MIG	S03
CrNiMo-19-12	1.2	Ar+2%CO ₂	1-MIG	S04
CrNiMo-19-12 (FC)	1.2	Ar+18%CO ₂	1-MIG	S84
CrNiMo-19-12 (FC)	1.2	CO ₂	1-MIG	S85
CrNiMo-19-12 (MC)	1.2	Ar+2%CO ₂	1-MIG	S87
CrNiMo-19-12	0.8	Ar+2%CO ₂	Pulse MIG	S01
CrNiMo-19-12	0.9	Ar+2%CO ₂	Pulse MIG	S02
CrNiMo-19-12	1.0	Ar+2%CO ₂	Pulse MIG	S06
CrNiMo-19-12	1.2	Ar+2%CO ₂	Pulse MIG	S04
CrNiMo-19-12	1.0	Ar+He+CO ₂	Pulse MIG	S26
CrNiMo-19-12	1.2	Ar+He+CO ₂	Pulse MIG	S24

PIPE STEEL PACK

Material	Wire ø (mm)	Shielding gas	Process	Number
Fe	0.8	Ar+18%CO ₂	WiseRoot+	F01
Fe	0.9	Ar+18%CO ₂	WiseRoot+	F02
Fe	1.0	Ar+18%CO ₂	WiseRoot+	F03
Fe	1.2	Ar+18%CO ₂	WiseRoot+	F04
Fe (MC)	1.2	Ar+18%CO ₂	WiseRoot+	M04
Fe (MC)	1.2	CO ₂	WiseRoot+	M24
Fe	0.8	CO ₂	WiseRoot+	F21
Fe	0.9	CO ₂	WiseRoot+	F22
Fe	1.0	CO ₂	WiseRoot+	F23
Fe	1.2	CO ₂	WiseRoot+	F24
Fe (Self shielded)	1.6		1-MIG	R56
Fe (Self shielded)	2.0		1-MIG	R57
Fe (Self shielded)	2.4		1-MIG	R58
Fe	0.8	Ar+18%CO ₂	1-MIG	F01
Fe	0.9	Ar+18%CO ₂	1-MIG	F02
Fe	1.0	Ar+18%CO ₂	1-MIG	F03
Fe	1.2	Ar+18%CO ₂	1-MIG	F04
Fe (MC)	1.2	Ar+18%CO ₂	1-MIG	M04
Fe (MC)	1.2	CO ₂	1-MIG	M24
Fe	0.8	CO ₂	1-MIG	F21
Fe	0.9	CO ₂	1-MIG	F22
Fe	1.0	CO ₂	1-MIG	F23
Fe	1.2	CO ₂	1-MIG	F24
Fe (FC)	1.2	Ar+18%CO ₂	1-MIG	R04
Fe (FC)	1.2	CO ₂	1-MIG	R24

More welding programs are available by purchasing MatchCurve and MatchCustom products.

4. BASIC TROUBLESHOOTING

NOTE! The problems listed and the possible causes are not definitive, but serve to suggest some standard and typical situations that may present during normal environmental use when using the MIG/MAG process with FastMig X 450 and MXP 37 Pipe.

Problem	Check the following
Machine won't work	• Check mains plug is connected correctly • Check mains power distribution is switched on • Check the mains fuse and or circuit breaker • Check power source 0/I switch is ON • Check interconnection cable set and connectors between the power source and wire feed unit are correctly fastened. See the manual schematic • Check earth return lead is connected • Check control panels are switched on.
Dirty, poor quality weld	• Check shielding gas supply • Check and set gas flow rate • Check gas type for application • Check gun/electrode polarity • Check correct welding program selected • Check correct channel number selected on wire feeder control panel • Check power supply – Phase down?
Variable welding performance	• Check wire feed mechanism is correctly adjusted • Check correct drive rolls are fitted • Check wire spool overrun tension is correctly adjusted • Check gun liner is not blocked, replace if necessary • Check correct gun liner is fitted for the filler wire size and type • Check contact tip for size, type and wear • Check gun is not over heating in application • Check cable connections and earth return clamp • Check welding parameter settings.
Filler wire won't feed	• Check that pressure arms are closed and adjusted in wire feed mechanism • Check welding gun switch function • Check Euro gun collar is correctly fastened • Check gun liner is not blocked • Check contact tip, size, type, wear • Check and try alternative gun
High spatter volume	• Check welding parameter values • Check inductance/Dynamics values • Check cable compensation value if long cables are fitted • Check gas type and flow • Check welding polarity – cable connections • Check filler material selection • Check correct welding program selected • Check correct channel number selection • Check filler wire delivery system • Check power supply – 3-phase present?
Err1	Power source is not calibrated or calibration data cannot be read • Restart power source • if the problem continues after multiple startups contact Kemppi service representative
Err 3	Overvoltage in the mains supply • Check the mains voltage

Err 4	Power source is overheated • Do not shut down, let the fans cool the machine. • Check ventilation. • If cooling fans are not running, contact Kemppi service representative.
Err 5	Mains power supply voltage is too low or one of the phases is missing or auxiliary supply is faulty • Check the mains supply and auxiliary supply and contact Kemppi service representative if necessary.
Err 8	FPGA is not configured • Restart the power source. • If the error persists, contact Kemppi service representative
Err 9	Loose cable connections • Check the voltage sensing cable, measurement cable and earth return cable.
Err 10	Illegal process • The welding process is not available in this machine.
Err 27	Error in the water cooling unit • Check the connections in the cooling unit.
Err 42 or Err 43	Over current in wire feeder motor • Check that the welding gun and consumable parts are properly mounted
Err 45	Gas guard alert • Check the shielding gas, gas guard and all connections.
Err 50	The function is not activated in this machine • if you need this function, order a licence for it from a Kemppi representative.
Err 51	Rear feed roll may be loose • Check that the feed rolls are properly tightened.
Err 52	Front feed roll may be loose • Check that the feed rolls are properly tightened
Err 62	Power source is not connected or not identified by the wire feeder • Check the intermediate cable and its connections.
Err 81	Welding program is not found • If you need the welding program, order a licence for it from Kemppi representative.
MEM ERR	Machine cannot complete read or write functions on the wire feeder memory card • Check the cables and connections. • Contact Kemppi service representative.
NO BUS	Control panel cannot establish a connection to the CAN bus • Check the flat cables and the control panels. • Contact Kemppi service representative.

NOTE! Many of these checks may be carried out by the operator. However certain checks relating to mains power must be completed by an authorised trained electrician.

NOTE! In the case of an error code other than the listed above, contact Kemppi service representative.

5. MAINTENANCE

When considering and planning routine maintenance, please consider the frequency of machine use and the working environment.

Correct operation of the machine and regular maintenance will help you avoid unnecessary downtime and equipment failure.

NOTE! *Disconnect the machine from the mains before handling the electrical cables.*

5.1 Daily maintenance

- Check the overall condition of the welding gun. Remove welding spatter from the contact tip and clean the gas nozzle. Replace worn or damaged parts. Only use original Kemppi spare parts.
- Check the condition and connection of the welding circuit components: welding gun, earth return cable and clamp, sockets and connectors.
- Check the condition of the feed rolls, needle bearings and shafts. Clean and lubricate bearings and shafts with a small quantity of light machine oil if necessary. Assemble, adjust and test function.
- Check that the feed rolls are suitable for the filler wire you are using, and that their pressure adjustment is correct.

5.2 Periodic maintenance

NOTE! *Periodic maintenance should only be carried out by a suitably qualified person. Disconnect the plug of the machine from the mains socket and wait about 2 minutes (capacitor charge) before removing the cover plate.*

Check at least every half year:

- Electric connectors of the machine – clean any oxidized parts and tighten loose connections.

NOTE! *You must know the correct tension torques values before starting the reparation of the loose joints.*

Clean the inner parts of the machine from dust and dirt e.g. with a soft brush and vacuum cleaner. Also clean the ventilation net behind the front grill.

Do not use compressed air, there is a risk that the dirt will compact even more tightly into gaps of cooling profiles.

Do not use pressure washing devices.

Only an authorized trained electrician should carry out repairs to Kemppi machines.

5.3 Service Workshop maintenance

Kemppi Service Workshops complete maintenance according to their Kemppi service agreement.

The major points in the maintenance procedure are listed as follows:

- Cleaning of the machine
- Checking and maintenance of the welding tools
- Checking of connectors, switches and potentiometers
- Checking of electric connections
- Checking of mains cable and plug
- Damaged parts or parts in bad condition are replaced by new ones
- Maintenance testing.
- Operation and performance values of the machine are checked, and when necessary adjusted by means of software and test equipment.

Software loading

Kemppi Service Workshops can also test and load firmware and welding software.

6. DISPOSAL OF THE MACHINE



Do not dispose of electrical equipment with normal waste!

In observance of European Directive 2002/96/EC on waste electrical and electronic equipment, and its implementation in accordance with national law, electrical equipment that has reached the end of its life must be collected separately and taken to an appropriate environmentally responsible recycling facility.

The owner of the equipment is obliged to deliver a decommissioned unit to a regional collection centre, as per the instructions of local authorities or a Kemppi representative. By applying this European Directive you will improve the environment and human health.

7. ORDERING CODES

FastMig MXP 37 Pipe Steel wire feeder, 300 mm		6103700
FastMig MXP 37 Pipe Stainless wire feeder, 300 mm		6103710
XF 37, wire feeder control panel	Included with the wire feeder	W007257
Cables		
Earth return cable	5 m, 50 mm ²	6184511
Earth return cable	5 m, 70 mm ²	6184711
MMA welding cable	5 m, 50 mm ²	6184501
MMA welding cable	5 m, 70 mm ²	6184701
Voltage sensing cable	Included with MXP wire feeder	W007110
Magnetic clamp (voltage sensing cable)	200 A	9871580
Magnetic clamp (earth return cable)	600 A	9871570
Interconnection cables, air cooled		
FASTMIG X 70-1.8-GH	1.8 m	6260468
FASTMIG X 70-5-GH	5 m	6260469
FASTMIG X 70-10-GH	10 m	6260470
FASTMIG X 70-20-GH	20 m	6260471
FASTMIG X 70-30-GH	30 m	6260472
– For other lengths, please contact Kemppi.		
Interconnection cables, water cooled		
FASTMIG X 70-1.8-WH	1.8 m	6260473
FASTMIG X 70-5-WH	5 m	6260474
FASTMIG X 70-10-WH	10 m	6260475
FASTMIG X 70-20-WH	20 m	6260476
FASTMIG X 70-30-WH	30 m	6260477
– For other lengths, please contact Kemppi.		

Software products		
MatchLog™		9991017
MatchChannel™	Included with MatchLog™ licence	
WisePulseMig™ licence for pulse welding	Included with Pipe Stainless package	9990417
WiseFusion™	Included with MXP wire feeder	9991014
WisePenetration™ function		9991000
Pipe Steel welding program package	Included with FastMig MXP 37 Pipe Steel wire feeder	99904274
Pipe Stainless welding program package	Included with FastMig MXP 37 Pipe Stainless wire feeder	99904275
– Other welding software available.		
Accessories		
Cooling unit FastCool 10		6068100
SuperSnake GT02S sub feeder	10 m	6153100
SuperSnake GT02S sub feeder	15 m	6153150
SuperSnake GT02S sub feeder	20 m	6153200
SuperSnake GT02S sub feeder	25 m	6153250
SuperSnake GT02S W sub feeder	10 m	6154100
SuperSnake GT02S W sub feeder	15 m	6154150
SuperSnake GT02S W sub feeder	20 m	6154200
SuperSnake GT02S W sub feeder	25 m	6154250
SuperSnake GT02S sub feeder synchronization unit for MXF and MXP wire feeders		W004030
KV 200 mounting plate for two wire feeders and TIG unit		6185249
Gun holder GH 30		6256030
Transport unit PM 500		6185291
Remote control unit R10	5 m	6185409
Remote control unit R10	10 m	618540901
Remote control unit R20	5 m	6185419
Remote control unit R30 DataRemote	5 m	6185420
Remote control unit R30 DataRemote	10 m	618542001
Remote control extension cable	10 m	6185481
DataGun software installation tool		6265023

MIG guns			
PMT MN	1.2 mm / 60° / L198 / ROOT	3.5 m	62503230N04
PMT MN	1.2 mm / 60° / L168 / ROOT	3.5 m	62503230N06
PMT MN	1.2 mm / 60° / L198 / ROOT	5 m	62503250N04
PMT MN	1.2 mm / 60° / L198	3.5 m	62503230N08
PMT MN	1.2 mm / 60° / L198	5 m	62503250N08
PMT MN	1.2 mm / 45° / L222	3.5 m	62503230N02
PMT MN	1.2 mm / 45° / L222	5 m	62503250N02
PMT MN	1.0 mm / Ss / 60° / L198 / ROOT	5 m	62503250N03SS
PMT MN	1.0 mm / Ss / 60° / L198	5 m	62503250N07SS
PMT MN	1.0 mm / Ss / 45° / L222	5 m	62503250N01SS
Neck	45° / L222		SP007229
Neck	60° / L198 / ROOT		SP007811
Neck	60° / L168 / ROOT		SP007810
Neck	60° / L198		SP008006
Neck	60° / L168		SP008007
PMT 35		3 m	6253513
PMT 35		4.5 m	6253514
PMT 42		3 m	6254213
PMT 42		4.5 m	6254214
PMT 50		3 m	6255013
PMT 50		4.5 m	6255014
PMT 30W		3 m	6253043
PMT 30W		4.5 m	6253044
PMT 42W		3 m	6254203
PMT 42W		4.5 m	6254204
PMT 52W		3 m	6255203
PMT 52W		4.5 m	6255204
WS 35	AL 1.2 mm	6 m	6253516A12
WS 30 W	AL 1.2 – 1.6 mm	6 m	6253046A12
WS 30 W	AL 1.2 – 1.6 mm	8 m	6253048A12
WS 42 W	AL 1.2 – 1.6 mm	6 m	6254206A12
WS 42 W	AL 1.2 – 1.6 mm	8 m	6254208A12
WS 35	Ss 1.0 mm	6 m	6253516S10
WS 30 W	Ss 1.0 mm	6 m	6253046S10
WS 30 W	Ss 1.2 mm	6 m	6253046S12
WS 30 W	Ss 1.0 mm	8 m	6253048S10
WS 30 W	Ss 1.2 mm	8 m	6253048S12
WS 42 W	Ss 1.0 mm	6 m	6254206S10
WS 42 W	Ss 1.2 mm	6 m	6254206S12
WS 42 W	Ss 1.0 mm	8 m	6254208S10
WS 42 W	Ss 1.2 mm	8 m	6254208S12

For a complete list of welding guns, please visit Kemppi web site at www.kemppi.com.

8. TECHNICAL DATA

FastMig MXP 37 Pipe		
Operating voltage (safety voltage)		50 V DC
Rated power		250 W
Output 40 °C	60 % ED	520 A
	100 % ED	440 A
Wire feed speed		0.5 – 25 m/min
Wire feed mechanism		4-roll, two motors
Diameter of feed rolls		32 mm
Filler wires	ø Fe, Ss	0.6 – 2.0 mm
	ø Cored wire	0.8 – 2.4 mm
	ø Al	0.8 – 2.4 mm
Wire spool	max. weight	20 kg
	max. ø	300 mm
Gun connection		Euro
Operation temperature range		-20...+40 °C
Storage temperature range		-40...+60 °C
EMC class		A
Degree of protection		IP23S
External dimensions	L x W x H	590 x 240 x 445 mm
Weight		13.1 kg

KEMPPI OY

Kempinkatu 1
PL 13
FIN-15801 LAHTI
FINLAND
Tel +358 3 899 11
Telefax +358 3 899 428
export@kempfi.com
www.kempfi.com

Kotimaan myynti:

Tel +358 3 899 11
Telefax +358 3 734 8398
myynti.fi@kempfi.com

KEMPPI SVERIGE AB

Box 717
S-194 27 UPPLANDS VÄSBY
SVERIGE
Tel +46 8 590 783 00
Telefax +46 8 590 823 94
sales.se@kempfi.com

KEMPPI NORGE A/S

Postboks 2151, Postterminalen
N-3103 TØNSBERG
NORGE
Tel +47 33 346000
Telefax +47 33 346010
sales.no@kempfi.com

KEMPPI DANMARK A/S

Literbuen 11
DK-2740 SKOVLENDE
DANMARK
Tel +45 4494 1677
Telefax +45 4494 1536
sales.dk@kempfi.com

KEMPPI BENELUX B.V.

Postbus 5603
NL-4801 EA BRED
NEDERLAND
Tel +31 765717750
Telefax +31 765716345
sales.nl@kempfi.com

KEMPPI (UK) Ltd

Martti Kemppi Building
Fraser Road
Priory Business Park
BEDFORD, MK44 3WH
UNITED KINGDOM
Tel +44 (0)845 6444201
Telefax +44 (0)845 6444202
sales.uk@kempfi.com

KEMPPI FRANCE S.A.S.

65 Avenue de la Couronne des Prés
78681 EPONE CEDEX
FRANCE
Tel +33 1 30 90 04 40
Telefax +33 1 30 90 04 45
sales.fr@kempfi.com

KEMPPI GmbH

Perchstetten 10
D-35428 LANGGÖNS
DEUTSCHLAND
Tel +49 6 403 7792 0
Telefax +49 6 403 779 79 74
sales.de@kempfi.com

KEMPPI SPÓŁKA Z O.O.

Ul. Borzymowska 32
03-565 WARSZAWA
POLAND
Tel +48 22 7816162
Telefax +48 22 7816505
info.pl@kempfi.com

KEMPPI AUSTRALIA PTY LTD.

13 Cullen Place
P.O. Box 5256, Greystanes NSW 2145
SMITHFIELD NSW 2164
AUSTRALIA
Tel. +61 2 9605 9500
Telefax +61 2 9605 5999
info.au@kempfi.com

ООО КЕМПИ

Polkovaya str. 1, Building 6
127018 MOSCOW
RUSSIA
Tel +7 495 739 4304
Telefax +7 495 739 4305
info.ru@kempfi.com

ООО КЕМПИ

ул. Полковая 1, строение 6
127018 Москва
Tel +7 495 739 4304
Telefax +7 495 739 4305
info.ru@kempfi.com

KEMPPI, TRADING (BEIJING) COMPANY, LIMITED

Room 420, 3 Zone, Building B,
No.12 Hongda North Street,
Beijing Economic Development Zone,
100176 Beijing
CHINA
Tel +86-10-6787 6064
+86-10-6787 1282
Telefax +86-10-6787 5259
sales.cn@kempfi.com

肯倍贸易 (北京) 有限公司
中国北京经济技术开发区宏达北路12号
创新大厦B座三区420室 (100176)
电话 : +86-10-6787 6064
+86-10-6787 1282
传真 : +86-10-6787 5259
sales.cn@kempfi.com

KEMPPI INDIA PVT LTD

LAKSHMI TOWERS
New No. 2/770,
First Main Road,
Kazura Garden,
Neelankarai,
CHENNAI - 600 041
TAMIL NADU
Tel +91-44-4567 1200
Telefax +91-44-4567 1234
sales.india@kempfi.com