Model 43*i* Trace Level-Enhanced

Instruction Manual

Pulsed Fluorescence SO₂ Analyzer Part Number 102780-00 16May2015





© 2007 Thermo Fisher Scientific Inc. All rights reserved.

Specifications, terms and pricing are subject to change. Not all products are available in all countries. Please consult your local sales representative for details.

Thermo Fisher Scientific Air Quality Instruments 27 Forge Parkway Franklin, MA 02038 1-508-520-0430 www.thermo.com/aqi

WEEE Compliance

This product is required to comply with the European Union's Waste Electrical & Electronic Equipment (WEEE) Directive 2002/96/EC. It is marked with the following symbol:



Thermo Fisher Scientific has contracted with one or more recycling/disposal companies in each EU Member State, and this product should be disposed of or recycled through them. Further information on Thermo Fisher Scientific's compliance with these Directives, the recyclers in your country, and information on Thermo Fisher Scientific products which may assist the detection of substances subject to the RoHS Directive are available at: www.thermo.com/WEEERoHS.

About This Manual

This manual provides information about installing, operating, maintaining, and servicing the Model 43*i* Trace Level-Enhanced. It also contains important alerts to ensure safe operation and prevent equipment damage. The manual is organized into the following chapters and appendixes to provide direct access to specific operation and service information.

- Chapter 1 "Introduction" provides an overview of the product features, describes the principle of operation, and lists the specifications.
- Chapter 2 "Installation" describes how to unpack, setup, and start-up the analyzer.
- Chapter 3 "Operation" describes the front panel display, the front panel pushbuttons, and the menu-driven software.
- Chapter 4 "Calibration" provides the procedures for calibrating the analyzer and describes the required equipment.
- Chapter 5 "Preventive Maintenance" provides maintenance procedures to ensure reliable and consistent instrument operation.
- Chapter 6 "Troubleshooting" presents guidelines for diagnosing analyzer failures, isolating faults, and includes recommended actions for restoring proper operation.
- Chapter 7 "Servicing" presents safety alerts for technicians working on the analyzer, step-by-step instructions for repairing and replacing components, and a replacement parts list. It also includes contact information for product support and technical information.
- Chapter 8 "System Description" describes the function and location of the system components, provides an overview of the software structure, and includes a description of the system electronics and input/output connections.
- Chapter 9 "Optional Equipment" describes the optional equipment that can be used with this analyzer.
- Appendix A "Warranty" is a copy of the warranty statement.
- Appendix B "C-Link Protocol Commands" provides a description of the C-Link protocol commands that can be used to remotely control an analyzer using a host device such as a PC or datalogger.

- Appendix C "MODBUS Protocol" provides a description of the MODBUS Protocol Interface and is supported both over RS-232/485 (RTU protocol) as well as TCP/IP over Ethernet.
- Appendix D "Geysitech (Bayern-Hessen) Protocol" provides a description of the Geysitech (Bayern-Hessen or BH) Protocol Interface and is supported both over RS-232/485 as well as TCP/IP over Ethernet.
- Appendix E "Standards for Trace Level Analyzers" provides information about generating zero air.

Safety and Equipment Damage Alerts

This manual contains important information to alert you to potential safety hazards and risks of equipment damage. Refer to the following types of alerts you may see in this manual.

Safety and Equipment Damage Alert Descriptions

Alert		Description
\triangle	DANGER	A hazard is present that will result in death or serious personal injury if the warning is ignored. \blacktriangle
\triangle	WARNING	A hazard is present or an unsafe practice can result in serious personal injury if the warning is ignored. \blacktriangle
\triangle	CAUTION	The hazard or unsafe practice could result in minor to moderate personal injury if the warning is ignored.
$\underline{\wedge}$	Equipment Damage	The hazard or unsafe practice could result in property damage if the warning is ignored.

Safety and Equipment Damage Alerts in this Manual

Alert		Description
\triangle	WARNING	If the equipment is operated in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.
		The service procedures in this manual are restricted to qualified service personnel only. ▲
		The Model 43 <i>i</i> Trace Level-Enhanced is supplied with a three-wire grounding cord. Under no circumstances should this grounding system be defeated. ▲
\triangle	Equipment Damage	Do not attempt to lift the analyzer by the cover or other external fittings. \blacktriangle
		Some internal components can be damaged by small amounts of static electricity. A properly grounded antistatic wrist strap must be worn while handling any

Alert	Description
	internal component. 🔺
	This adjustment should only be performed by an instrument service technician. $lacksquare$
	Handle all printed circuit boards by the edges only. $lacksquare$
	Do not remove the panel or frame from the LCD module. \blacktriangle
	The LCD module polarizing plate is very fragile, handle it carefully. ▲
	Do not wipe the LCD module polarizing plate with a dry cloth, it may easily scratch the plate. \blacktriangle
	Do not use Ketonics solvent or aromatic solvent to clean the LCD module, use a soft cloth moistened with a naphtha cleaning solvent.
	Do not place the LCD module near organic solvents or corrosive gases. \blacktriangle
	Do not shake or jolt the LCD module. $lacksquare$

FCC Compliance

Changes or modifications to this unit not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

Note This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense. \blacktriangle

WEEE Symbol

The following symbol and description identify the WEEE marking used on the instrument and in the associated documentation.

Symbol Description



Marking of electrical and electronic equipment which applies to electrical and electronic equipment falling under the Directive 2002/96/EC (WEEE) and the equipment that has been put on the market after 13 August 2005. ▲

Where to Get Help

Service is available from exclusive distributors worldwide. Contact one of the phone numbers below for product support and technical information or visit us on the web at www.thermo.com/aqi.

1-866-282-0430 Toll Free

1-508-520-0430 International

Contents

Principle of Operation 1 Specifications 1 Chapter 2 Installation 2 Lifting 2 Unpacking and Inspection 2 Setup Procedure 2	-3 -1 -1 -3 -5 -5 -5 -7
Chapter 2 Installation	- 1 -1 -3 -5 -5 -5
2. Unpacking and Inspection	-1 -1 -5 -5 -5
Unpacking and Inspection2	-1 -3 -5 -5 -5
	-3 -5 -5 -7
	-3 -5 -5 -7
	-5 -5 -7
Connecting External Devices	-5 -5 -7
Terminal Board PCB Assemblies	-7
I/O Terminal Board	
D/O Terminal Board	-8
25-Pin Terminal Board	
Startup	
Chapter 3 Operation	-1
Display	
Pushbuttons	
Soft Keys	
Software Overview	
Power-Up Screen	
Run Screen	
Main Menu	
Range Menu	
Single Range Mode	
Dual Range Mode	
Autorange Mode	
Gas Units	
SO_2 Range	
Set Custom Ranges	
Custom Ranges	
Averaging Time	
Calibration Factors Menu	
SO ₂ Background	
SO ₂ Span Coefficient	
Reset User Calibration Default	8
Calibration Menu	
Calibrate SO ₂ Background	
Calibrate SO ₂ Dattground $3-1$ Calibrate SO ₂ Coefficient $3-1$. 0

Zero/Span Check Menu	. 3-19
Next Time	. 3-20
Period Hours	. 3-20
Zero/Span/Purge Duration Minutes	3-21
Zero/Span Averaging Time	
Zero/Span Ratio	
Instrument Controls Menu	
Flash Lamp	
Datalogging Settings	
Select SREC/LREC	3-23
View Logged Data	
Number of Records	
Date and Time	. 3-24
Erase Log	3-25
Select Content	. 3-25
Choose Item Type	. 3-26
Concentrations	
Other Measurements	. 3-27
Analog Inputs	. 3-27
Commit Content	
Reset to Default Content	. 3-28
Configure Datalogging	
Logging Period Min	
Memory Allocation Percent	
Data Treatment	
Communication Settings	
Baud Rate	
Instrument ID	
Communication Protocol	
Streaming Data Configuration	
Streaming Data Interval	
Choose Item Signal	
Concentrations	
Other Measurements	
Analog Inputs	
RS-232/RS-485 Selection	
TCP/IP Settings	
Use DHCP	
IP Address	
Netmask	
Gateway	
Host Name	
I/O Configuration	
Output Relay Settings	
Logic State	
Instrument State	
instrument state	5-50

Alarms	3-39
Non-Alarm	3-39
Digital Input Settings	3-40
Logic State	3-41
Instrument Action	3-41
Analog Output Configuration	3-41
Select Output Range	
Minimum and Maximum Value	3-42
Choose Signal To Output	3-43
Analog Input Configuration	3-45
Descriptor	
Units	3-46
Decimal Places	3-46
Number of Table Points	3-46
Table Point	3-47
Volts	3-47
User Value	3-47
Temperature Compensation	3-48
Pressure Compensation	3-48
Screen Contrast	3-49
Service Mode	3-49
Date/Time	3-50
Diagnostics Menu	3-50
Program Versions	3-50
Voltages	3-51
Motherboard Voltages	3-51
Interface Board Voltages	
I/O Board Voltages	3-52
Temperatures	3-52
Pressure	3-53
Sample Flow	3-53
Lamp Intensity	3-53
Optical Span Test	3-53
Analog Input Readings	
Analog Input Voltages	3-54
Digital Inputs	3-55
Relay States	
Test Analog Outputs	3-56
Set Analog Outputs	3-56
Instrument Configuration	3-56
Contact Information	3-57
Alarms Menu	3-57
Internal Temperature	
Min and Max Internal Temperature Limits	
Chamber Temperature	
Min and Max Chamber Temperature Limits	

Pressure	3-59
Min and Max Pressure Limits	3-60
Sample Flow	3-60
Min and Max Sample Flow Limits	
Lamp Intensity	3-61
Min and Max Lamp Intensity Limits	3-61
Lamp Voltage	
Min and Max Lamp Voltage Limits	
Zero and Span Check	
Max Zero and Span Offset	
Zero and Span Auto Calibration	
SO ₂ Concentration	
Min and Max SO ₂ Concentration Limits	3-64
Min Trigger	3-64
Service Menu	3-65
Flash Voltage Adjustment	3-65
Initial Flash Reference	
PMT Voltage Adjustment	3-66
Range Mode Select	
Pressure Calibration	
Calibrate Pressure Zero	3-68
Calibrate Pressure Span	3-68
Restore Default Pressure Calibration	3-69
Flow Calibration	3-69
Calibrate Flow Zero	3-69
Calibrate Flow Span	3-70
Restore Default Flow Calibration	3-70
Input Board Test	3-71
Temperature Calibration	3-71
Analog Output Calibration	3-71
Analog Output Calibrate Zero	3-72
Analog Output Calibrate Full-Scale	3-73
Analog Input Calibration	3-73
Analog Input Calibration Zero	3-74
Analog Input Calibrate Full-Scale	3-74
Permeation Oven Settings	3-75
Calibrate Gas Thermistor	3-75
Water Bath	3-75
Resistor	3-76
Calibrate Oven Thermistor	3-76
Permeation Oven Setpoint	3-76
Factory Calibrate Gas Thermistor	3-77
Low and High Points	3-77
Set defaults	3-77
Factory Calibrate Oven Thermistor	3-78
Low and High Points	3-78

	Set defaults	
	Dilution Ratio	
	Display Pixel Test	
	Restore User Defaults	
	Password	
	Set Password	
	Lock Instrument	
	Change Password	
	Remove Password	
	Unlock Instrument	
Chapter 4	Calibration	4-1
-	Zero Gas Generation	
	Commercial Heatless Air Dryers	
	Absorbing Column	
	Calibration Gas Generation	
	Cylinder Gas Dilution	
	Commercial Precision Dilution Systems	
	Permeation Tube System	
	Commercial Permeation Systems	
	Multi-Point Calibration	
	Multipoint Calibration in Dual/Auto Range Mode	
	Zero/Span Check	
Chapter 5	Preventive Maintenance	5-1
•	Safety Precautions	
	Replacement Parts	
	Cleaning the Outside Case	
	Visual Inspection and Cleaning	
	Cleaning the Mirrors	
	Capillary Inspection and Replacement	
	Fan Filter Inspection and Cleaning	
	Sample Particulate Filter Inspection	
	Lamp Voltage Check	
	Leak Test	
	Pump Rebuilding	
Chapter 6	Troubleshooting	6-1
-	Safety Precautions	6-1
	Troubleshooting Guides	
	Board-Level Connection Diagrams	
	Connector Pin Descriptions	
	Service Locations	

	Safety Precautions
	Firmware Updates
	Accessing the Service Mode
	Replacement Parts List
	Cable List
	External Device Connection Components
	Removing the Measurement Bench and Lowering the Partition Panel 7-6
	Fuse Replacement
	Pump Replacement
	Fan Replacement
	Optical Bench Replacement
	Cleaning the Mirrors
	Flash Lamp Replacement
	Flash Lamp Voltage Adjustment
	Flash Trigger Assembly Replacement
	Flash Intensity Assembly Replacement
	Photomultiplier Tube Replacement
	PMT High Voltage Power Supply Replacement
	PMT Voltage Adjustment
	DC Power Supply Replacement
	Analog Output Testing
	Analog Output Calibration
	Analog Input Calibration
	Calibrating the Input Channels to Zero Volts
	Calibrating the Input Channels to Full Scale
	Pressure Transducer Assembly Replacement
	Pressure Transducer Calibration
	Flow Transducer Replacement
	Flow Transducer Calibration
	Heater Assembly Replacement
	Kicker Replacement
	Thermistor Replacement
	Ambient Temperature Calibration
	Input Board Replacement
	I/O Expansion Board (Optional) Replacement
	Digital Output Board Replacement
	Motherboard Replacement
	Measurement Interface Board Replacement
	Front Panel Board Replacement
	LCD Module Replacement
	Service Locations
Chapter 8	System Description8-1
	Hardware
	Hydrocarbon Kicker
	Optics
	1

Flash Lamp	8-3
Condensing Lens	
Mirror Assembly	8-3
Relay Lens	
Light Baffle	8-3
Flash Lamp Trigger Assembly	8-3
Reaction Chamber	
Bandpass Filter	8-4
Photomultiplier Tube	
Photodetector	
Flow Sensor	8-4
Pressure Transducer	8-4
Capillary	8-4
Vacuum Pump	8-4
Software	8-4
Instrument Control	8-4
Monitoring Signals	8-5
Measurement Calculations	8-5
Output Communication	
Electronics	
Motherboard	8-6
External Connectors	8-6
Internal Connectors	8-7
Measurement Interface Board	8-7
Measurement Interface Board Connectors	8-7
Flow Sensor Assembly	8-7
Pressure Sensor Assembly	8-8
Bench Heater	8-8
PMT Power Supply Assembly	8-8
Diagnostic LED	8-8
Input Board	8-8
Digital Output Board	8-8
Front Panel Connector Board	8-8
Flash Trigger Board	8-9
Flash Intensity Board	
I/O Expansion Board (Optional)	
I/O Components	
Analog Voltage Outputs	8-9
Analog Current Outputs (Optional)	
Analog Voltage Inputs (Optional)	8-10
Digital Relay Outputs	
Digital Inputs	
Serial Ports	
RS-232 Connection	8-11
RS-485 Connection	8-12
Ethernet Connection	8-12

	External Accessory Connector	
	Internal Zero/Span and Sample Valves	
Chapter 9	* *	
	Optional Equipment	9-1
	Internal Permeation Span Source	
	Permeation Tube Installation	
	Computation of Concentrations	
	Oven Installation and Configuration	
	Permeation Tube Oven Calibration	
	Setting Perm Oven Temperature	
	Setting Temperature with Water Bath	
	Setting Temperature with Known Resistance	
	Determining Permeation Rate by Weight Loss	
	Determining Release Rate by Transfer Standard	
	Teflon Particulate Filter	
	I/O Expansion Board Assembly	
	25-Pin Terminal Board Assembly	
	Terminal Block and Cable Kits	
	Cables	
	Mounting Options	
Appendix B	C-Link Protocol Commands	B -1
••	Instrument Identification Number	B-1
	Commands	B-2
	Accessing Streaming Data	B-2
	Entering Units in PPB	
	Measurements	B-7
	Alarms	B-11
	Diagnostics	B-14
	Datalogging	
	Calibration	B-23
	Keys/Display	B-26
	Measurement Configuration	B-27
	Hardware Configuration	B-31
	Communications Configuration	B-34
	I/O Configuration	B-38
	Record Layout Definition	B-43
	Format Specifier for ASCII Responses	B-43
	Format Specifier for Binary Responses	B-44
	Format Specifier for Front-Panel Layout	B-44
	Text	B-45
	Value String	B-45

	Alarm Information	B-45
	Translation Table	
	Selection Table	
	Button Designator	
	Examples	
	r	
Appendix C	MODBUS Protocol	C-1
	Serial Communication Parameters	
	TCP Communication Parameters	
	Application Data Unit Definition	
	Slave Address	
	MBAP Header	
	Function Code	
	 Data	
	Error Check	-
	Function Codes	-
	(0x01/0x02) Read Coils / Read Inputs	
	(0x03/0x04) Read Holding Registers / Read Input Registers	
	(0x03/0x04) Read Holding Registers / Read Input Registers	
	(0x05) Force (Write) Single Coil	
	MODBUS Commands Supported	
	11	
Appendix D	Geysitech (Bayern-Hessen) Protocol	D-1
	Serial Communication Parameters	
	TCP Communication Parameters	
	Instrument Address	
	Abbreviations Used	
	Basic Command Structure	
	Block Checksum <bcc></bcc>	D-3
	Geysitech Commands	
	Instrument Control Command (ST)	
	Data Sampling/Data Query Command (DA)	D-4
	Measurements reported in response to DA command	
	Single Range Mode	
	Dual/Auto Range Mode	
	Operating and Error Status	
Appendix E	Standards for Trace Level Analyzers	E-1

Contents

Where to Get Help

Figures

Figure 1–1. Model 43i Trace Level-Enhanced Flow Schematic	1-3
Figure 2–1. Remove the Packing Material	2-2
Figure 2–2. Removing the Shipping Screws	2-2
Figure 2–3. Rear Panel	2-4
Figure 2–4. Atmospheric Dump Bypass Plumbing	2-5
Figure 2–5. I/O Terminal Board Views	2-6
Figure 2–6. D/O Terminal Board Views	2-7
Figure 2–7. 25-Pin Terminal Board Views	2-8
Figure 3–1. Front Panel Display	3-2
Figure 3–2. Front Panel Pushbuttons	3-3
Figure 3–3. Flowchart of Menu-Driven Software	3-5
Figure 3–4. Pinout of Rear Panel Connector in Single Range Mode	3-8
Figure 3–5. Pinout of Rear Panel Connector in Dual Range Mode	
Figure 3–6. Analog Output in Autorange Mode	3-11
Figure 3–7. Pin-Out of Rear Panel Connector in Auto-Range Mode	
Figure 4–1. Cylinder Gas Dilution System	4-3
Figure 4–2. Permeation Tube System	4-4
Figure 5–1. Inspecting and Replacing the Capillary	5-3
Figure 5–1. Inspecting and Cleaning the Fan	
Figure 5–2. Rebuilding the Pump	
Figure 6–1. Board-Level Connection Diagram - Common Electronics	
Figure 6–2. Board-Level Connection Diagram – Measurement System	6-11
Figure 7–1. Properly Grounded Antistatic Wrist Strap	7-2
Figure 7–2. Model 43i Trace Level-Enhanced Component Layout	
Figure 7–3. Removing the Measurement Bench and Lowering the Partition	
Panel	7-7
Figure 7–4. Replacing the Pump	7-9
Figure 7–5. Replacing the Fan	7-10
Figure 7–6. Replacing the Optical Bench	7-12
Figure 7–7. Replacing the Flash Lamp and Flash Trigger Assembly	7-13
Figure 7–8. Replacing the Flash Intensity Assembly	7-16
Figure 7–9. Replacing the PMT	7-17
Figure 7–10. Replacing the PMT High Voltage Power Supply (HVPS)	7-18
Figure 7–11. Replacing the DC Power Supply	
Figure 7–12. Rear Panel Analog Input and Output Pins	
Figure 7–13. Replacing the Pressure Transducer Assembly	7-27

Figure 7–14. Replacing the Flow Transducer	7-30
Figure 7–15. Replacing the Heater Assembly	7-33
Figure 7–16. Replacing the Kicker Assembly	7-34
Figure 7–17. Replacing the Thermistor	7-35
Figure 7–18. Replacing the Input Board	7-37
Figure 7–19. Replacing the I/O Expansion Board (Optional)	7-38
Figure 7–20. Rear Panel Board Connectors	7-39
Figure 7–21. Replacing the Measurement Interface Board	7-42
Figure 7–22. Replacing the Front Panel Board and the LCD Module	7-43
Figure 8–1. Hardware Components	8-2
Figure 9–1. Internal Permeation Span Source Flow Diagram	9-2
Figure 9–2. Cal Oven Therm Resistor Screen	9-5
Figure 9–3. Cal Gas Therm Bath Screen	9-6
Figure 9–4. Cal Gas Therm Resistor Screen	9-7
Figure 9–5. Rack Mount Option Assembly	9-12
Figure 9–6. Bench Mounting	9-13
Figure 9–7. EIA Rack Mounting	9-14
Figure 9–8. Retrofit Rack Mounting	9-15
Figure B–1. Flags	B-10
Figure B–1. Flags	B-1U

Tables

Table 1–1. Model 43 <i>i</i> Trace Level-Enhanced Specifications	1-3
Table 1–2. Model 43i Trace Level-Enhanced Optional Permeation Oven	
Specifications	1-5
Table 2–1. I/O Terminal Board Pin Descriptions	2-6
Table 2–2. D/O Terminal Board Pin Descriptions	2-7
Table 2–3. 25-Pin Terminal Board Pin Descriptions	2-8
Table 3–1. Front Panel Pushbuttons	
Table 3–2. Default Analog Outputs in Single Range Mode	3-8
Table 3–3. Default Analog Outputs in Dual Range Mode	
Table 3–4. Default Analog Outputs in Auto Range Mode	3-12
Table 3–5. Standard Ranges.	3-13
Table 3–6. Analog Output Zero to Full Scale Values	3-43
Table 3–7. Signal Types Group Choices	3-44
Table 6–1. Troubleshooting - Power-Up Failures	6-2
Table 6–2. Troubleshooting - Calibration Failures	6-3
Table 6–3. Troubleshooting - Measurement Failures	6-5
Table 6–4. Troubleshooting - Alarm Messages	6-8
Table 6–5. Motherboard Connector Pin Descriptions	6-12
Table 6–6. Measurement Interface Board Connector Pin Descriptions	6-16
Table 6–7. Front Panel Board Connector Pin Diagram	6-19
Table 6–8. I/O Expansion Board (Optional) Connector Pin Descriptions	6-21
Table 6–9. Digital Output Board Connector Pin Descriptions	6-22
Table 6–10. Input Board Connector Pin Descriptions	6-23
Table 6–11. Flash Trigger Pack Pin Descriptions	6-24
Table 6–12. Flash Intensity Assembly Pin Descriptions	6-24
Table 7–1. Replacement Parts	7-3
Table 7–2. Model 43i Trace Level-Enhanced Cables	7-4
Table 7–3. External Device Connection Components	7-5
Table 7–4. Analog Output Channels and Rear Panel Pin Connections	7-22
Table 7–5. Analog Input Channels and Rear Panel Pin Connections	7-23
Table 8–1. RS-232 DB Connector Pin Configurations Configurations	8-12
Table 8–2. RS-485 DB Connector Pin Configuration	8-12
Table 9–1. Cable Options	
Table 9–2. Color Codes for 25-Pin and 37-Pin Cables	9-10
Table 9–3. Mounting Options	9-11
Table B–1. C-Link Protocol Commands	B-2

Table B–2. Averaging Times	В-8
Table B–3. Alarm Trigger Values	B-14
Table B–4. Record Output Formats	B-19
Table B–5. Stream Time Values	B-23
Table B–6. Standard Ranges	B-28
Table B–7. Extended Ranges	B-28
Table B–8. Contrast Level	B-32
Table B–9. Reply Termination Formats	B-37
Table B–10. Analog Current Output Range Values	B-39
Table B–11. Analog Voltage Output Range Values	B-40
Table B–12. Default Output Assignment	B-41
Table C–1. Read Registers for 43i Trace Level-Enhanced	C-8
Table C-2. Write Coils for 43i Trace Level-Enhanced	C-10
Table C–3. Read Coils for 43i Trace Level-Enhanced	
Table D–1. Operating Status for Model 43 <i>i</i> Trace Level-Enhanced	D-7
Table D-2. Error Status for Model 43i Trace Level-Enhanced	D-7

Chapter 1 Introduction

The Model 43*i* Trace Level-Enhanced Pulsed Fluorescence Analyzer combines proven detection technology, easy to use menu-driven software, and advanced diagnostics to offer unsurpassed flexibility and reliability. The Model 43*i* Trace Level-Enhanced has the following features:

- 320 x 240 graphics display
- Menu-driven software
- Field programmable ranges
- User-selectable single/dual/auto range modes
- Multiple user-defined analog outputs
- Analog input options
- High sensitivity
- Fast response time
- Linearity through all ranges
- Internal sample pump
- Totally self contained
- Insensitive to changes in flow and ambient temperature
- User-selectable digital input/output capabilities
- Standard communications features include RS232/485 and Ethernet
- C-Link, MODBUS, Geysitech (Bayern-Hessen), and streaming data protocols

For details of the analyzer's principle of operation and product specifications, see the following topics:

- "Principle of Operation" on page 1-2 describes the analyzer's operating principles.
- "Specifications" on page 1-3 provides a list of the analyzer's performance specifications.

Thermo Fisher Scientific is pleased to supply this pulsed fluorescence SO₂ analyzer. We are committed to the manufacture of instruments exhibiting

high standards of quality, performance, and workmanship. Service personnel are available for assistance with any questions or problems that may arise in the use of this analyzer. For more information on servicing, see the "Servicing" chapter.

Principle of Operation

The Model 43i Trace Level-Enhanced operates on the principle that SO₂ molecules absorb ultraviolet (UV) light and become excited at one wavelength, then decay to a lower energy state emitting UV light at a different wavelength. Specifically,

 $SO_2 + hv_1 \rightarrow SO_2^* \rightarrow SO_2 + hv_2$

The sample is drawn into the Model 43 *i* Trace Level-Enhanced through the SAMPLE bulkhead, as shown in **Figure 1–1**. The sample flows through a hydrocarbon "kicker," which removes hydrocarbons from the sample by forcing the hydrocarbon molecules to permeate through the tube wall. The SO₂ molecules pass through the hydrocarbon "kicker" unaffected.

The sample then flows into the fluorescence chamber, where pulsating UV light excites the SO_2 molecules. The condensing lens focuses the pulsating UV light into the mirror assembly. The mirror assembly contains eight selective mirrors that reflect only the wavelengths which excite SO_2 molecules.

As the excited SO_2 molecules decay to lower energy states they emit UV light that is proportional to the SO_2 concentration. The bandpass filter allows only the wavelengths emitted by the excited SO_2 molecules to reach the photomultiplier tube (PMT). The PMT detects the UV light emission from the decaying SO_2 molecules. The photodetector, located at the back of the fluorescence chamber, continuously monitors the pulsating UV light source and is connected to a circuit that compensates for fluctuations in the UV light.

As the sample leaves the optical chamber, it passes through a flow sensor, a capillary, and the "shell" side of the hydrocarbon kicker. The sample then flows to the pump and is exhausted out the EXHAUST bulkhead of the analyzer. The Model 43i Trace Level-Enhanced outputs the SO₂ concentration to the front panel display and the analog outputs, and also makes the data available over the serial or Ethernet connection.




Figure 1–1. Model 43i Trace Level-Enhanced Flow Schematic

Specifications

 Table 1–1. Model 43*i* Trace Level-Enhanced Specifications

Preset ranges	0-10, 20, 50, 100, 200, 500, and 1000 ppb
	0-20, 50, 100, 200, 500, 1000, and 2000 μg/m ³
Custom ranges	0-10 to 1000 ppb
	0-20 to 2000 μg/m ³
Zero noise	0.14 ppb RMS (10 second averaging time)
	0.06 ppb RMS (60 second averaging time)
	0.025 ppb RMS (300 second averaging time)
Lower detectable	0.208 ppb (10 second averaging time)
limit	0.12 ppb (60 second averaging time)
	0.05 ppb (300 second averaging time)
Zero drift (24 hour)	< 0.2 ppb
Span drift	\pm 1% full-scale per week

Response time	80 sec (10 second averaging time)		
	110 sec (60 second averaging time)		
	320 sec (300 second averaging time)		
Linearity	\pm 1% of full-scale		
Sample flow rate	0.5 lpm (standard)		
	1.0 lpm (optional)		
Interferences	Less than lower detectable limit except for the following:		
(EPA levels)	$NO < 1$ ppb, M-Xylene $< 1ppb,H_2O < 3\%$ of reading		
Operating temperature	15–35 °C (may be safely operated over the range of 0–45 °C) $^{\rm 1}$		
Power	100 VAC @ 50/60 Hz		
requirements	115 VAC @ 50/60 Hz		
	220-240 VAC @ 50/60 Hz		
	165 watts		
Physical	16.75" (W) X 8.62" (H) X 23" (D)		
dimensions			
Weight	Approximately 48 lbs.		
Analog outputs	6 voltage outputs; 0–100 mV, 1, 5, 10 V (user selectable), 5% of full-scale over/under range, 12 bit resolution, user selectable for measurement input		
Digital outputs	1 power fail relay Form C, 10 digital relays Form A, user selectable alarm output, relay logic, 100 mA @ 200 VDC		
Digital inputs	16 digital inputs, user select programmable, TTL level, pulled high		
Serial Ports	1 RS-232 or RS-485 with two connectors, baud rate 1200–115200, data bits, parity, and stop bits, protocols: C-Link, MODBUS, Geysitech (Bayern-Hessen), and streaming data (all user selectable)		

¹In non-condensing environments. Performance specifications based on operation within 20–30 °C range.

Temperature control	Single Point 45 °C
Temperature stability	± 0.1 °C
Warm-up time	1 hour (permeation device can take 24 to 48 hours to stabilize)
Carrier gas flow	≈ 70 scc/min
Chamber size	Accepts permeation tubes up to 9 cm in total length; 1 cm in diameter
Temperature range	20–30 °C
Physical dimensions	Contained inside the Model 43 <i>i</i> Trace Level-Enhanced
Power requirements	120 VAC @ 50/60 Hz, 50 watts (in addition to the standard Model 43 <i>i</i> Trace Level-Enhanced)

Table 1–2. Model 43i Trace Level-Enhanced Optional Permeation Oven

 Specifications

Introduction Specifications

Chapter 2 Installation

Installation of the Model 43*i* Trace Level-Enhanced includes lifting the instrument, unpacking and inspection, connecting sample, zero, span, and exhaust lines, and attaching the analog outputs to a recording device. The installation should always be followed by instrument calibration as described in the "Calibration" chapter of this manual.

This chapter provides the following recommendations and procedures for installing the instrument:

- Lifting on page 2-1
- Unpacking and Inspection on page 2-1
- Setup Procedure on page 2-3
- Connecting External Devices on page 2-5
- Startup on page 2-9

Lifting

When lifting the instrument, use a procedure appropriate to lifting a heavy object, such as, bending at the knees while keeping your back straight and upright. Grasp the instrument at the bottom in the front and at the rear of the unit. Although one person can lift the unit, it is desirable to have two persons lifting, one by grasping the bottom in the front and the other by grasping the bottom in the rear.




Equipment Damage Do not attempt to lift the instrument by the cover or other external fittings. ▲

Unpacking and Inspection

The Model 43*i* Trace Level-Enhanced is shipped complete in one container. If there is obvious damage to the shipping container when you receive the instrument, notify the carrier immediately and hold for inspection. The carrier is responsible for any damage incurred during shipment.

Use the following procedure to unpack and inspect the instrument.

- 1. Remove the instrument from the shipping container and set it on a table or bench that allows easy access to both the front and rear.
- 2. Remove the cover to expose the internal components.
- 3. Remove the packing material (**Figure 2–1**).



Units without Optional I/O Board

Units with Optional I/O Board

Figure 2–1. Remove the Packing Material

4. Remove the three shipping screws from the pump (**Figure 2–2**).




Figure 2–2. Removing the Shipping Screws

- 5. Check for possible damage during shipment.
- 6. Check that all connectors and circuit boards are firmly attached.
- 7. Re-install the cover.
- 8. Remove any protective plastic material from the case exterior.

Setup Procedure

- Use the following procedure to setup the instrument.
- Connect the sample line to the SAMPLE bulkhead on the rear panel Ensure that the sample line is not contaminated by dirty, wet, or incompatible materials. All tubing should be constructed of FEP Teflon[®], 316 stainless steel, borosilicate glass, or similar tubing with an OD of 1/4-inch and a minimum ID of 1/8-inch. The length of the tubing should be less than 10 feet.

Note Gas must be delivered to the instrument free of particulates. It may be necessary to use the Teflon particulate filter as described in "Teflon Particulate Filter" on page 9-9. ▲

If the sample may contain particulates larger than 5 microns, it should be filtered before introducing it to the instrument. Use a filter (such as Teflon) that does not interact with SO_2 in the sample. If a sample filter is used, all calibrations and span checks must be performed through the filter. The filter element should be replaced regularly to prevent the absorption of SO_2 by trapped material on the filter.

Note Gas must be delivered to the instrument at atmospheric pressure. It may be necessary to use an atmospheric bypass plumbing arrangement as shown in **Figure 2–4** if gas pressure is greater than atmospheric pressure. ▲

- 2. Connect the EXHAUST bulkhead to a suitable vent. The exhaust line should be 1/4-inch OD with a minimum ID of 1/8-inch. The length of the exhaust line should be less than 10 feet. Verify that there is no restriction in this line.
- 3. Connect a suitable recording device to the rear panel connector. For detailed information about connecting to the instrument, refer to:

"Connecting External Devices" on page 2-5

"External Device Connection Components" on page 7-5.

"Terminal Block and Cable Kits" on page 9-9

"Instrument Controls Menu" on page 3-22

For detailed information about troubleshooting a connection, refer to "Analog Output Testing" on page 7-21.

4. Plug the instrument into an outlet of the appropriate voltage and frequency.



WARNING The Model 43i Trace Level-Enhanced is supplied with a threewire grounding cord. Under no circumstances should this grounding system be defeated.




Figure 2–3. Rear Panel




Figure 2–4. Atmospheric Dump Bypass Plumbing

Connecting External Devices

Several components are available for connecting external devices to *i*Series instruments.

These connection options include:

- Individual terminal board PCB assemblies
- Terminal block and cable kits (optional)
- Individual cables (optional)

For detailed information on the optional connection components, refer to the "Optional Equipment" chapter. For associated part numbers, refer to the "Servicing" chapter.


Terminal Board PCB Assemblies


The following terminal board PCB assemblies are available for *i*Series instruments:

- I/O terminal board PCB assembly, 37 pin (standard)
- D/O terminal board PCB assembly, 37 pin (standard)
- 25-pin terminal board PCB assembly, (included with optional I/O Expansion Board)

I/O Terminal Board Figure 2–5 shows the recommended method for attaching the cable to the terminal board using the included tie-down and spacer. Table 2–1 identifies the connector pins and associated signals.

Note All of the I/O available in the instrument are not brought out on this terminal board, if more I/O is desired, an alternative means of connection is required. \blacktriangle







Detail "B"


Assembled Connector

Figure 2–5. I/O Terminal Board Views

Table 2–1. I/O Terminal Board Pin Descriptions

Pin	Signal Description	Pin	Signal Description
1	Analog1	13	Power_Fail_NC
2	Analog ground	14	Power_Fail_COM
3	Analog2	15	Power_Fail_NO
4	Analog ground	16	TTL_Input1
5	Analog3	17	TTL_Input2
6	Analog ground	18	TTL_Input3
7	Analog4	19	TTL_Input4
8	Analog ground	20	Digital ground
9	Analog5	21	TTL_Input5
10	Analog ground	22	TTL_Input6
11	Analog6	23	TTL_Input7
12	Analog ground	24	Digital ground

D/O Terminal Board Figure 2–6 shows the recommended method for attaching the cable to the terminal board using the included tie-down and spacer. **Table 2–2** identifies the connector pins and associated signals.





Assembled Connector

Figure 2–6. D/O Terminal Board Views Table 2–2. D/O Terminal Board Pin Descriptions


Pin	Signal Description	Pin	Signal Description
1	Relay1_ContactA	13	Relay7_ContactA
2	Relay1_ContactB	14	Relay7_ContactB
3	Relay2_ContactA	15	Relay8_ContactA
4	Relay2_ContactB	16	Relay8_ContactB
5	Relay3_ContactA	17	Relay9_ContactA
6	Relay3_ContactB	18	Relay9_ContactB
7	Relay4_ContactA	19	Relay10_ContactA
8	Relay4_ContactB	20	Relay10_ContactB
9	Relay5_ContactA	21	Not Used
10	Relay5_ContactB	22	+24V
11	Relay6_ContactA	23	Not Used
12	Relay6_ContactB	24	+24V


25-Pin Terminal Board





Component Side Viewed from Top of Board





Detail "A"

Detail "B"

Assembled Connector

Figure 2–7. 25-Pin Terminal Board Views Table 2–3. 25-Pin Terminal Board Pin Descriptions

Pin	Signal Description	Pin	Signal Description
1	lOut1	13	Analog_In1
2	Isolated ground	14	Analog_In2
3	lOut2	15	Analog_In3
4	Isolated ground	16	GNDD
5	lOut3	17	Analog_In4
6	Isolated ground	18	Analog_In5
7	lOut4	19	Analog_In6
8	Isolated ground	20	GNDD
9	lOut5	21	Analog_In7
10	Isolated ground	22	Analog_In8
11	lOut6	23	GNDD
12	Isolated ground	24	GNDD

Startup Use the following procedure when starting the instrument.

- 1. Turn the power ON.
- 2. Allow 30 minutes for the instrument to stabilize.
- 3. Set instrument parameters such as operating ranges and averaging times to appropriate settings. For more information about instrument parameters, see the "Operation" chapter.
- 4. Before beginning actual monitoring, perform a multipoint calibration as described in the "Calibration" chapter.

Installation Startup

Chapter 3 Operation

This chapter describes the front panel display, front panel pushbuttons, and menu-driven software.

- "Display" on page 3-2 describes the LCD graphics display.
- "Pushbuttons" on page 3-3 describes the various front panel pushbuttons and the expected key actions for each.
- "Software Overview" on page 3-4 describes the menu-driven software and submenus.
- "Range Menu" on page 3-7 describes the gas units, SO₂ range, and custom ranges.
- "Averaging Time" on page 3-15 describes the averaging period applied to SO₂ measurements.
- "Calibration Factors Menu" on page 3-15 describes the calibration factors used to correct SO₂ measurement readings.
- "Calibration Menu" on page 3-18 describes manual and automatic calibration of zero and span.
- "Instrument Controls Menu" on page 3-22 describes the instrument hardware control and configuration.
- "Diagnostics Menu" on page 3-50 describes the diagnostic information and functions.
- "Alarms Menu" on page 3-57 describes a list of items that are monitored by the analyzer.
- "Service Menu" on page 3-65 describes service related menu items.

Display

The 320 x 240 graphics liquid-crystal display (LCD) shows the sample concentrations, instrument parameters, instrument controls, help, and error messages. Some menus contain more items than can be displayed at one time. For these menus, use and to move the cursor up and down to each item.




Figure 3–1. Front Panel Display



CAUTION If the LCD panel breaks, do not to let the liquid crystal contact your skin or clothes. If the liquid crystal contacts your skin or clothes, wash it off immediately using soap and water. \blacktriangle

Pushbuttons

The Pushbuttons allow the user to traverse the various screens/menus. **Table 3–1** lists the front panel pushbuttons and their functions.




Figure 3–2. Front Panel Pushbuttons

Table 3–1. Front Panel Pushbuttons

Key Name	Function
= Soft Keys	The (soft keys) are used to provide shortcuts that allow the user to jump to user-selectable menu screens. For more information on processing soft keys, see "Soft Keys".
► = Run	The \bigcirc is used to display the Run screen. The Run screen normally displays the SO ₂ concentration.
■ = Menu	The b is used to display the Main Menu when in the Run screen, or back up one level in the menu system. For more information about the Main Menu, see "Main Menu" later in this chapter.
? = Help	The relation is context-sensitive, that is, it provides additional information about the screen that is being displayed. Press relation about the current screen or menu. Help messages are displayed using lower case letters to easily distinguish them from the operating screens. To exit a help screen, press relation or to return to the previous screen, or to return to the Run screen.
 ▲ = Up, Down ▲ = Left, Right 	The four arrow pushbuttons (, , , , , and , and) move the cursor up, down, left, and right or change values and states in specific screens.
= Enter	The is used to select a menu item, accept/set/save a change, and/or toggle on/off functions.

Soft Keys The Soft Keys are multi-functional keys that use part of the display to identify their function at any moment. The function of the soft keys allows immediate access to the menu structure and most often used menus and screens. They are located directly underneath the display and as the keys' functions change this is indicated by user-defined labels in the lower part of the display, so that the user knows what the keys are to be used for.

To change a soft key, place the menu cursor ">" on the item of the selected menu or screen you wish to set. Press → followed by the selected soft key within 1 second of pressing the right-arrow key. The edit soft key prompt will be displayed for configuration for the new label.

Note Not all menu items may be assigned to soft keys. If a particular menu or screen item cannot be assigned, the key assignment screen will not come up upon entering right-arrow-soft key combinations. All items under the Service menu (including the menu itself) cannot be assigned soft keys. ▲



Software Overview

The Model 43i Trace Level-Enhanced utilizes the menu-driven software as illustrated by the flowchart in **Figure 3–3**. The Power-Up screen, shown at the top of the flowchart, is displayed each time the instrument is turned on. This screen is displayed while the instrument is warming up and performing self-checks. After the warm-up period, the Run screen is automatically displayed. The Run screen is the normal operating screen. It displays the SO₂ concentration, depending on operating mode. From the Run screen, the Main Menu can be displayed by pressing **•**. The Main Menu contains a list of submenus. Each submenu contains related instrument settings. This chapter describes each submenu and screen in detail. Refer to the appropriate sections for more information.




Figure 3–3. Flowchart of Menu-Driven Software

Power-Up Screen

The Power-Up screen is displayed on power up of the Model 43*i* Trace Level-Enhanced. The Self-Test is displayed while the internal components are warming up and diagnostic checks are performed.



Run Screen The Run screen displays the SO₂ concentration. The status bar displays time and alarm status, and optional zero/span sample solenoid valves, if installed. The word "SAMPLE" on the bottom left of the display indicates the analyzer has the span/zero valve option and is in "SAMPLE" mode. Other modes appear in the same area of the display as "ZERO" or "SPAN". For more information about the optional solenoid valves, see Chapter 9, "Optional Equipment".

When operating in dual or auto range mode two sets of coefficients are used to calculate the CO "High" and "Low" concentrations. Also, two averaging times are used—one for each range. The title bar indicates which range concentrations are displayed. The words "LOW RANGE CONCENTRATION" on the top of the display indicates that the low concentration is displayed. In dual range mode, pressing the and arrows will toggle between high and low concentrations. The example that follows shows the Run screen in single range mode.

C	ONCENT	RATION		
SO 2		25.	5	PPB
SAMPLE	12	:34	ALF	ARM
RANGE	AVG	DIAGS	ALf	ARM


- **Main Menu** The Main Menu contains a number of submenus. Instrument parameters and features are divided into these submenus according to their function. The concentration appears above the main menu and submenus in every screen. The SERVICE menu is visible only when the instrument is in service mode. For more information on the service mode, see "Service Mode" later in this chapter.
 - Use 🛨 and 🕨 to move the cursor up and down.
 - Press 🗲 to select a choice.
 - Press **•** to return to the top of the Main Menu or **•** to return to the Run screen.



SERVICE PASSWORD

Range Menu The Range menu allows the operator to select the gas units, SO₂ ranges, and to set the custom ranges. The screens that follow show the range menu in single mode and dual/autorange modes. The only difference between the screens are the words "HI" and "LO" to indicate which range is displayed. For more information about the single, dual and auto range modes, see "Single Range Mode", "Dual Range Mode", and "Autorange Mode."

In the Main Menu, choose Range.



Single Range Mode

In the single range mode, there is one range, one averaging time, and one span coefficient.

By default, two SO_2 analog outputs are arranged on the rear panel connector as shown in **Figure 3–4**. See **Table 3–2** for channels and pin connections. Single range mode may be selected from the "Range Mode Select" in the "Service Menu", later in this chapter.




Figure 3–4. Pinout of Rear Panel Connector in Single Range Mode

Channel	Connector Pin	I/O Terminal Pin	Description
1	14	1	SO ₂ Analog Output
2	33	3	SO ₂ Analog Output
3	15	5	None
4	34	7	None
5	17	9	None
6	36	11	None
Ground	16, 18, 19, 35, 37	2, 4, 6, 8, 10, 12	Signal Ground

Table 3–2. Default Analog Outputs in Single Range Mode

Note All channels are user definable. If any customization has been made to the analog output configuration, the default selections my not apply. ▲

Dual Range Mode In the dual range mode, there are two independent analog outputs. These are labelled simply as the "High Range" and the "Low Range". Each channel has its own analog output range, averaging time, and span coefficient.

This enables the sample concentration reading to be sent to the analog outputs at two different ranges. For example, the low SO_2 analog output can be set to output concentrations from 0 to 50 ppb and the high SO_2 analog output set to output concentrations from 0 to 100 ppb.

In addition, each SO₂ analog output has a span coefficient. There are two span coefficients so that each range can be calibrated separately. This is necessary if the two ranges are not close to one another. For example, the low SO₂ range is set to 0-10 ppb and the high SO₂ range is set to 0-1000 ppb.

By default, in the dual range mode, the analog outputs are arranged on the rear panel connector as shown in **Figure 3–5**. See **Table 3–3** for channels and pin connections. Dual range mode may be selected from the "Range Mode Select" in the "Service Menu", later in this chapter.




Figure 3–5. Pinout of Rear Panel Connector in Dual Range Mode

Channel	Connector Pin	I/O Terminal Pin	Description
1	14	1	SO ₂ High Range
2	33	3	SO ₂ Low Range
3	15	5	None
4	34	7	None

Table 3–3. Default Analog O	utputs in Dual	Range Mode
-----------------------------	----------------	------------

Channel	Connector Pin	I/O Terminal Pin	Description
5	17	9	None
6	36	11	None
Ground	16, 18, 19, 35, 37	2, 4, 6, 8, 10, 12	Signal Ground

Note All channels are user definable. If any customization has been made to the analog output configuration, the default selections my not apply. ▲

Autorange Mode The autorange mode switches the SO₂ analog outputs between high and low ranges, depending on the concentration level. The high and low ranges are defined in the Range menu.

For example, suppose the low range is set to 50 ppb and the high range is set to 100 ppb (**Figure 3–6**). Sample concentrations below 50 ppb are output based on low range selection and sample concentrations above 50 ppb are output based on high range selection. When the low range is active, the status output is at 0 volts. When the high range is active, the status output is at half of full-scale.

When the high range is active, the concentration must drop to 95% of the low SO₂ range for the low range to become active.

In addition, each SO₂ analog output has a span coefficient. There are two span coefficients so that each range can be calibrated separately. This is necessary if the two ranges are not close to one another. For example, the low SO₂ range is set to 0-10 ppb and the high SO₂ range is set to 0-1000 ppb.




Figure 3–6. Analog Output in Autorange Mode

By default, in the autorange mode, the analog outputs are arranged on the rear panel connector as shown in **Figure 3–7**. See **Table 3–4** for channels and pin connections. Autorange mode may be selected from "Range Mode Select" in the "Service Menu" later in this chapter.




Figure 3–7. Pin-Out of Rear Panel Connector in Auto-Range Mode

Channel	Connector Pin	I/O Terminal Pin	Description
1	14	1	SO ₂ Analog Output
2	33	3	SO ₂ Status Output half-scale = high range zero scale = low range
3	15	5	None
4	34	7	None
5	17	9	None
6	36	11	None
Ground	16, 18, 19, 35, 37	2, 4, 6, 8, 10, 12	Signal Ground

Table 3–4. Default Analog Outputs in Auto Range Mode

Note All channels are user definable. If any customization has been made to the analog output configuration, the default selections my not apply. ▲

Gas Units


The Gas Units screen defines how the SO₂ concentration readings are expressed. Gas units of parts per billion (ppb), or micrograms per cubic meter (μ g/m³) are available. The μ g/m³ gas concentration is calculated using a standard pressure of 760 mmHg and a standard temperature of 20 °C.

When switching the selected units from ppb or $\mu g/m^3$, the analog ranges all default to the highest range in that mode. For example, when switching from $\mu g/m^3$ to ppb, all the ranges default to 1000 ppb.

Therefore, whenever you change units, you should also check the range settings.

In the Main Menu, choose Range > Gas Units.

Note If the units change from ppb to $\mu g/m^3$ or vice versa, the instrument should be re-calibrated, particularly if the user's standard temperature is different from 20 °C. A display warning will appear that ranges will be defaulted and calibration parameters reset.



SO₂ Range The SO₂ Range screen defines the concentration range of the analog outputs. For example, a SO₂ range of 0–50 ppb restricts the analog output to concentrations between 0 and 50 ppb.

The display shows the current SO_2 range. The next line of the display is used to change the range. The range screen is similar for the single, dual, and autorange modes. The only difference between the screens are the words "High" or "Low" displayed to indicate which range is displayed. The example that follows shows the SO_2 range screen in single mode. For more information about the dual and autorange modes, see "Single Range Mode", "Dual Range Mode", and "Autorange Mode" earlier in this chapter.

Table 3–5 lists the available standard ranges.

In the Main Menu, choose Range > **SO**₂ **Range**.




Table 3–5. Standard Ranges

ppb	µg/m³
10	20
20	50
50	100
100	200
200	500
500	1000
1000	2000

ppb	µg/m³	
C1	C1	
C2	C2	
C3	С3	

C1, C2, and C3 are custom ranges. For more information about custom ranges, see "Set Custom Ranges" that follows.

Set Custom Ranges The Set Custom Ranges menu lists three custom ranges: C1, C2, and C3. Custom ranges are user-defined ranges. Any value between 10 ppb and 1000 ppb can be specified as a range. In the μ g/m³ mode, any value between 20 μ g/m³ and 2000 μ g/m³ can be specified as a range.

In the Main Menu, choose Range > **Set Custom Ranges**.

CUSTOM F CUSTOM CUSTOM CUSTOM	RANGES: RANGE RANGE RANGE	12	55.6 75.0 85.0
RANGE	AVG	DIAGS	ALARM

Custom Ranges The Custom Ranges screen is used to define the custom ranges.

The display shows the current custom range. The next line of the display is used to set the range. To use the custom full-scale range, be sure to select it (Custom range 1, 2, or 3) in the SO_2 Range screen. For more information about selecting ranges, see " SO_2 Range" above.

In the Main Menu, choose Range > Set Custom Ranges > Custom range 1, 2, or 3.

CUSTOM RANGE 1: CURRENTLY: 55.5 SET TO: 000055. ?
 ← MOVE CURSOR ▲ CHANGE VALUE D SAVE
RANGE AVG DIAGS ALARM

Averaging Time

The Averaging Time defines a time period (1 to 300 seconds) during which SO_2 measurements are taken. The average concentration of the readings are calculated for that time period. The front panel display and analog outputs are updated every 10 seconds for averaging times between 10 and 300 seconds. For averaging times of 1, 2, and 5 seconds, the front panel display and analog outputs are updated every second. An averaging time of 10 seconds, for example, means that the average concentration of the last 10 seconds will be output at each update. An averaging time of 300 seconds means that the moving average concentration of the last 300 seconds will be output at each update. Therefore, the lower the averaging time the faster the front panel display and analog outputs respond to concentration changes. Longer averaging times are typically used to smooth output data.

The Averaging Time screen for the single range mode is shown below. In the dual and auto range modes, an averaging time menu is displayed before the averaging time screen. This additional menu is needed because the dual and autorange modes have two averaging times (high and low). The averaging time screen functions the same way in the single, dual, and autorange modes. The following averaging times are available: 1, 2, 5, 10, 20, 30, 60, 90, 120, 180, 240, and 300 seconds.

In the Main Menu, choose Averaging Time.




Calibration Factors Menu

Calibration factors are used to correct the SO_2 concentration readings that the instrument generates using its own internal calibration data. The Calibration Factors menu displays the calibration factors. The screens below show the calibration factors menu in single mode and dual/autorange modes. The only differences between the screens are the words "HI" and "LO" to indicate which range is displayed.

Normally, the instrument is calibrated automatically using the commands listed in the Calibration menu described later in this chapter. However, the instrument can also be calibrated manually using the Calibration Factors menu.

To manually calibrate the instrument, see " SO_2 Background" and " SO_2 Span Coefficient" that follows for more information.

In the Main Menu, choose Calibration Factors.



SO₂ Background The SO₂ Background correction is determined during zero calibration. The SO₂ background is the amount of signal read by the analyzer while sampling zero air. Although the background is expressed in terms of concentration, the background signal is actually the combination of electrical noise and scattered light. Before the analyzer sets the SO₂ reading to zero, it stores this value as the SO₂ background correction.

The SO₂ Background screen is used to perform a manual adjustment of the instruments zero background. As such, the instrument should sample zero air until stable readings are obtained. The display shows the current SO₂ reading. This reading is the SO₂ background signal. The next line of the display shows the SO₂ background correction that is stored in memory and is being used to correct the SO₂ reading. That is, the SO₂ background correction is subtracted from the SO₂ reading.

In the example that follows, the analyzer is reading 1.49 ppb of SO_2 while sampling zero air. The SO_2 background correction is 0.0 ppb. That is, the analyzer is not applying a zero background correction. The question mark is used as a prompt to change the background correction. In this case the background correction must be increased to 1.49 ppb in order for the SO_2 reading to be at 0 ppb.

To set the SO₂ reading in the example that follows to zero, use 1 to increment the SO₂ background correction to 1.49 ppb. As the SO₂ background correction is increased, the SO₂ concentration is decreased. At this point, however, no real changes have been made. To escape this screen without saving any changes, press 1 to return to the Calibration Factors menu or 1 to return to the Run screen. Press 1 to actually set the SO₂ reading to 0 ppb and store the new background correction of 1.49 ppb.

In the Main Menu, choose Calibration Factors > SO₂ Bkg.



SO2 Span Coefficient

The SO_2 span coefficient is usually calculated by the instrument processor during calibration. The span coefficients are used to correct the SO_2 readings and normally has a value near 1.000.

The SO₂ Span Coefficient screen allow the SO₂ span coefficient to be manually changed while sampling span gas of known concentration.

The display shows the current SO_2 concentration reading. The next line of the display shows the SO_2 span coefficient that is stored in memory and is being used to correct the SO_2 concentration. Notice that as the span coefficient value is changed, the current SO_2 concentration reading on the above line also changes. However, no real changes are made to the value stored in memory until \checkmark is pressed. Only proposed changes, as indicated by a question mark prompt, are displayed until \checkmark is pressed.

In dual or autorange modes, "HIGH" or "LOW" is displayed to indicate the calibration of the high or low coefficient.

The example that follows shows the coefficient screen in dual or auto range mode.

Note The concentration value will show ERROR if the measured concentration is not a valid span value (either higher than the selected range, or 0 or lower). \blacktriangle

In the Main Menu, choose Calibration Factors > Hi SO₂ Coef.

HIGH SO2 HIGH SET COEF	S02:	NT: 35.7 1.000 ?
	♣♣ INC/D ♣ SAVE	
RANGE A	VG DIAG	s alarm

Reset User CalibrationThe Reset User Calibration DefaDefaultcalibration configuration values to


The Reset User Calibration Default screen allows the user to reset the calibration configuration values to factory defaults.

In the Main Menu, choose Calibration Factors > Reset User Cal Defaults.



Calibration Menu The Calibration menu is used to calibrate zero and span. The calibration menu is similar for the single, dual, and autorange mode as shown below. The dual and autorange modes have two SO₂ span factors ("HI" and "LO"). This allows each range to be calibrated separately. This is necessary if the two ranges used are not close to one another. For example, a low SO₂ range of 10 ppb and a high SO₂ range of 1000 ppb. For more information about calibration, see Chapter 4, "Calibration".

In the Main Menu, choose Calibration.



Calibrate SO₂
Background
The Calibrate SO₂ Background screen is used to adjust the SO₂
background, or perform a "zero calibration". Before performing a zero calibration, ensure the analyzer samples zero air for at least 5 minutes.
It is important to note the averaging time when calibrating. The longer the averaging time, the more accurate the calibration will be. To be most accurate, use the 300-second averaging time. For more information about calibration, see Chapter 4, "Calibration".

In the Main Menu, choose Calibration > Cal SO₂ Background.



Calibrate SO₂ Coefficient

The Calibrate SO_2 Coefficient screen is used to adjust the SO_2 coefficient and enter the span concentration. The display shows the current SO_2 concentration reading and the current SO_2 range. The next line of the display is where the SO_2 calibration gas concentration is entered.

The SO_2 span coefficient is calculated, stored, and used to correct the current SO_2 reading. For more information about calibration, see Chapter 4, "Calibration". In dual or auto range modes, "HIGH" or "LOW" is displayed to indicate the calibration of the high or low coefficient.

In the Main Menu, choose Calibration > Cal SO₂ Coefficient.




Zero/Span Check Menu

The Zero/Span Check menu is available with the zero/span valve option. It is used to program the instrument to perform fully automated zero and span check or adjustments. Total Duration Hr is the sum of zero, span, and purge duration minutes.

Note Zero and Span Calibration Reset are toggle items that change between yes or no when selected, and present only if auto calibration is installed. ▲

In the Main Menu, choose Calibration > Zero/Span Check.



Next Time The Next Time screen is used to set the initial date and time of the zero/span check. Once the initial zero/span check is performed, the date and of the next zero/span check is calculated and displayed.

In the Main Menu, choose Calibration > Zero/Span Check > Next Time.



Period Hours The Zero/Span Period Hours screen defines the period or interval between zero/span checks. Periods between 0 and 999 hours are acceptable. To turn the zero/span check off, set the period to 0.

In the Main Menu, choose Calibration > Zero/Span Check > **Period Hours**.

ZERO/SPAN PE CURRENTLY: SET TO:	RIOD: 024 HRS 020 HRS ?				
←→ MOVE CURSOR ★↓ CHANGE VALUE ← SAVE					
RANGE AVG	DIAGS ALARM				

Zero/Span/Purge Duration Minutes

The Zero Duration Minutes screen defines how long zero air is sampled by the instrument. The span and purge duration screens look and functions the same way as the zero duration screen, and are used to set how long the span gas and sample gas are sampled by the instrument. Durations between 0 and 60 minutes are acceptable. Each time a zero/span check occurs the zero check is done first, followed by the span check. To perform just a zero check, set the span and purge duration screens to 0 (off). The same applies to perform just a span or purge check.

In the Main Menu, choose Calibration > Zero/Span Check > **Zero, Span** or **Purge Duration Min**.

ZERO DURATION: CURRENTLY: SET TO:	30 MIN 31 MIN ?
←→ MOVE ++ CHANGE VALUE	CURSOR
RANGE AVG DIAGS	ALARM

Zero/Span Averaging Time


The Zero/Span Averaging Time screen allows the user to adjust the zero/span averaging time. The zero/span averaging time is used by the analyzer only when performing an automatic zero, or span check, or calibration. The analyzer's averaging time is used for all other functions. The following averaging times are available: 1, 2, 5, 10, 20, 30, 60, 90, 120, 180, 240, and 300 seconds.

In the Main Menu, choose Calibration > Zero/Span Check > Zero/Span Avg Sec.



Zero/Span RatioThe Zero/Span Ratio screen is used to adjust the ratio of zeros to spans. For
example, if this value is set to 1, a span check will follow every zero check.
If this value is set to 3, there will be two zero checks between each
zero/span check. This value may be set from 1 to 10, with 1 as default.


In the Main Menu, choose Calibration > Zero/Span Check > Zero/Span Ratio.



Controls Menu

Instrument The Instrument Controls menu contains a number of items. The software controls listed in this menu enable control of the listed instrument functions.

In the Main Menu, choose Instrument Controls.




SERVICE MODE TIME

Flash Lamp The Flash Lamp screen is used to turn the flash lamp on or off. The flash lamp must be off when using the optical span test LED. For more information about the optical span test LED, see "Optical Span Test" later in this chapter.

In the Main Menu, choose Instrument Controls > Flash Lamp.




Datalogging
SettingsThe Datalogging Settings menu deals with datalogging.In the Main Menu, choose Instrument Controls > Datalogging Settings.



Select SREC/LREC The Select SREC/LREC is used to select short record or long record format for other operations in this menu.

In the Main Menu, choose Instrument Controls > Datalogging Settings > Select SREC/LREC.



View Logged Data The View Logged Data screen is used to select the start point to view the logged data by number or records or date and time.

In the Main Menu, choose Instrument Controls > Datalogging Settings > Select SREC or LREC > View Logged Data.

SELECT	START	POINT	BY:
SET	TO:	# OF RE	ECS
★ ₽ CH	IANGE	← A(CEPT
RANGE	AVG	DIAGS	ALARM

Number of Records

The Number of Records screen is used to select the starting record to display the number of records back to view.



The Record Display screen (read only) displays the selected records.

10:01 10:02 10:03 10:04	06/20, 06/20, 06/20, 06/20,	/05 FC0088 /05 FC0088	3900 3900 3900
RANGE	AVG	DIAGS ALA	ARM

Date and Time The Date and Time screen is used to set a start date and time for which to view logged data. For example, if "20 JUN 2005 10:00" is entered, then the first logged data record that is displayed is the first record after this time. If set to one minute logging, this would be at "20 JUN 2005 10:01".

DATE AN 20 JUN ▲● CHG	2005		3
➡ SET	CURŜO	R TO MO SHOWN	ONTHS
RANGE	AVG	DIAGS	ALARM

The Record Display screen (read only) displays the selected records.

time 10:01 10:02 10:03 10:04 10:04	date 06/20, 06/20, 06/20, 06/20, 06/20, 00/20,	/05 FC0088900 /05 FC0088900	
RANGE	AVG	DIAGS ALARM	

Erase Log The Erase Log is used to erase all saved data for the selected record type (not all short records and long records).

In the Main Menu, choose Instrument Controls > Datalogging Settings > **Erase Log**.



Select Content The Select Content submenu displays a list of 32 record fields to use and a submenu list of the analog output signal group choices to choose from. Choices are Concentrations, Other Measurements, and Analog Inputs (if the I/O expansion board is installed). This is a temporary list of items for the selected record type that must be committed via the datalogging menu before the changes will apply. Note that committing any changes to this list will erase all currently logged data, as the format of the stored data is changed.

In the Main Menu, choose Instrument Controls > Datalogging Settings > **Select Content**.

LREC F >FIELD FIELD FIELD FIELD FIELD FIELD FIELD FIELD FIELD	ELDS:	SO2 HISO2 INTT RCTT PRES SMPLFL PMTV
RANGE	AVG	DIAGS ALARM

Choose Item Type The Choose Item Type submenu is a list of the type of data that can be logged for the current field. Choices are Concentrations, Other Measurements, and Analog Inputs (if the I/O expansion board is installed).

In the Main Menu, choose Instrument Controls > Datalogging Settings > Select Content > Field 1-32.


CONCEN.	TRATI(1EASUR	REMENTS	
RANGE	AVG	DIAGS	ALARM

Note The ANALOG INPUTS item is only displayed if the I/O Expansion Board option is installed. ▲

Concentrations The Concentrations screen allows the user to select the output signal that is tied to the selected field item. The selected item is shown by "<---" after it. Note that at this point, pressing \frown indicates that these are proposed changes as opposed to implemented changes. To change the selected record format and erase record log file data, see "Commit Content" that follows. Range Status is visible only in auto range mode.


In the Main Menu, choose Instrument Controls > Datalogging Settings > Select Content > Select Field > **Concentrations**.

Operation Instrument Controls Menu




Other Measurements The Other Measurements screen allows the user to select the output signal that is tied to the selected field item. The selected item is shown by "<--" after it. Items displayed are determined by the options installed. Note that at this point, pressing indicates that these are proposed changes as opposed to implemented changes. To change the selected record format and erase record log file data, see "Commit Content" that follows.

In the Main Menu, choose Instrument Controls > Datalogging Settings > Select Content > Select Field > **Other Measurements**.



Analog Inputs The Analog Inputs screen allows the user to select the output signal (none or analog inputs 1-8) that is tied to the selected field item. The selected item is shown by "<---" after it. Note that at this point, pressing ← indicates that these are proposed changes as opposed to implemented changes. To change the selected record format and erase record log file data, see "Commit Content" that follows.

In the Main Menu, choose Instrument Controls > Datalogging Settings > Select Content > Select Field > **Analog Inputs**.



Commit Content The Commit Content screen is used to save the selected output signal that is tied to the selected field item. If no changes have been made "NO CHANGES TO RECORD LIST!" will appear. For more information about selecting the analog output signal group choices, see "Commit Content" in this chapter.

In the Main Menu, choose Instrument Controls > Datalogging Settings > **Select Content**.



Reset to Default Content The Reset to Default Content screen is used to reset all of the datalogging field items to default values. For more information about selecting the analog output signal group choices, see "Select Content" in this chapter.

In the Main Menu, choose Instrument Controls > Datalogging Settings > **Reset to Default Content**.

RESET LREC DATA AND ERASE LREC LOG FILE DATA? ← RESET '	RESET LREC DATA AND ERASE LREC LOG FILE DATA?
RANGE AVG DIAGS ALARM	RANGE AVG DIAGS ALARM

Configure Datalogging The Configure Datalogging menu deals with datalogging configuration for the currently selected record type.

In the Main Menu, choose Instrument Controls > Datalogging Settings > Configure Datalogging.

>LÓGGIN MEMORY	<u>G</u> PERI	ATION %	OFF
RONGE	AVA	DTARS	ALARM

Logging Period Min The Logging Period Min screen is used to select the logging period in minutes for the record format (srec or lrec). List of choices include: off, 1, 5, 15, 30, and 60 minutes (default).


In the Main Menu, choose Instrument Controls > Datalogging Settings > Configure Datalogging > Logging Period Min.

SET PERIOD FOR CURRENTLY: SET TO:	R SREC: OFF MIN 60 MIN ?
▲● CHANGE VAL	UE 🕈 SAVE
RANGE AVG	DIAGS ALARM

Memory Allocation Percent

The Memory Allocation Percent screen is used to select the percentage of
 each record type for both srecs and lrecs. Percentages between 0 and 100%
 are available in increments of 10. Changing this value results in log erasure
 for both short records and long records.

In the Main Menu, choose Instrument Controls > Datalogging Settings > Configure Datalogging > Memory Allocation %.



Data Treatment The Data Treatment screen is used to select the data type for the selected record type: whether the data should be averaged over the interval, the minimum or maximum measured during the interval, or the current value (last value measured). Data treatment doesn't apply to all data, just to the concentration measurement. All other data points log the current value at the end of the interval.

In the Main Menu, choose Instrument Controls > Datalogging Settings > Configure Datalogging > **Data Treatment**.

SET LRE CURREN SET) TYPE:	AVG CUR ?
♦ ₽ CHAI	NGE VAL	UE 🕈	SAVE
RANGE	AVG	DIAGS (ALARM

Communication Settings


The communication Settings menu is used with communications control and configuration.

In the Main Menu, choose Instrument Controls > Communication Settings.

COMMUNI >BAUD R	CATION ATE	SETTIN	4GS:
INSTRUI COMMUN			COL
STREAM RS-232	7RS-489	TA CONF 5 SELEC	IG
TCP/IP	SETTI	IGS	
RANGE	AVG	DIAGS	ALARM

Baud Rate The Baud Rate screen is used to set the RS-232/RS-485 interface baud rate. Baud rates of 1200, 2400, 4800, and 9600, 19200, 38400, 57600, and 115200 are available.

In the Main Menu, choose Instrument Controls > Communication Settings > **Baud Rate**.



Instrument IDThe Instrument ID screen allows the operator to edit the instrument ID.
The ID is used to identify the instrument when using the C-Link or
MODBUS protocols to control the instrument or collect data. It may be
necessary to edit the ID number if two or more of the same instruments are
connected to one computer. Valid Instrument ID numbers are from 0 to
127. The Model 43*i* Trace Level-Enhanced has a default Instrument ID of
43. For more information about the Instrument ID, see Appendix B "C-
Link Protocol Commands" or Appendix C "MODBUS Protocol".

In the Main Menu, choose Instrument Controls > Communication Settings > Instrument ID.

INSTRUMENT CURRENTLY: SET TO:	ID	•	43 50	?
1		CHANGE SAVE VA		
RANGE AVE		DIAGS	ALARM	

Communication Protocol The Communication Protocol screen is used to change the instrument communication protocol for serial communications.

In the Main Menu, choose Instrument Controls > Communication Settings > Communication Protocol.

CURRENT		I PROTOCOL: CLINK STREAMING ?
	‡ ₩	CHANGE VALUE SAVE VALUE
RANGE	AVG	DIAGS ALARM

Streaming DataThe SConfigurationof theformationformation

The Streaming Data Configuration menu is used to allow for configuration of the 8 streaming data output items, streaming interval, current data format, and current timestamp setting. The Choose Item Signal submenu displays a list of the analog output signal group choices to choose from. Choices are Concentrations, Other Measurements, and Analog Inputs (if the I/O expansion board option is installed).


Note Add Labels and Prepend Timestamp are toggle items that change between yes or no when selected. ▲

In the Main Menu, choose Instrument Controls > Communication Settings > **Streaming Data Config**.

> INTERV	BELS	FA CONF 10 ESTAMP	G: SEC SEC SEC SEC SEC SEC SEC SEC SEC SEC	¥
RANGE	AVG	DIAGS	ALARM	
ITEM 5 ITEM 6 ITEM 7 ITEM 8		St	1PLFL NONE NONE NONE	

Streaming Data Interval The Streaming Data Interval screen is used to adjust the streaming data interval. The following interval times are available: 1, 2, 5, 10, 20, 30, 60, 90, 120, 180, 240, and 300 seconds.

In the Main Menu, choose Instrument Controls > Communication Settings > Streaming Data Config > **Streaming Data Interval**.



Choose Item SignalThe Choose Signal screen displays a submenu list of the analog output
signal group choices. Group choices are Concentrations, Other
Measurements, and Analog Inputs (if the I/O expansion board is installed).

In the Main Menu, choose Instrument Controls > Communication Settings > Streaming Data Config > **Item 1-8**.

CONCENTRATIONS OTHER MEASUREMENTS ANALOG INPUTS				
RANGE	AVG	DIAGS	ALARM	

Concentrations The Concentrations screen allows the user to select the output signal that is tied to the selected streaming data item. The selected item is shown by "<---" after it. In dual or auto range mode, "HI" or "LO" is displayed to indicate high or low concentrations. Range Status is also visible in auto range mode


In the Main Menu, choose Instrument Controls > Communication Settings > Streaming Data Config > Select Item > **Concentrations**.



Other Measurements

The Other Measurements screen allows the user to select the output signal that is tied to the selected streaming data item. The selected item is shown by "<--" after it. In dual or auto range mode, "HI" or "LO" is displayed to indicate high or low range concentrations.

In the Main Menu, choose Instrument Controls > Communication Settings > Streaming Data Config > Select Item > **Other Measurements**.



PMT VOLTS FLASH VOLTS FLASH REF

Analog Inputs The Analog Inputs screen allows the user to select the analog input signal (none or analog inputs 1-8) that is tied to the selected streaming data item. The selected item is shown by "<---" after it.

In the Main Menu, choose Instrument Controls > Communication Settings > Streaming Data Config > Select Item > **Analog Inputs**.

ANALOG >NONE	INPUTS:		
INPUT INPUT	1 2		<
ÎNPŬT INPUT	34		
ÎNPŬ† INPUT	5 6		Ŧ
RANGE	AVG	DIAGS	ALARM

INPUT 7 INPUT 8


RS-232/RS-485 Selection

The RS-232/RS-485 Selection screen allows the user to choose between the RS-232 or RS-485 specification for serial communication.



Equipment Damage Disconnect the serial cable before changing RS-232 and RS-485 selection to prevent damage to the connected equipment.


In the Main Menu, choose Instrument Controls > Communication Settings > RS-232/RS-485 Selection.



TCP/IP Settings The TCP/IP Settings menu is used for defining TCP/IP settings.


Note The instrument power must be cycled after this parameter has been changed for the change to take effect. ▲

In the Main Menu, choose Instrument Controls > Communication Settings > TCP/IP Settings.




Use DHCP The Use DHCP screen is used to specify whether to use DHCP or not. When DHCP is enabled, the network dynamically provides an IP address for the instrument. The instrument's power must be cycled for a change to this parameter to take affect.

> In the Main Menu, choose Instrument Controls > Communication Settings > TCP/IP Settings > Use DCHP.




IP Address The IP Address screen is used to edit the IP address. The IP address can only be changed when DHCP is OFF. For more information on DHCP, see "Use DHCP" above.

In the Main Menu, choose Instrument Controls > Communication Settings > TCP/IP Settings > **IP Address**.




Netmask The Netmask screen is used to edit the netmask. The netmask is used to determine the subnet for which the instrument can directly communicate to other devices on. The netmask can only be changed when DHCP is OFF. For more information on DHCP, see "Use DHCP" in this chapter.

In the Main Menu, choose Instrument Controls > Communication Settings > TCP/IP Settings > Netmask.



Gateway The Default Gateway screen is used to edit the gateway address. The default gateway can only be changed when DHCP is OFF. For more information on DHCP, see "Use DHCP" in this chapter. Any traffic to addresses that are not on the local subnet will be routed through this address.

In the Main Menu, choose Instrument Controls > Communication Settings > TCP/IP Settings > Gateway.



Host Name The host name screen is used to edit the host name. When DHCP is enabled, this name is reported to the DHCP server.

In the Main Menu, choose Instrument Controls > Communication Settings > TCP/IP Settings > Host Name.

I	HOST NAME: CURRENT:	ISERIES	
	ABCDEF	GHIJKLMN UVWXYZ	? BKSP PAGE
		56789 ./-	SAVE

I/O Configuration

The I/O Configuration menu deals with configuration of the analyzer's I/O system. The analog input configuration is displayed only if the I/O expansion board option is installed.

Note The digital outputs may take up to one second after the assigned state occurs to show up on the outputs. ▲


Note Analog Input Config is only displayed if the optional I/O Expansion Board is installed. \blacktriangle

In the Main Menu, choose Instrument Controls > I/O Configuration.

I/O CONF >OUTPUT DIGITAL ANALOG ANALOG	FIGURA RELAY - INPU OUTPU INPUT	SETTINGS T SETTINGS
RANGE	AVG	DIAGS ALARM

Output Relay Settings The Output Relay Settings menu displays a list of the 10 digital output relays available, and allows the user to select the instrument parameter or logic state to change for the relay selected.

In the Main Menu, choose Instrument Controls > I/O Configuration > Output Relay Settings > **1-10**.



Logic State The Logic State screen is used to change the I/O relay to either normally open or normally closed.

Press *to toggle and set the logic state between open and closed.*

OUTPUT >LOGIC INSTRU	STATE		OPEN
RANGE	AVG	DIAGS	ALARM

Instrument State The Instrument State submenu allows the user to select the instrument state that is tied to the selected relay output. A submenu lists signal types of either alarm and non-alarm to choose from.

In the Main Menu, choose Instrument Controls > I/O Configuration > Output Relay Settings > Select Relay > **Instrument State**.

CHOOSE > ALARMS NON-AL		TYPE:	
RANGE	AVG	DIAGS	ALARM

Alarms The Alarms status screen allows the user to select the alarm status for the selected relay output. The selected item is shown by "<--" after it.


In the Main Menu, choose Instrument Controls > I/O Configuration > Output Relay Settings > Select Relay > Instrument State > Alarms.

Note The I/O BD STATUS alarm is only present if the I/O expansion board is installed. ZERO CHK/CAL and SPAN CHK/CAL are only present if autozero/span check is enabled. ▲



Non-Alarm The Non-Alarm status screen allows the user to select the non-alarm status for the selected relay output. The selected item is shown by "<--" after it.

In the Main Menu, choose Instrument Controls > I/O Configuration > Output Relay Settings > Relay 1-10 > Instrument State > **Non-Alarm**.




SAMPLE MODE SO2 MODE PURGE MODE

Digital Input Settings The Digital Input Settings menu displays a list of the 16 digital inputs available, and allows the user to select the instrument parameter or logic state to change for the relay selected.

Note The digital inputs must be asserted for at least one second for the action to be activated. \blacktriangle

In the Main Menu, choose Instrument Controls > I/O Configuration > Digital Input Settings.



Logic State The Logic State screen is used to change the I/O relay to either normally open or normally closed. The default state is open, which indicates that a relay connected between the digital input pin and ground is normally open and closes to trigger the digital input action. If nothing is connected to the digital input pin, the state should be left at open to prevent the action from being triggered.

Press 🖝 to toggle and set the logic state open or closed.

DIGITAL >LOGIC INSTRU	STATE		OPEN
RANGE	AVG	DIAGS	ALARM

Instrument Action The Instrument Action screen allows the user to select the instrument state that is tied to the selected digital input.

In the Main Menu, choose Instrument Controls > I/O Configuration > Digital Input Settings > Select Relay > **Instrument State**.

CHOOSE ACTION: >NONE ZERO MODE SPAN MODE	<
SET BACKGROUND CAL TO LO SPAN AOUTS TO ZERO	÷
RANGE AVG DIAGS	ALARM

AOUTS TO FS CAL TO HI SPAN

Analog OutputTConfigurationor

The Analog Output Configuration menu displays a list of the analog output channels available for configuration. Channel choices include all voltage channels, all current channels, voltage channels 1-6, and current channels 1-6 (if the I/O expansion board option is installed). Configuration choices include selecting range, setting minimum/maximum values, and choosing signal to output. **Note** The current outputs are displayed only if the I/O expansion board option is installed. ▲

In the Main Menu, choose Instrument Controls > I/O Configuration > **Analog Output Config.**

OUTPUT CHANNELS: > ALL VOLTAGE CHANNELS ALL CURRENT CHANNELS VOLTAGE CHANNEL 1 VOLTAGE CHANNEL 2 VOLTAGE CHANNEL 3 VOLTAGE CHANNEL 4 VOLTAGE CHANNEL 5	ANALOG OUTPUT CONFIG: >SELECT RANGE SET MINIMUM VALUE SET MAXIMUM VALUE CHOOSE SIGNAL TO OUTPUT
RANGE AVG DIAGS ALARM	RANGE AVG DIAGS ALARM
VOLTAGE CHANNEL 6 CURRENT CHANNEL 1 CURRENT CHANNEL 2	

Select Output Range The Select Output Range screen is used to select the hardware range for the selected analog voltage output channel. Possible ranges for the voltage outputs are: 0-100 mV, 0-1, 0-5, 0-10 V.

In the Main Menu, choose Instrument Controls > I/O Configuration > Analog Output Config > Select Channel > **Select Range**.

SELECT OUTPUT RANGE: SELECTED OUTPUT: V 1 CURRENTLY: 0-10V SET TO: 0-5V ?
★↓ CHANGE VALUE
RANGE AVG DIAGS ALARM

Minimum and Maximum Value

CURRENT CHANNEL

RRENT CHANNEL RRENT CHANNEL

RENT CHANNEL

3 4

5

The Minimum Value screen is used to edit the zero (0) to full-scale (100) value in percentages for the selected analog output channel. See Table 3-7 for a list of choices. In dual or auto range mode, "HI" or "LO" is displayed to indicate high or low concentrations. Range Status is visible only in auto range mode. The minimum and maximum output value screens function the same way. The example that follows shows the set minimum value screen.

In the Main Menu, choose Instrument Controls > IO Configuration > Analog Output Config > Select Channel > **Set Minimum** or **Maximum Value**.

MINIMUM OUTPUT SELECTED OUTPU CURRENTLY: SET TO:	
↑ ₽ CHANGE VALU	JE 🕈 SAVE
RANGE AVG [)IAGS ALARM

Table 3–6. Analog Ou	utput Zero to Full Scale Values
----------------------	---------------------------------

Output	Zero % Value	Full-Scale 100% Value
S02	Zero (0)	Range Setting
L0 S02	Zero (0)	Range Setting
HI SO2	Zero (0)	Range Setting
Range SO2	Recommend not to change the set	tting for this output
Internal Temp	User-set alarm min value	User-set alarm max value
Chamber Temp	User-set alarm min value	User-set alarm max value
Perm Oven Gas Temp	Perm Oven Gas alarm min value	Perm Oven Gas alarm max value
Perm Oven Heater Temp	Perm Oven Heater alarm min value	Perm Oven Heater alarm max value
Pressure	User-set alarm min value	User-set alarm max value
Sample Flow	User-set alarm min value	User-set alarm max value
PMT Volts	700 volts	1100 volts
Flash Voltage	User-set alarm min value	User-set alarm max value
Flash Reference	User-set alarm min value	User-set alarm max value
Everything Else	0 units	10 units

Choose Signal To Output

The Choose Signal To Output screen displays a submenu list of the analog output signal group choices. Group choices are Concentrations, Other Measurements, and Analog Inputs (if the I/O expansion board is installed). This allows the user to select the output signal to the selected output channel. In dual or auto range mode, "HI" or "LO" is displayed to indicate high or low concentrations. Range (SO₂) is visible only in auto range mode. The Concentrations screen is shown below. See Table 3-8 that follows for a list of items for each signal group choice.

In the Main Menu, choose Instrument Controls > I/O Configuration > Analog Output Config > Select Channel > **Choose Signal To Output**.





Table 3–7. Signal Types Group Choices

Concentrations	Other Measurements	Analog Inputs	
None	None	None	
SO2 (single/auto range only)	Internal Temperature	Analog Input 1	I/O Expansion Board installed
LO SO2 (dual range only)	Chamber Temperature	Analog Input 2	I/O Expansion Board installed
HI SO2 (dual/auto range only)	Perm Oven Gas	Analog Input 3	I/O Expansion Board installed
Range Status (auto range only	Perm Oven Heater	Analog Input 4	I/O Expansion Board installed
02 %	Chamber Pressure	Analog Input 5	I/O Expansion Board installed
SO2 COR	Sample Flow	Analog Input 6	I/O Expansion Board installed
LO SO2 COR (dual/auto range only)	PMT Volts	Analog Input 7	I/O Expansion Board installed
HI SO2 COR (dual/auto range only)	Flash Volts	Analog Input 8	I/O Expansion Board installed
SO2 BKG	Flash Ref		I/O Expansion Board installed

Concentrations	Other Measurements	Analog Inputs	
LO SO2 COEF			
HI SO2 COEF			

Analog Input Configuration The Analog Input Configuration menu displays a list of the 8 analog input channels available for configuration. This screen is only displayed if the I/O expansion board option is installed. Configuration includes entering descriptor, units, decimal places, and choice of 2-10 table points, and corresponding number of points selected.

In the Main Menu, choose Instrument Controls > I/O Configuration > **Analog Input Config**.



CHANNEL 8

IN8

Descriptor The Descriptor screen allows the user to enter the descriptor for the selected analog input channel. The descriptor is used in datalogging and streaming data to report what data is being sent out. The descriptor may be from 1 to 3 characters in length, and defaults to IN1to IN8 (user input channel number).

In the Main Menu, choose Instrument Controls > I/O Configuration > Analog Input Config > Select Channel > **Descriptor**.

ANAL	.0G (INPU <u>T</u>	DESCRIP	PTOR:
	aRí	DEEGH		RKSP
	ÖP	ĴŔŜŤŨŴ	ŴŶŶŹ	PAGE
	01:	234567	89 ./-	SAVE
RAŀ	√GE	AVG	DIAGS	ALARM

Units The Units screen allows the user to enter the units for the selected analog input channel. The units are displayed on the diagnostic screen and in datalogging and streaming data. The units may be from 1 to 3 characters in length, and defaults to V (volts).

In the Main Menu, choose Instrument Controls > I/O Configuration > Analog Input Config > Select Channel > **Units**.

I	ANALOG		UNITS:	
			ЧІЈКЦММ	BKSP PAGE
		QRSTU 23456	789 ./-	r Hae SAVE
L	RANGE	AVG	DIAGS	Alarm

Decimal Places The Decimal Places screen allows the user to select how many digits are displayed to the right of the decimal, from 0 to 6, with a default of 2.

In the Main Menu, choose Instrument Controls > I/O Configuration > Analog Input Config > Select Channel > **Decimal Places**.



Number of Table Points The Number of Table Points screen allows the user to select how many points are used in the conversion table. The points range from 2 to 10, with a default of 2.

In the Main Menu, choose Instrument Controls > I/O Configuration > Analog Input Config > Select Channel > **Table Points**.





Table PointThe Table Point submenu allows the user to set up an individual table
point.

In the Main Menu, choose Instrument Controls > I/O Configuration > Analog Input Config > **Table Point 1-10**.


TABLE P >YOLTS USER V		01	CONFI	ø.	00 00
RANGE	AVG	C	IAGS	AL	ARM

Volts The Volts screen allows the user to set the input voltage for the selected table point in the conversion table, from 0.00 to 10.50. The default table is a two-point table with point 1: 0.00 V = 000.0 U and point 2: 10.00 V = 10.0 U.

In the Main Menu, choose Instrument Controls > I/O Configuration > Analog Input Config > Select Table Point > **Volts**.



In the Main Menu, choose Instrument Controls > I/O Configuration > Analog Input Config > Select Table Point > **User Value**.




Temperature Compensation

Temperature compensation provides compensation for any changes to the instrument's output signal due to internal instrument temperature variations. The effects of internal instrument temperature changes on the analyzer's subsystems and output have been empirically determined. This empirical data is used to compensate for any changes in temperature. This compensation can be used for special applications, or when operating the instrument outside the recommended temperature range.

When temperature compensation is on, the first line of the display shows the current internal instrument temperature (measured by a thermistor on the Interface board). When temperature compensation is off, the first line of the display shows the factory standard temperature of 30 °C.

In the Main Menu, choose Instrument Controls > Temperature Compensation.



Pressure Compensation

Pressure compensation provides compensation for any changes to the instrument's output signal due to reaction chamber pressure variations. The effects of reaction chamber pressure changes on the analyzer's subsystems and output have been empirically determined. This empirical data is used to compensate for any change in reaction chamber pressure.

When pressure compensation is on, the display represents the current pressure in the fluorescence chamber. When pressure compensation is off, the display shows the factory standard pressure of 750 mmHg.

In the Main Menu, choose Instrument Controls > **Pressure Compensation**.



Screen Contrast The Screen Contrast screen is used to change the contrast of the display. Values between 0 and 100% in increments of 10 are available. Changing the screen contrast may be necessary if the instrument is operated at extreme temperatures.

In the Main Menu, choose Instrument Controls > Screen Contrast.



Service Mode The Service Mode screen is used to turn the service mode on or off. The service mode locks out any remote actions and includes parameters and functions that are useful when making adjustments or diagnosing the Model 43*i* Trace Level-Enhanced. For more information about the service mode, see "Service Menu" later in this chapter.


Note The service mode should be turned off when finished, as it prevents remote operation. \blacktriangle

In the Main Menu, choose Instrument Controls > Service Mode.



Date/Time The Date/Time screen and allows the user to view and change the system date and time (24-hour format). The internal clock is powered by its own battery when instrument power is off.


In the Main Menu, choose Instrument Controls > Date/Time.



Diagnostics Menu

The Diagnostics menu provides access to diagnostic information and functions. This menu is useful when troubleshooting the instrument. The analog input readings and analog input voltages are only displayed if the I/O expansion board option is installed.

In the Main Menu, choose Instrument Controls > Diagnostics.



ANALOG INPUT READINGS ANALOG INPUT VOLTAGES DIGITAL INPUTS RELAY STATES TEST ANALOG OUTPUTS INSTRUMENT CONFIGURATION CONTACT INFORMATION

Program Versions

The Program Versions screen (read only) shows the version numbers of the programs installed. Prior to contacting the factory with any questions regarding the instrument, please note the product model program version numbers.

In the Main Menu, choose Diagnostics > **Program Versions**.

PROGRAM	VERS	IONS:
PROD	UCT:	MODEL 43iTLE
VERS	IONS:	01.02.22.104
FIRM	WARE:	07.92.19
RANGE	AVG	DIAGS ALARM

Voltages The Voltages menu displays the current diagnostic voltage readings. This screen enables the power supply to be quickly read for low or fluctuating voltages without having to use a voltage meter. The I/O board item is only displayed if the I/O expansion board is installed.

In the Main Menu, choose Diagnostics > Voltages.



Motherboard Voltages The Motherboard screen (read only) is used to display the current voltage readings on the motherboard.

In the Main Menu, choose Diagnostics > Voltages > Motherboard Voltages.

MOTHER 550 1043 -3	30ARD Y(SUPPLY SUPPLY SUPPLY SUPPLY SUPPLY SUPPLY	DLTAGES: 36 16 24 -3	.0 V .А V
RANGE	AVG	DIAGS A	LARM

Interface Board Voltages

The Interface Board screen (read only) is used to display the current voltage readings on the interface board.


In the Main Menu, choose Diagnostics > Voltages > Interface Board Voltages.

INTERF PMT FLASH 5.0 15.0	ICE BOAF SUPPLY SUPPLY SUPPLY SUPPLY SUPPLY SUPPLY	2D VOLTAGES: 612.5 V 1000.0 V 3.3 V 5.0 V 15.0 V
-15.0 24.0	SUPPLY SUPPLY	-15.0 V 24.0 V
RANGE	AVG	DIAGS ALARM

I/O Board Voltages

The I/O Board screen (read only) is used to display the current voltage readings on the I/O expansion board. This menu is only accessible if the I/O expansion board is installed.

In the Main Menu, choose Diagnostics > Voltages > I/O Board Voltages.



Temperatures The Temperatures screen (read only) displays the current internal instrument temperature and chamber temperature. The internal temperature is the air temperature measured by a sensor located on the interface board.

In the Main Menu, choose Diagnostics > **Temperatures**.

TEMPERATURES: >INTERNAL 34.6 °C CHAMBER 49.7 °C PERM OVEN GAS 45.0 °C PERM OVEN HTR 45.0 °C
RANGE AYG DIAGS ALARM

Pressure The Pressure screen (read only) displays the current optical bench pressure. The pressure is measured by a pressure transducer in-line with the optical bench.

In the Main Menu, choose Diagnostics > **Pressure**.

PRESSURE:		753.0 mmH		
RANGE	AVG	DIAGS	ALARM	

Sample Flow The Sample Flow screen (read only) displays the current sample flow rate. The flows is measured by an internal flow sensor.

In the Main Menu, choose Diagnostics > Flow.

SAMPLE	FLOW:	0.500 LPM	
RANGE	AVG	DIAGS ALARM	

Lamp Intensity The Lamp Intensity screen (read only) displays the current lamp intensity in Hertz. Normally the intensity would read 90%, but this number will decrease over time as the lamp degrades.

In the Main Menu, choose Diagnostics > Lamp Intensity.

LAMP	INTI	ENSIT	Υ :	90	%
RANG	ie (₽VG	DIAGS	ALAF	SM

Optical Span Test

The Optical Span Test screen is used to turn the optical span test LED on or off, and displays the SO2 concentration reading. Within the fluorescence chamber is a light emitting diode (LED) which may be used to simulate a particular concentration of SO₂. It is designed to provide a quick and easy way of checking the optics and electronics for span drift or other problems.

In the Main Menu, choose Diagnostics > Optical Span Test.



Analog Input Readings

The Analog Input Readings screen (read only) displays the 8 current userscaled analog readings (if the I/O expansion board option is installed).

In the Main Menu, choose Diagnostics > Analog Input Readings.

ANALOG >NO CO2 FL1 WND FL2 IO7	INPUT	READINGS: 10.2 PPB 18.2 PPB 250 PPM 20.42 LPM 9.86 V 1.865 LPM 0.0 V
RANGE	AVG	DIAGS ALARM
108		0.0 V

Analog Input Voltages


The Analog Input Voltages screen (read only) displays the 8 raw analog voltage readings (if the I/O expansion board option is installed).

In the Main Menu, choose Diagnostics > Analog Input Voltages.

	ANALOG ANALOG ANALOG ANALOG ANALOG ANALOG ANALOG ANALOG ANALOG	NPUT120346367	VOLTAGES: 6.24 V 4.28 V 0.00 V 0.00 V 0.00 V 0.00 V 0.00 V 0.00 V
	RANGE	AVG	DIAGS ALARM
_	ANALOG	IN 8	0.00 V

Digital Inputs The Digital Inputs screen (read only) displays the state of the 16 digital inputs.

In the Main Menu, choose Diagnostics > **Digital Inputs**.



Relay States The Relay States screen displays the state of the 10 digital outputs and allows toggling of the state to either on (1) or off (0). The relays are restored to their original states upon exiting this screen.

In the Main Menu, choose Diagnostics > Relay States.


Press 🖝 to toggle the relay state open and closed.

RELAY ST OUTPUT OUTPUT OUTPUT OUTPUT OUTPUT OUTPUT OUTPUT	FATE: 12/04/04/04/07	
RANGE	AVG	DIAGS ALARM
OUTPUT OUTPUT OUTPUT	8 9 10	0 0 0

Test Analog Outputs

The Test Analog Outputs menu contains a number of digital to analog converter (DAC) calibration items. Channel choices include all analog outputs, 6 voltage channels, and 6 current channels (if the I/O expansion board option is installed).


In the Main Menu, choose Diagnostics > Test Analog Outputs.





Set Analog Outputs The Set Analog Outputs screen contains three choices: Set to full-scale, set to zero, or reset to normal. Full-scale sets the analog outputs to the full-scale voltage, zero sets the analog outputs to 0 volts, and normal operation. The example that follows shows the selected output state "ALL" is set to full-scale.

In the Main Menu, choose Diagnostics > Test Analog Outputs > ALL, Voltage Channel 1-6, or Current Channel 1-6.



Instrument Configuration

The Instrument Configuration screen displays information on the hardware configuration of the instrument.

In the Main Menu, choose Diagnostics > Instrument Configuration.

Note If the analyzer is in service mode, pressing \frown on the item will toggle it yes or no (with the exception of dilution ratio and auto calibration, which may only be enabled at the factory).

>I70 EX ZERO/S PERM 0 DILUTI	PANSI(PAN V(VEN ON	ONFIGURE ON BOARD ALVES ATION	ATION: YES YES YES YES YES
RANGE	AVG	DIAGS	ALARM

Contact Information

The Contact Information screen displays the customer service information.
 In the Main Menu, choose Diagnostics > Contact Information.

CONTACT	INFOR	MATION:	l
CALL C	ENTER:	508-52	20-0430
WE8:	W	WW.THER	RWO.COM
noucer	000	NTOOC	
RANGE	AVG	DIH@2	ALARM


Alarms Menu

The alarms menu displays a list of items that are monitored by the analyzer. If the item being monitored goes outside the lower or upper limit, the status of that item will go from "OK" to either "LOW" or "HIGH", respectively. If the alarm is not a level alarm, the status will go from "OK" to "FAIL". The number of alarms detected is displayed to indicate how many alarms have occurred. If no alarms are detected, the number zero is displayed.

To see the actual reading of an item and its minimum and maximum limits, move the cursor to the item and press $(\frown$.

Items displayed are determined by the options displayed. The zero/span check and auto calibration screens are visible only if the zero/span check or auto calibration options are enabled. The motherboard status, interface board status, and I/O expansion board status (if installed) indicates that the power supplies are working and connections are successful. There are no setting screens for these alarms.

In the Main Menu, choose Alarms.



Internal Temperature

The internal temperature screen displays the current internal temperature and sets the minimum and maximum alarm limits. Acceptable alarm limits range from 8 to 47 \boxtimes C. If the internal temperature reading goes beyond either the minimum or maximum alarm limit, an alarm is activated. The word "ALARM" appears in the Run screen and in the Main Menu.

In the Main Menu, choose Alarms > Internal Temp.

INTERNAL ACTUAL >MIN MAX	TEMPERA	FURE: 30.1 8.0 47.0	°C °C
RANGE A	AVG DIF	AGS ALA	RM

Min and Max Internal Temperature Limits

The Minimum Internal Temperature alarm limit screen is used to change the minimum internal temperature alarm limit. The minimum and maximum internal temperature screens function the same way.

In the Main Menu, choose Alarms > Internal Temp > Min or Max.



Chamber Temperature


The Chamber Temperature screen displays the current chamber temperature and sets the minimum and maximum alarm limits. The chamber temperature is regulated at 45.0 degrees C. Acceptable alarm limits range from 43 to 47 °C. If the chamber temperature reading goes beyond either the minimum or maximum limit, an alarm is activated. The word alarm appears in the Run screen and in the Main Menu.

In the Main Menu, choose Alarms > Chamber Temp.

CHAMBER ACTUAL >MIN MAX	TEMPER	43.1	
RANGE	AVG	DIAGS AI	_ARM

Min and Max Chamber Temperature Limits The Minimum Chamber Temperature alarm limit screen is used to change the minimum chamber temperature alarm limit. The minimum and maximum internal temperature screens function the same way.


In the Main Menu, choose Alarms > Chamber Temp > Min or Max.



Pressure

The Pressure screen displays the current reaction chamber pressure reading and sets the minimum and maximum alarm limits. Acceptable alarm limits range from 400 to 1000 mmHg. If the pressure reading goes beyond either the minimum or maximum limit, an alarm is activated. The word "ALARM" appears in the Run screen and in the Main Menu.


In the Main Menu, choose Alarms > Pressure.



Min and Max Pressure Limits

The Minimum Pressure alarm limit screen is used to change the minimum pressure alarm limit. The minimum and maximum pressure screens function the same way.

In the Main Menu, choose Alarms > Pressure > Min or Max.



Sample Flow The Sample Flow screen displays the current sample flow reading and sets the minimum and maximum alarm limits. Acceptable alarm limits range from 0 to 2.5 LPM. If the sample flow reading goes beyond either the minimum or maximum limit, an alarm is activated. The word "ALARM" appears in the Run screen and in the Main Menu.

In the Main Menu, choose Alarms > Sample Flow.

SAMPLE F ACTUAL >MIN MAX	LOW:	0.550 0.000 1.000	LPM LPM LPM
RANGE	AVG	DIAGS A	LARM


Min and Max Sample
Flow LimitsThe Minimum Sample Flow alarm limit screen is used to change the
minimum sample flow alarm limit. The minimum and maximum sample
flow screens function the same way.

In the Main Menu, choose Alarms > Sample Flow > Min or Max.

SAMPLE FLOW: ACTUAL MIN: SET MIN TO:	0.250 LPM 0.300 LPM ?
	INC/DEC SAVE VALUE
RANGE AVG	DIAGS ALARM


Lamp Intensity The Lamp Intensity screen displays the current lamp intensity reading and sets the minimum and maximum alarm limits. Acceptable alarm limits range from 20 to 100 percent. If the lamp intensity reading goes beyond either the minimum or maximum limit, an alarm is activated. The word "ALARM" appears in the Run screen and in the Main Menu.

In the Main Menu, choose Alarms > Lamp Intensity.



Lamp The Minimum Lamp Intensity alarm limit screen is used to change the minimum lamp intensity alarm limit. The minimum and maximum lamp intensity screens function the same way.

In the Main Menu, choose Alarms > Lamp Intensity > Min or Max.



Min and Max Lamp Intensity Limits

Lamp Voltage The Lamp Voltage screen displays the current lamp voltage and sets the minimum and maximum alarm limits. Acceptable alarm limits range from 500 to 1200 volts. If the lamp voltage goes beyond either the minimum or maximum limit, an alarm is activated. The word "ALARM" appears in the Run screen and in the Main Menu.

In the Main Menu, choose Alarms > Lamp Voltage.

LAMP VOL ACTUAL >MIN MAX	_TAGE:	1000 V 750 V 1200 V
RANGE	AVG	DIAGS ALARM

Min and Max Lamp
Voltage LimitsThe Minimum Lamp Voltage alarm limit screen is used to change the
minimum lamp voltage alarm limit. The minimum and maximum lamp
voltage screens function the same way.

In the Main Menu, choose Alarms > Lamp Voltage > Min or Max.

LAMP VOI ACTUAL SET MII	MIN:	: 750 ¥ 700 ¥ ?
		INC/DEC SAVE VALUE
RANGE	AVG	DIAGS ALARM

Zero and Span Check

The Zero Span Check screen allows the user to view the status of the most recent zero check and set the maximum zero check offset. The zero and span check screens are visible only if the zero/span check option is enabled and function the same way.

In the Main Menu, choose Alarms > Zero or Span Check.



Max Zero and Span OffsetThe Max Zero Check Offset screen is used to change the maximum zero
check offset. The maximum zero and span offset screens function the same
way.

In the Main Menu, choose Alarms > Zero or Span Check > Max Offset.



The Zero Auto Calibration screen (read only) allows the user to view the status of the most recent auto background calibration. The zero and span auto calibration screens are visible only if the auto calibration option is enabled and function the same way.

In the Main Menu, choose Alarms > Zero or Span Autocal.


	ÂL	TO CI ARM NSE	8	[BRAT	IOŀ	¦: OK 1∙2	
RANG	E	AVG		DIAG	S F	LARM	

SO₂ **Concentration** The SO₂ Concentration screen displays the current SO₂ concentration and sets the maximum alarm limit. Acceptable alarm limits range from 0 to 1000 ppb or 2000 μ g/m³. The minimum alarm may be programmed as a floor trigger (alarm is triggered when the concentration falls below the minimum value) or a ceiling trigger (alarm is triggered when the concentration goes above the minimum value). If the SO₂ concentration

Zero and Span Auto Calibration

goes beyond either the minimum or maximum limit, an alarm is activated. The word "ALARM" appears in the Run screen and in the Main Menu.

In the Main Menu, choose Alarms > SO₂ Concentration.



Min and Max SO₂ Concentration Limits

The Minimum SO₂ Concentration alarm limit screen is used to change the minimum SO₂ concentration alarm limit. The minimum and maximum SO₂ concentration alarm limit screens function the same way.

In the Main Menu, choose Alarms > SO₂ Concentration> Min or Max.



Min Trigger The Minimum Trigger screen allows the user to view and set the SO₂ concentration alarm trigger type to either floor or ceiling. The minimum alarm may be programmed as a floor trigger (alarm is triggered when the concentration falls below the minimum value) or a ceiling trigger (alarm is triggered when the concentration goes above the minimum value).

In the Main Menu, choose Alarms > SO₂ Concentration > Min Trigger.


MIN TRIG(CEILI ACTUAL TRIGGE SET TRIGGER T	R: CEILING
+ TOGGLE AND	SAVE VALUE
RANGE AVG	DIAGS ALARM

Service Menu The Service menu appears only when the instrument is in the service mode. To put the instrument into the service mode:

In the Main Menu, choose Instrument Controls > Service Mode.

Advanced diagnostic functions are included in the service mode. Meaningful data should not be collected when the instrument is in the service mode. In dual or auto range modes, "HI" or "LO" multi-point calibration is displayed to indicate the calibration of the high or low concentrations.

In the Main Menu, choose Service.





Flash Voltage Adjustment

The Flash Voltage Adjustment screen allows the user to manually adjust the flasher supply voltage. The flash voltage adjustment screen is visible only when the instrument is in service mode. For more information on the service mode, see "Service Mode" earlier in this chapter.

Note This adjustment should only be performed by an instrument service technician. ▲

In the Main Menu, choose Service > Flash Voltage Adjustment.



Initial Flash Reference

The Initial Flash Reference allows the user to view and set the initial flash reference. The initial flash reference screen is visible only when the instrument is in service mode. For more information on the service mode, see "Service Mode" earlier in this chapter.

Note This adjustment should only be performed by an instrument service technician. \blacktriangle

In the Main Menu, choose Service > Initial Flash Reference.

PMT Voltage Adjustment The PMT Voltage Adjustment screen is used to manually adjust the PMT supply voltage. The PMT voltage adjustment is visible only when the instrument is in service mode. For more information on the service mode, see "Service Mode" earlier in this chapter.

Note This adjustment should only be performed by an instrument service technician. \blacktriangle

In the Main Menu, choose Service > PMT Voltage Adjustment.



Range Mode Select

The Range Mode Select screen is used to switch between the various range modes: single, dual, and autorange.

In the Main Menu, choose Service > **Range Mode Select**.

RANGE MU CURREN SET	TLY:	ELECT: SINGLE DUAL ?
		CHANGE VALUE SAVE VALUE
RANGE	AVG	DIAGS ALARM

Pressure Calibration

The Pressure Calibration menu is used to calibrate the pressure sensor to zero, span, or restore factory default values. The pressure calibration is visible only when the instrument is in service mode. For more information on the service mode, see "Service Mode" earlier in this chapter.

The pressure sensor's zero counts and span slope are displayed on the menu

Note This adjustment should only be performed by an instrument service technician. \blacktriangle

In the Main Menu, choose Service > Pressure Calibration.

PRESSUR >ZERO SPAN SET DE			100 1.2200
RANGE	AVG	DIAGS	ALARM

Calibrate Pressure Zero The Calibrate Pressure Zero screen calibrates the pressure sensor at zero pressure.

Note A vacuum pump must be connected to the pressure sensor before performing the zero calibration. ▲

In the Main Menu, choose Service > Pressure Calibration > Zero.

CALIBRATE PRES	SURE ZERO: 0.0 mmHg 0.0 mmHg ?
CONNECT VACUL	
RANGE AVG	DIAGS ALARM

Calibrate Pressure Span The Calibrate Pressure Span screen allows the user to view and set the pressure sensor calibration span point.

Note The plumbing going to the pressure sensor should be disconnected so the sensor is reading ambient pressure before performing the span calibration. The operator should use an independent barometer to measure the ambient pressure and enter the value on this screen before calibrating. ▲

In the Main Menu, choose Service > Pressure Calibration > **Span**.

CALIBRATE PRE:	SSURE SPAN:
CURRENTLY:	756.0 mmHg
SET TO:	760.0 mmHg ?
◆ →	MOVE CURSOR
↑ ↓ CHANGE VA	LUE ↔ SAVE
RANGE AVG	DIAGS ALARM

Restore Default Pressure
CalibrationThe Restore Default Pressure Calibration screen allows the user to reset the
configuration values to factory defaults.

In the Main Menu, choose Service > Pressure Calibration > **Set Defaults**.



Flow Calibration The Flow Calibration menu is used to calibrate the flow sensor to zero, span, or restore factory default values. The flow calibration is visible only when the instrument is in service mode. For more information on the service mode, see "Service Mode" earlier in the chapter.

Note This adjustment should only be performed by an instrument service technician. ▲

In the Main Menu, choose Service > Flow Calibration.

FLOW SEI >ZERO SPAN SET DEI	NSOR C	:	200 1.0000
RANGE	AVG	DIAGS	ALARM

Calibrate Flow Zero The Calibrate Flow Zero screen calibrates the flow sensor at zero flow.

Note The pump must be disconnected before performing the zero calibration. ▲

In the Main Menu, choose Service > Flow Calibration > **Zero**.

CALIBRATE FLOW CURRENTLY: SET TO:	ZERO: 0.000 LPM 0.000 LPM ?	
DISCONNECT PUMP AND ✔ SAVE ZERO PRESSURE		
RANGE AVG I	DIAGS ALARM	

Calibrate Flow Span The Calibrate Flow Span screen allows the user to view and set the flow sensor calibrate span point.

Note An independent flow sensor is required to read the flow, then the operator enters the flow value on this screen to perform the calibration. ▲

In the Main Menu, choose Service > Flow Calibration > **Span**.



Restore Default Flow
CalibrationThe Restore Default Flow Calibration screen allows the user to reset the
configuration values to factory defaults.


In the Main Menu, choose Service > Flow Calibration > **Set Defaults**.



Input Board Test The Input Board Test screen is used to manually adjust the input board gain. The input board test is visible only when the instrument is in service mode. For more information on the service mode, see "Service Mode" earlier in the chapter.

Note This adjustment should only be performed by an instrument service technician. \blacktriangle

In the Main Menu, choose Service > Input Board Test.



Temperature
CalibrationThe Temperature calibration screen allows the user to view and set the
ambient temperature sensor calibration. The temperature calibration is
visible only when the instrument is in service mode. For more information
on the service mode, see "Service Mode" earlier in the chapter.

Note This adjustment should only be performed by an instrument service technician. ▲

In the Main Menu, choose Service > **Temperature Calibration**.

CALIBRATE AMB	IENT TEMP:
CURRENTLY:	30.0 °C
SET TO:	25.0 °C?
♦	MOVE CURSOR
♦ CHANGE VA	LUE 🕈 SAVE
RANGE AVG	DIAGS ALARM

Analog Output Calibration


The Analog Output Calibration menu is a selection of analog output to calibrate, and allows the user to select the calibration action zero or span. The analog output calibration is visible only when the instrument is in

service mode. For more information on the service mode, see "Service Mode" earlier in the chapter.

Notes This adjustment should only be performed by an instrument service technician. ▲

Current channels are visible only if the I/O expansion board is installed.

In the Main Menu, choose Service > Analog Output Calibration > Voltage Channel 1-6 or Current Channel 1-6.




CURRENT	CHANNEL	
CURRENT	CHANNEL	3
CURRENT	CHANNEL	4
CURRENT	CHANNEL	5
CURRENT	CHANNEL	6

Analog Output Calibrate Zero

The Analog Output Calibrate Zero screen allows the user to calibrate the zero state of the selected analog output. The operator must connect a meter to the output and adjust the output until it reads 0.0 V on the meter.

In the Main Menu, choose Service > Analog Output Calibration > Selected Channel > Calibrate Zero.



Analog Output Calibrate Full-Scale

The Analog Output Calibrate Full-Scale screen allows the user to calibrate the full-scale state of the selected analog output. The operator must connect a meter to the output and adjust output until it reads the value shown in the set output to: field.

In the Main Menu, choose Service > Analog Output Calibration > Selected Channel > Calibrate Full Scale.

SET SAVE		PUT: ↑↓ It	SPAN TPUT! 3697 IC/DEC 10 V
RANGE	AVG	DIAGS	ALARM

Analog Input
CalibrationThe Analog Input Calibration menu is a selection of analog input to
calibration action zero or span.
The analog input calibration is visible only when the instrument is in
service mode. For more information on the service mode, see "Service
Mode" earlier in the chapter.

Note This screen is present only when the I/O expansion board is installed. \blacktriangle

Note This adjustment should only be performed by an instrument service technician. \blacktriangle

In the Main Menu, choose Service > Analog Input Calibration > Input Channel 1-8.

ANALOG INPUT CAL: >INPUT CHANNEL 1 INPUT CHANNEL 2 INPUT CHANNEL 3 INPUT CHANNEL 4 INPUT CHANNEL 5 INPUT CHANNEL 6 INPUT CHANNEL 7	ANALOG INPUT CAL: >CALIBRATE ZERO CALIBRATE FULL SCALE
	RANGE AVG DIAGS ALARM
RANGE AVG DIAGS ALARM	KANUL AYU VIAUDALAKII

INPUT CHANNEL 8

Analog Input Calibration Zero

The Analog Input Calibrate Zero screen allows the user to calibrate the zero state of the selected analog input.

In the Main Menu, choose Service > Analog Input Calibration > Select Channel > **Calibrate Zero**. (Hook up a voltage source of 0 V to the analog input channel.)

ANALOG I DISCONNE SELECTE CURRENT	ĈT ŜE D INP	LECTED UT: I	
← CALIE	RATE	INPUT T	O ZERO
RANGE	AVG	DIAGS	ALARM

Analog Input Calibrate Full-Scale

The Analog Input Calibration Full-Scale screen allows the user to calibrate the full-scale state of the selected analog input.

In the Main Menu, choose Service > Analog Input Calibration > Select Channel > Calibrate Full Scale. (Hook up a voltage source of 10 V to the analog input channel.)

ANALOG INPUT CA PROVIDE VOLTAGE SELECTED INPUT CURRENTLY: SET TO: CALIBRA	F: INPUT 1 9.80 V 10.00 V ?
RANGE AYG	IAGS ALARM

Permeation Oven Settings

The Permeation Oven Settings menu is used for setting up and calibrating the permeation oven option. The permeation oven settings menu is visible only when the instrument is in service mode. For more information on the service mode, see "Service Mode" earlier in the chapter.

Note This adjustment should only be performed by an instrument service technician. \blacktriangle

In the Main Menu, choose Service > Perm Oven Settings.


CAL GAL CAL O	/EN THI)VEN SI }Y CAL	RMISTOR ERMISTOR ELECTION GAS THE	RM HERM
RANGE	AVG	DIAGS	ALARM

Calibrate Gas Thermistor The Calibrate Gas Thermistor submenu is used for calibrating the permeation oven gas thermistor using a water bath or known resistance.

In the Main Menu, choose Service > Perm Oven Settings > Cal Gas Thermistor > Water Bath or Known Resistor.

CALIBRA >WATER KNOWN			ISTOR:
RANGE	AVE	DIAGS	ALARM

Water Bath The Calibrate Gas Thermistor Water Bath screen allows the user to view and set the permeation oven gas temperature to a known temperature value.



Resistor The Calibrate Gas Thermistor Resistance screen allows the user to view and set the permeation oven gas thermistor resistance to a known resistor value.

CAL GAS THERM	(RESISTOR): 3850 Ohms 04002 Ohms
	MOVE CURSOR ILUE ← SAVE
RANGE AVG	DIAGS ALARM

Calibrate Oven
ThermistorThe Calibrate Oven Thermistor menu is used to view and set the
permeation oven thermistor resistance to a known resistor value.

In the Main Menu, choose Service > Perm Oven Settings > Cal Oven Thermistor.

CAL OVEN THERM (RESISTOR): CURRENTLY: SET TO : [3850 Ohms 34001 Ohms
◆ CHANGE VALUE	VE CURSOR E 🗣 SAVE (AGS ALARM

Permeation Oven
SetpointThe Permeation Oven Setpoint screen is used to select the permeation oven
state to not present, or the desired temperature choice of 30, 35, and 45
°C.


In the Main Menu, choose Service > Perm Oven Settings > Perm Oven Selection.

PERM OVEN SET CURRENTLY: SET TO:	TPOINT: NOT PRESENT 45 °C ?
	CHANGE VALUE SAVE VALUE
RANGE AVG	DIAGS ALARM

Factory Calibrate Gas Thermistor

The Factory Calibrate Gas Thermistor submenu is used for calibrating the permeation oven gas thermistor to either low point, high point, or set defaults.

In the Main Menu, choose Service > Perm Oven Settings > Factory Cal Gas Therm.



Low and High Points The Calibrate Gas Thermistor Low Point screen allows the user to view and set the permeation oven thermistor resistance. The low and high point screens function the same way.

In the Main Menu, choose Service > Perm Oven Settings > Factory Cal Gas Therm > **Low Point**.

CAL GAS THERM	LOW POINT:
CURRENTLY:	3850 Ohms
SET TO:	04002 Ohms
♦♦	MOVE CURSOR
★↓ CHANGE VAL	_UE
RANGE AVG	DIAGS ALARM

Set defaults The Set Defaults screen allows the user to reset the configuration values to factory defaults.


In the Main Menu, choose Service > Perm Oven Settings > Factory Cal Gas Therm > **Set Defaults**.

	DEFAULT SETTINGS: RM OVEN GAS THERM & RESTORE
	SURE YOU WANT TO? TO CONFIRM RESTORE
RANGE	AVG DIAGS ALARM

Factory Calibrate OvenThe FactorThermistorthe permotion

The Factory Calibrate Oven Thermistor submenu is used for calibrating the permeation oven heater thermistor to either low point, high point, or set defaults.

In the Main Menu, choose Service > Perm Oven Settings > Factory Cal Oven Therm.



Low and High Points The Calibrate Oven Thermistor Low Point screen allows the user to view and set the permeation oven thermistor resistance. The low and high point screens function the same way.

In the Main Menu, choose Service > Perm Oven Settings > Factory Cal Oven Therm > Low Point.

Set defaults The Set Defaults screen allows the user to reset the configuration values to factory defaults.

In the Main Menu, choose Service > Perm Oven Settings > Factory Cal Oven Therm > **Set Defaults**.

RESTORE		T SETTINGS: HTR THERM ✔ RESTORE	
ARE YOU PRESS ➡		OU WANT TO? FIRM RESTORE	
RANGE	AVG I	DIAGS ALARM	

Dilution Ratio The Dilution Ratio screen allows the user to view and set the dilution ratio. Acceptable values are 1–500: 1. The default is 1:1. When this value is set, the dilution ratio is applied to all concentration measurements. This screen is only accessible if the dilution ratio option is installed.

In the Main Menu, choose Service > **Dilution Ratio**.

Display Pixel Test The Display Pixel Test is used to test the LCD display. The display pixel test screen is visible only when the instrument is in service mode. For more information on the service mode, see "Service Mode" earlier in the chapter.

In the Main Menu, choose Service > Display Pixel Test.

DISPLAY PIXEL TEST: DURING TEST PRESS ⑦ OR ► TO EXIT, ← TO TOGGLE
← BEGIN TEST ⑦ GO BACK TO MENU
RANGE AVG DIAGS ALARM

Restore User
DefaultsThe Restore User Defaults screen is used to reset the user calibration and
configuration values to factory defaults. The restore default user is visible
only when the instrument is in service mode. For more information on the
service mode, see "Service Mode" earlier in the chapter.

In the Main Menu, choose Service > Restore User Defaults.

RESTORE USER DEFAULTS:	RESTORE USER DEFAULTS:
← RESTORE	← RESTORE ARE YOU SURE YOU WANT TO? PRESS → TO CONFIRM RESTORE
RANGE AVG DIAGS ALARM	RANGE AVG DIAGS ALARM

Password The Password menu allows the user to configure password protection. If the instrument is locked, none of the settings may be changed via the front panel user interface. The items visible under the password menu are determined by the instrument's password status.

In the Main Menu, choose PasswordSet .



Set Password

The Set Password screen is used to set the password to unlock the front panel. The set password is shown if the instrument is unlocked and the password is set. In the Main Menu, choose Password > **Set Password**.

ENTER N	EW PA	SSWORD:	
<u></u> OP	QRSTU	HIJKLMÞ VWXVZ 789 ./-	PAGE
RANGE	AVG	DIAGS	ALARM

Lock Instrument The Lock Instrument screen is used to lock the instrument's front panel so users can not change any settings from the front panel. The lock instrument screen is shown if the instrument is unlocked and the password is set.

In the Main Menu, choose Password > Lock Instrument.

LOCK FRO PRESS PREVENT CONFIG CONFIG	SING USER FROM		JILL HANGING PANEL TO RUN
RANGE	AVG	DIAGS	ALARM

Change Password The Change Password is used to set or change the password used to unlock the instrument's front panel. The change password screen is shown if the instrument is unlocked.

In the Main Menu, choose Password > Change Password.

ENTER M	4EW PAS	SSWORD:	
or	oonee o	HIJKLMN	pizep
	PORSTU		BKSP PAGE
		789 ./-	SAVE
RANGE	AVG	DIAGS	ALARM

Remove Password The Remove Password screen is used to erase the current password and disable password protection. The remove password screen is shown if a instrument is unlocked and the password set.	
--	--

In the Main Menu, choose Password > Remove Password.

REMOVE PRES REMOVE AND	SING E CURRE DISABL	ENTER WI ENT PASS	
RANGE	AVG	DIAGS	ALARM

Unlock Instrument

The Unlock Instrument screen is used to enter the password to unlock the front panel. The unlock instrument is shown if the instrument is locked.

In the Main Menu, choose Password > Unlock Instrument

ENTER N	EW PASSWORD):
<u>O</u> P	CDEFGHIJKL QRSTUVWXYZ 23456789 •/	PAGE
RANGE	AVG DIAGS	

Chapter 4 Calibration

The Model 43*i* Trace Level-Enhanced requires initial and periodic calibration according to the procedures described in this chapter. A quality control plan that allows the frequency and number of calibration points to be modified depending on calibration and zero/span check data should be implemented. Such a quality control program is essential to ascertain the accuracy and reliability of the air quality data collected. The data compiled for such a program might include items such as dates of calibration, atmospheric conditions, control settings and other pertinent data. For more detailed quality assurance guidelines, see the *Quality Assurance Handbook for Air Pollution Measurement Systems*, published by the U.S. EPA, Research Triangle Park, NC, 27711.

There are a number of conditions which should be met prior to a calibration or a zero/span check. First, the instrument should have at least 30 minutes to warm up and stabilize. Second, the range used during the calibration or zero/span check should be the same as that used during normal monitoring. Third, all operational adjustments to the instrument should be completed prior to calibration. Fourth, all parts of the gas flow system, such as sample lines, and particulate filters, which are used in normal monitoring should also be used during calibration. Finally, it is recommended that the recording devices and outputs used during normal monitoring be calibrated prior to the instrument calibration and that they be used during the calibration or the zero/span check.

Zero Gas Generation

Commercial Heatless Air Dryers

An SO₂-free (< 0.5 ppb) air supply is required for the proper calibration and checkout of the instrument. There are several methods that are acceptable to generate this zero gas. For more information about generating zero air, See Appendix E, "Standards for Trace Level-Enhanced Analyzers."

Commercial heatless air dryers filled with a mixed bed of activated charcoal and a 13X molecular sieve have been found effective in removing SO_2 from compressed air. The use of this type of zero gas system is recommended when minimum maintenance is of prime importance. This system requires a source of compressed air. Refer to the manufacturer's recommendations for installation of such a system.

Absorbing Column	An absorbing column packed with activated charcoal is acceptable for scrubbing SO_2 from ambient air. Ambient air is forced through a laboratory gas absorption column packed with the charcoal and the SO_2 is removed to acceptable levels (<0.5 ppb). The charcoal should be changed at a minimum of every six months. It may be necessary to change the charcoal more frequently depending on local conditions.
Calibration Gas Generation	A calibration gas system capable of providing accurate levels of SO ₂ calibration gas between zero and 80% of the full-scale range is required. The calibration system must provide a flow rate of at least 0.8 LPM for an instrument with the standard flow (instruments with higher flow rates will require a higher minimum calibration system flow rate). All calibration gas should be derived from local or working standards (such as cylinders of compressed gas or permeation devices) that are certified as traceable to an NIST primary standard.
Cylinder Gas Dilution	A cylinder gas dilution system, shown in Figure 4–1 , can be constructed. All connections between components in the system should be made with glass, Teflon [®] , or other non-reactive material.
	The air flow controller should be capable of maintaining a constant air flow within $\pm 2\%$ of the required flow rate. The SO ₂ flow controller should be capable of maintaining constant SO ₂ flows within $\pm 2\%$ of the required flow rate. Ensure both flow controllers are properly calibrated. The pressure regulator for the standard SO ₂ cylinder must have a non-reactive diaphragm and internal parts and a suitable delivery pressure.




Figure 4–1. Cylinder Gas Dilution System

The exact SO₂ concentration is calculated from:

$$[SO_2]_{OUT} = \frac{[SO_2]_{STD} \times F_{SO_2}}{F_D + F_{SO_2}}$$

Where:

 $[SO_2]_{OUT}$ = diluted SO₂ concentration at the output manifold, ppm

 $[SO_2]_{STD}$ = concentration of the undiluted SO₂ standard, ppm

 F_{SO2} = flow rate of the SO_2 standard corrected to 25 $^{\circ}\mathrm{C}$ and 760 mm Hg

 F_D = flow rate of the dilution air corrected to 25 °C and 760 mm Hg

Commercial Precision Dilution Systems

Commercial precision dilution systems are available which reliably and accurately dilute a high concentration gas mixture to provide a reliable span gas. A high concentration (50 ppm) of SO_2 in air is precisely diluted to the concentration range required.

The Thermo Scientific *Model 146 Multigas Calibration System* is one such system for precision dilution.

Permeation Tube System

Permeation tube systems which precisely maintain a set temperature to within ± 0.1 °C and hold a zero air flow rate to within $\pm 0.5\%$ can be used for generation of span gas. The flow rate of the permeation system must be at least 0.8 LPM for proper operation.

A permeation tube system, shown in **Figure 4–2** can be constructed. All connections between components in the system should be made with glass, Teflon[®], or other non-reactive material.

The air flow controllers should be capable of maintaining a constant air flow within $\pm 2\%$ of the required flow rate. Ensure all devices are properly calibrated and that all flows are corrected to 25 °C and 1 atm.




Figure 4–2. Permeation Tube System

The SO₂ output level is calculated from:

$$[SO_2]_{OUT} = \frac{P \times K}{F_T}$$

Where:

 $[SO_2]_{OUT}$ = SO₂ output concentration in ppm

P = permeation rate in μ g/min

 F_T = total flow rate of gas after mixing chamber (F_P + F_D) in liters/minute

K (SO₂) = 0.382 constant for SO₂ permeant

Commercial Permeation Systems

Commercial permeation systems, such as the Thermo Scientific Model 146 Multigas Calibration System, are available for this requirement. Refer to the instrument instruction manual for more information.

Multi-Point Calibration

Regulations typically require zero/span calibration when the instrument is newly installed, moved, repaired, interrupted for more than a few days, or when span or zero shift by more than 15%.

All gas must be supplied to the instrument at atmospheric pressure. It may be necessary to employ an atmospheric bypass plumbing arrangement to accomplish this. Refer to **Figure 2–4** in the "Installation" chapter for an example of an atmospheric bypass plumbing arrangement.

If a filter is used, all gas must enter the instrument through the filter.

For detailed information about the menu parameters and the icons used in these procedures, see the "Operation" chapter.

Note The calibration and calibration check duration times should be long enough to account for the transition (purge) process when switching from sample to zero and from zero to span. This transition time is the time required to purge the existing air. ▲

Depending on the plumbing configuration and the instrument, data from approximately the first minute of a zero calibration or check should be disregarded because of residual sample air. Also, data from approximately the first minute of a span calibration or check should be disregarded because the span is mixing with the residual zero air.

Use the following procedure to perform a zero/span calibration.

1. If the instrument is equipped with the optional zero/span and sample valves, connect the zero and span gas to the rear panel bulkheads labeled ZERO and SPAN, otherwise connect a source of vented zero air to the SAMPLE bulkhead.

Note Do not use nitrogen for zero air. ▲

▶ is used to activate the zero and span valves. The lower left-hand corner of the Run screen indicates which mode is active: ZERO, SPAN, or SAMPLE.

2. To ensure that the zero air is being measured at atmospheric pressure, check that the zero air flow reported by the analyzer is approximately

0.5 LPM. Actual zero air flow should be 0.8 LPM or more, with the excess flowing out the atmospheric bypass.

- a. From the Run screen, press 🕒 to display the Main Menu.
- b. From the Main Menu, choose Diagnostics > **Flow** to display the Sample Flow screen.
- c. Make sure that the reported sample flow is less than the actual zero air flow.
- 3. Monitor the zero air reading and wait for the reading to stabilize.
- 4. From the Main Menu, choose **Calibration** to display the Calibration menu.
- 5. At the Calibration menu, press to display the SO₂ Background screen, after 10 minutes of zero air and when the reading is stable, press to set the SO₂ reading to zero.

The display flashes the message "SAVING", and the SO_2 reading is added to the background correction. Record the stable zero air reading as Z_{SO_2} .

- 6. Press 🕒 to return to the Calibration menu.
- 7. Connect a source of calibration gas to the SAMPLE bulkhead. The calibration gas concentration should be approximately 80% of the full-scale range.
- 8. To ensure that the calibration gas is being measured at atmospheric pressure, check that the sample flow in the analyzer is approximately 0.5 LPM. Actual sample air flow should be 0.8 LPM or more, with the excess flowing out the atmospheric bypass.
- 9. Sample the vented calibration gas and wait for the instrument reading to stabilize.
- 10. Press → to move the cursor to Cal SO₂ Coefficient, and press
 → to display the Calibrate SO₂ screen.

The first line of the display shows the current SO_2 reading. The SPAN CONC line of the display is where you enter the calibration gas concentration.

11. To enter the calibration gas concentration, use → to move the cursor left and right. Use → to increment and decrement the digit. Press → to calibrate the instrument to the SO2 calibration gas.

The display flashes the message "SAVING", and the corrected SO2 reading is displayed.

12. Press the pushbutton to return to the Run screen. If using a chart recorder hooked up to an analog output channel, the SO2 recorder response will equal:

$$\frac{[SO_2]_{OUT}}{URL} \ge 100 = Z_{SO}$$

Where:

- URL = upper range limit of the analyzer's operating range
- Z_{SO2} = analyzer response to zero air, % fullscale
- 13. For multi-point calibration, generate five SO2 concentrations equally spaced between zero and the concentration above. Record instrument reading for each concentration after allowing time for both gas generation system and instrument to stabilize. Plot a graph of instrument readings against the SO2 concentrations generated. This is the instrument calibration curve. All future measurements should be interpreted using this curve.

Regulations typically require multipoint calibration when the instrument is newly installed, moved, repaired, interrupted for more than a few days, or when span or zero shift by more than 15%.

All gas must be supplied to the instrument at atmospheric pressure. It may be necessary to employ an atmospheric bypass plumbing arrangement to accomplish this.

If a filter is used, all gas must enter the instrument through the filter.

For detailed information about the menu parameters and the icons used in these procedures, see the "Operation" chapter.

Note The calibration and calibration check duration times should be long enough to account for the transition (purge) process when switching from

Multipoint Calibration in Dual/Auto Range Mode

sample to zero and from zero to span. This transition time is the time required to purge the existing air. \blacktriangle

Use the following procedure to perform a multipoint calibration in dual/autorange mode.

1. If the instrument is equipped with the optional zero/span and sample valves, connect the zero and span gas to the rear panel bulkheads labeled ZERO and SPAN, otherwise connect a source of vented zero air to the SAMPLE bulkhead.

Note Do not use nitrogen for zero air. \blacktriangle

▶ is used to activate the zero and span valves from the run screen. The lower left-hand corner of the Run screen indicates which mode is active ZERO, SPAN, or SAMPLE.

- To ensure that the zero air is being measured at atmospheric pressure, check that the zero air flow reported by the analyzer is approximately 0.5 LPM. Actual zero air flow should be 0.8 LPM or more, with the excess leaving out the atmospheric bypass.
 - a. From the Run screen, press **•** to display the Main Menu.
 - b. From the Main Menu choose, Diagnostics > **Flow** to display the Sample Flow screen.
 - c. Make sure that the reported sample flow is less than the actual zero air flow.
- 3. Press to monitor the zero air reading and wait for the reading to stabilize.
- 4. Press and choose Calibration > **SO**₂ **Background** to display the SO₂ Background screen.
- 5. When the reading stabilizes, press (\frown) to set the SO₂ reading to zero.

The display flashes the message "SAVING", and the SO_2 reading is added to the background correction. Record the stable zero air reading as Z_{SO2} .

6. Press **•** to return to the Calibration menu.

- 7. Connect a source of calibration gas to the SAMPLE bulkhead. The calibration gas should be approximately 80% of the high full-scale range.
- 8. To ensure that the calibration gas is being measured at atmospheric pressure, check that the flow reported by the analyzer is approximately 0.8 LPM. Actual sample flow should be 0.8 LPM or more, with the excess flowing out the atmospheric bypass.
- 9. Sample the calibration gas and wait for the instrument reading to stabilize.
- 10. Use → to move the cursor to **Calibrate HI SO2**, and press ← to display the Calibrate HI SO₂ screen.

The first line of the display shows the current SO_2 reading. The second line of the display is where you enter the high calibration gas concentration.

11. To enter the high calibration gas concentration, use
to move the cursor left and right. Use
to increment and decrement the digit. Press
to calibrate the instrument to the high SO2 calibration gas.

The display flashes the message "SAVING", and the corrected SO₂ reading is displayed.

12. Press to return to the Calibration menu. If using a chart recorder, the SO₂ recorder response will equal:

$$\frac{ISO_2}{URL} \times 100 + Z_{SO_2}$$

Where:

URL = upper range limit of the instrument's operating range

 Z_{SO2} = instrument response to zero air, % full scale

- 13. Generate five SO_2 concentrations equally spaced between zero and the concentration above.
- 14. Record instrument reading for each concentration after allowing time for both gas generation system and instrument to stabilize.

- 15. Plot a graph of instrument readings against the SO₂ concentrations generated for the high range.
- 16. Connect a source of calibration gas to the SAMPLE bulkhead. The calibration gas should be approximately 80% of the low full-scale range.
- 17. Use to move the cursor to Calibrate LO SO₂, and press to display the Calibrate LO SO₂ screen.

The first line of the display shows the current SO_2 reading. The second line of the display is where you enter the low calibration gas concentration.

18. To enter the low calibration gas concentration, use to move the cursor left and right. Use to increment and decrement the digit. Press to calibrate the instrument to the low SO₂ calibration gas.

The display flashes the message "SAVING", and the corrected SO_2 reading is displayed.

- 19. Press **•** to return to the Calibration menu.
- 20. Generate five SO_2 concentrations equally spaced between zero and the concentration above.
- 21. Record instrument reading for each concentration after allowing time for both gas generation system and instrument to stabilize.
- 22. Plot a graph of instrument readings against the SO_2 concentrations generated for the low range.

This is the instrument calibration curve. All future measurements should be interpreted using this curve.

Zero/Span Check The zero/span check proceduction check of the accuracy of the

The zero/span check procedure is normally performed any time a quick check of the accuracy of the instrument is required. Normally, zero and span are checked daily. As experience is gained with the instrument, the frequency of these checks can be adjusted accordingly.

The span gas concentration used in the span check should be between 70% and 90% of the full-scale range. The zero and span drift should be measured and recorded prior to making any adjustments.

All gas must be supplied to the instrument at atmospheric pressure. It will be necessary to employ an atmospheric bypass plumbing arrangement to accomplish this.

If a filter is used, all gas must enter the instrument through the filter.

For detailed information about the menu parameters and the icons used in these procedures, see the "Operation" chapter.

Use the following procedure to check the zero/span.

1. If the instrument is equipped with the optional zero/span and sample valves, connect the zero and span gas to the rear panel bulkheads labeled ZERO and SPAN, otherwise connect a source of vented zero air to the SAMPLE bulkhead.

Note Do not use nitrogen for zero air. \blacktriangle

• is used to activate the zero and span valves. The lower left-hand corner of the Run screen indicates which mode is active: ZERO, SPAN, or SAMPLE.

- 2. To ensure that the zero air is being measured at atmospheric pressure check that the flow reported by the analyzer is approximately 0.5 LPM. Actual zero air flow should be 0.8 LPM or more, with the excess flowing out the atmospheric bypass.
 - a. From the Run screen, press **•** to display the Main Menu.

 - c. Make sure that the reported sample flow is less than the actual zero air flow.
- 3. Press to monitor the zero air reading and wait for the reading to stabilize.
- 4. Record the measured SO_2 value as the zero drift since the last adjustment. If the zero has changed by more than \pm 1.5 ppb, it is recommended that a new calibration be performed.
- 5. Connect a source of vented span gas to the SAMPLE bulkhead. The span gas should be approximately 80% of the full-scale range.

- 6. To ensure that the span gas is being measured at atmospheric pressure check that the flow is approximately 0.5 LPM or more, with the excess flowing out the atmospheric bypass.
- 7. Press to monitor the span gas reading and wait for the reading to stabilize.
- 8. Record the difference between the measured SO_2 value and the actual SO_2 span concentration used. This is the span drift since the last adjustment. If the calibration has changed by more than ±10%, a new calibration should be performed.

Chapter 5 Preventive Maintenance

This chapter describes the periodic maintenance procedures that should be performed on the instrument to ensure proper operation. Since usage and environmental conditions vary greatly, you should inspect the components frequently until an appropriate maintenance schedule is determined.

This chapter includes the following maintenance information and replacement procedures:

- "Safety Precautions" on page 5-1
- "Replacement Parts" on page 5-2
- "Cleaning the Outside Case" on page 5-2
- "Visual Inspection and Cleaning" on page 5-2
- "Cleaning the Mirrors" on page 5-2
- "Fan Filter Inspection and Cleaning on page 5-4
- "Sample Particulate Filter Inspection" on page 5-5
- "Lamp Voltage Check" on page 5-5
- "Leak Test" on page on page 5-6
- "Pump Rebuilding" on page 5-6

Safety Precautions

Read the safety precautions before beginning any procedures in this chapter.

 \triangle

WARNING If the equipment is operated in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired. Do not attempt to lift the instrument by the cover or other external fittings. ▲



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component. For more information about appropriate safety precautions, see the "Servicing" chapter. ▲



Equipment Damage Do not use solvents or other cleaning products to clean the outside case.



Equipment Damage DO NOT attempt to clean the mirrors in the optical bench. These mirrors do not come in contact with the sample gas and should not be cleaned. Cleaning the mirrors can damage the mirrors.

Replacement Parts

See the "Servicing" chapter for a list of replacement parts.

Cleaning the Outside Case



labels on the case.

Clean the outside case using a damp cloth being careful not to damage the

Equipment Damage Do not use solvents or other cleaning products to clean the outside case. ▲

Visual Inspection and Cleaning

The instrument should be inspected occasionally for obvious visible defects, such as loose connectors, loose fittings, cracked or clogged Teflon[®] lines, and excessive dust or dirt accumulation. Dust and dirt can accumulate in the instrument and can cause overheating or component failure. Dirt on the components prevents efficient heat dissipation and may provide conducting paths for electricity. The best way to clean the inside of the instrument is to first carefully vacuum all accessible areas and then blow away the remaining dust with low pressure compressed air. Use a soft paint brush or cloth to remove stubborn dirt.

Cleaning the Mirrors

The mirrors located in the optical bench do not come in contact with the sample gas and DO NOT need cleaning. Read the Equipment Damage warning that follows.



Equipment Damage DO NOT attempt to clean the mirrors in the optical bench. These mirrors do not come in contact with the sample gas and should not be cleaned. Cleaning the mirrors can damage the mirrors.

Capillary Inspection and Replacement

The capillary normally only requires inspection when instrument performance indicates that there may be a flow problem. A decreased sample flow may be an indication that a capillary is blocked.



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component. For more information about appropriate safety precautions, see the "Servicing" chapter. ▲

Use the following procedure to inspect and replace the capillary.

- 1. Turn the instrument OFF and unplug the power cord.
- 2. Remove the instrument cover.
- 3. Locate the capillary holder (**Figure 5–1**) and unscrew the knurled cap nut.




Figure 5–1. Inspecting and Replacing the Capillary

4. Remove the glass capillary (1.5-inch long x 0.250-inch OD x 0.013inch ID) and O-ring. Refer to "Replacement Parts" in the "Servicing" chapter.

- 5. Check capillary for particulate deposits. Clean or replace as necessary.
- 6. Inspect O-ring for cuts or abrasion, and replace as necessary.
- 7. Replace capillary in the holder, making sure the O-ring is around the capillary before inserting it into the body.
- 8. Finger-tighten the cap nut enough to ensure a tight seal.
- 9. Re-install the cover.
- 10. Connect the power cord and turn the instrument ON.

Fan Filter Inspection and Cleaning

Under normal use, the filter over the instrument fan located on the rear panel of the instrument should be cleaned and reconditioned at six-month intervals. If the instrument is operated in excessively dirty surroundings, this procedure should be instituted on a more frequent schedule. Use the following procedure to inspect and clean the fan filter (**Figure 5–1**).



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

- 1. Turn the instrument OFF and unplug the power cord.
- 2. Remove the fan guard from the fan.
- 3. Flush the filter with warm water and let dry (a clean, oil-free purge will help the drying process) or blow the filters clean with compressed air.
- 4. Re-install the filter and fan guard.




Figure 5–1. Inspecting and Cleaning the Fan

Sample Particulate Filter Inspection

Lamp Voltage Check If a sample pre-filter is used, it should be inspected regularly for excessive dust and particulates which will restrict flow. Replace the sample filter as necessary.

The instrument is equipped with a lamp voltage control circuit, which automatically corrects for degradation of the flash lamp. However, after several years of use, the lamp may have degraded to the point that is being driven with the maximum voltage that the power supply can deliver.

Use the following procedure to check the lamp voltage.

- 1. Press **•** to display the Main Menu.
- 3. Check the flash supply voltage. If this voltage is at 1200 V, it is necessary to either replace the lamp or adjust the lamp voltage control circuit.

For detailed information about this screen, refer to the "Operation" chapter. For more information about replacing the lamp or adjusting the lamp voltage control circuit, see the "Servicing" chapter.

Leak Test A normal flow rate is approximately 0.5 LPM. If the flow rate is less than 0.35 LPM, use the following procedure to perform a leak test.

- 1. Block the SAMPLE bulkhead on the rear panel with a leak-tight cap.
- 2. Wait two minutes.
- 3. Press **b** to display the Main Menu.
- 4. Press 🔸 to move the cursor to Diagnostics and press 🗲 to display the Diagnostics menu.
- 5. Press 🔸 to move the cursor to Flow and press ← to display the Sample Flow screen. The flow reading should indicate zero flow.
- 6. Press to display the Diagnostics Menu, then press to move the cursor to Pressure and press to display the Pressure screen. The pressure reading should be less than 180 mm Hg. If not, check to see that all fittings are tight and that none of the input lines are cracked or broken. For detailed information about these screens, refer to the "Operation" chapter.
- 7. If the instrument passes the leak test, but still has low flow, check the capillary for blockage.
- 8. If the flow drops to zero during the flow check, but the pressure is above 250 mm Hg, the pump may need to be rebuilt.

Pump Rebuilding

Use the following procedure to rebuild the pump (**Figure 5–2**). To replace the pump, see "Pump Replacement" in the "Servicing" chapter.

Equipment Required:

Flatblade screwdriver

Pump rebuild kit (flapper valve and diaphragm)



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Loosen the fittings and remove both lines going to the pump.
- 3. Remove the four screws from the top plate, remove top plate, flapper valve, and the bottom plate (**Figure 5–2**).
- 4. Remove the screw the securing the diaphragm to piston and remove diaphragm.
- 5. Assemble the pump by following the previous steps in reverse, make sure the Teflon[®] (white) side of the diaphragm is facing up and that the flapper valves cover the holes of the top and bottom plate.




Figure 5–2. Rebuilding the Pump

- 6. Check that the flow reads approximately 0.5 LPM when power is turned ON.
- 7. Perform a leak test as described in this chapter.

Chapter 6 Troubleshooting

This instrument has been designed to achieve a high level of reliability. In the rare event of problems or failure, the troubleshooting guidelines, boardlevel connection diagrams, connector pin descriptions, and testing procedures presented in this chapter should be helpful in isolating and identifying problems.

For additional fault location information refer to the "Preventive Maintenance" chapter in this manual.

The service mode, described in the "Operation" chapter, includes parameters and functions that are useful when making adjustments or diagnosing problems.

The Technical Support Department at Thermo Fisher Scientific can also be consulted in the event of problems. See "Service Locations" at the end of this chapter for contact information. In any correspondence with the factory, please note both the serial number and program number of the instrument.

This chapter provides the following troubleshooting information:

- Safety Precautions on page 6-1
- Troubleshooting Guides on page 6-1
- Board-Level Connection Diagrams on page 6-10
- Connector Pin Descriptions on page 6-12
- Service Locations on page 6-24

Safety Precautions

Troubleshooting Guides

Read the safety precautions in the Preface and the "Servicing" chapter before performing any actions listed in this chapter.

The troubleshooting guides presented in this chapter are designed to help isolate and identify instrument problems.

Table 6–1. Troubleshooting - Power-Up Failures, **Table 6–2.**Troubleshooting - Calibration Failures, and **Table 6–3.** Troubleshooting -Measurement Failures provide general troubleshooting information and

indicate the checks that you should perform if you experience an instrument problem.

Table 6–4. Troubleshooting - Alarm Messages lists all the alarm messages you may see on the display and provides recommendations about how to resolve the alarm condition.

Malfunction	Possible Cause	Action
Does not start (The backlight on the display does not come on and the pump motor is not running.)	No power or wrong power configuration	Check the line to confirm that power is available and that it matches the voltage and frequency configuration of the instrument.
	Main fuse is blown or missing	Unplug the power cord, open the fuse drawer on the back panel, and check the fuses visually or with a multimeter.
	Bad switch or wiring connection	Unplug the power cord, disconnect the switch and check operation with a multimeter.
Display does not come on. (Pump is running.)	DC power supply failure	Check the green LED on the back edge of the power supply. If the LED is off, the supply has failed.
	DC power distribution failure	Check surface mount LEDs labelled "24V PWR" on the motherboard and the interface board. If lit, power is OK.
	Display failure	If possible, check instrument function through RS-232 or Ethernet. Contact Thermo Fisher Scientific Service Department.
Power comes on and the display functions, but the pump is not running.	AC power is not reaching the pump.	Locate the three-pin connector on the interface board and use a voltmeter to check AC voltage across the two black wires (should read 110 - 120V, even on 220V or 100V instruments).
	Pump is jammed due to a new or stiff diaphragm.	Carefully rotate the pump fan to get past sticking point.
	Pump bearings have failed.	Disconnect AC power and remove the gas lines from the pump head, then try to rotate the pump fan. If it is jammed, or noisy, the motor bearings may have failed.

Table 6–1. Troubleshooting - Power-Up Failures

	Table 6–2. Troubleshooting - Calibration Failures	
--	---	--

Malfunction	Possible Cause	Action
Cannot zero instrument or there is a high background signal when sampling zero air. (Zero air should produce a reading equivalent to less than 10.0 ppm SO ₂ .)	Zero air system is faulty, needs new SO ₂ scrubbers or requires maintenance.	Test against an ultra-zero cylinder from a reputable scientific gas supplier or check effect of a new chromatography grade activated charcoal scrubber installed at the instrument inlet.
	Zero air flow rate is inadequate.	Check by-pass or atmospheric pressure vent to verify that the zero air system is providing more flow than the instrument is drawing.
	Instrument is not drawing in span gas.	Check sample Flow and Pressure readings on the Diagnostics screen.
		Use an independent flow meter to check flows at the sample inlet and exhaust bulkheads (they should match).
		Perform a leak test, as described in the "Preventive Maintenance" chapter.
	Span gas containing SO ₂ , NO, or a hydrocarbon is contaminating system.	Verify that span gases connected to the calibration system are shut off and leak-tight.
	Internal or external lines, filters, and other sample handling equipment are contaminated or dirty.	Replace inlet filter (if installed) and as much of the tubing as possible.
	Hydrocarbon kicker has failed.	Replace the hydrocarbon kicker.
	High scattered light	Go to Instrument Controls, select Flash Lamp and toggle to OFF. If the previously high signal drops to zero o less when the flash lamp is off, the problem may be caused by scattered light from dust in the optical bench. It so, carefully clean the optical bench.
	Input board failure	Disconnect the input board from the interface board by unplugging ribbon cable labelled "INPUT." The instrument reading should drop to zero or to a negative value.
Instrument appears to zero, but there is weak or	Span cylinder empty	Check the source pressure.

Malfunction	Possible Cause	Action
no response to span gas.		
	Calibration system failure	Check solenoids or other hardware to be sure that span gas is being delivered.
	Flow rate of the diluted span mix is inadequate.	Check by-pass or atmospheric vent to verify that the zero air system is providing more flow than the instrument draws.
	Instrument is not drawing in span gas.	Check sample Flow and Pressure readings on the Diagnostics screen.
		Use an independent flow meter to check flows at the sample inlet and exhaust bulkheads (they should match).
		Perform a leak test, as described in the "Preventive Maintenance" chapter.
	SO ₂ is being absorbed by tubing, filters, or dirt in the calibration system.	Replace any lines made of vinyl or other plastics with fresh Teflon or stainless steel. Replace Teflon filter membranes that look dirty. Remove any filters that are not Teflon membranes.
	Flash lamp has failed.	Listen for the rapid clicking of the flash lamp. Check the flash lamp voltage and intensity.
	PMT or input board has failed.	Check the PMT voltage and run the optical span test. A good optical spa test indicates that the PMT is OK and that the problem is more likely the flash lamp.
Zero or Span will not stabilize.	Flow rate of the diluted span mix is inadequate.	Check by-pass or atmospheric pressure vent to verify that the zero air system is providing more flow than the instrument is drawing.
	Instrument is not drawing in span gas.	Check sample Flow and Pressure readings on the Diagnostics screen.
		Use an independent flow meter to check flows at the sample inlet and exhaust bulkheads (they should match).
		Perform a leak test, as described in the "Preventive Maintenance" chapter.
	SO_2 is being absorbed	Replace any lines made of vinyl or

Malfunction	Possible Cause	Action
	and released by dirt in the tubing or filters of the calibration system, or contamination inside the instrument.	other plastics with fresh Teflon or stainless steel. Replace Teflon filter membranes that look dirty. Remove any filters that are not Teflon membranes.
	Averaging time is not set correctly.	Check the Averaging Time in Main Menu. If too high, the unit will be slow to stabilize. If too low, the signal may appear noisy.
	PMT high voltage power supply failure	Check the PMT high voltage power supply voltage. This voltage should be about -600 volts (violet wire is positive).
	Flasher lamp	Replace with known good lamp to see if the lamp is the problem.

Table 6–3. Troubleshooting - Measurement Failures

	0	
Malfunction	Possible Cause	Action
Reduced response or no response to sample gas with alarm(s) indicated.	Undefined electronic failure or pump failure	Check alarm screens and the diagnostic voltage screen to localize fault.
		Check the response to known span gas.
		Run an optical span test.
	Instrument is not drawing in sample as expected.	Check sample Flow and Pressure readings on the Diagnostics screen.
		Use an independent flow meter to check flows at the sample inlet and exhaust bulkheads (they should match).
		Perform a leak test, as described in the "Preventive Maintenance" chapter.
Reduced response or no response to sample gas with no alarms indicated.	Instrument is not drawing in sample as expected.	Check sample Flow and Pressure readings on the Diagnostics screen.
		Use an independent flow meter to check flows at the sample inlet and exhaust bulkheads (they should match).
		Perform a leak test, as described in the "Preventive Maintenance" chapter.
		Check the external plumbing for leaks or other problems.

Malfunction	Possible Cause	Action
		Check all external plumbing and the source of the sample to verify that the SO_2 is not being adsorbed by the sampling system. Lines carrying SO_2 must be made from clean Teflon or stainless steel.
	Detection circuit failure	Go to Diagnostics menu and run the optical span test to verify PMT and associated electronics.
	Instrument is not properly calibrated.	Go to the Calibration Factors menu and verify that the SO_2 Background and SO_2 Coefficient are set appropriately.
	Input board malfunction	Go to Service Menu and select Input Board Test to verify A/D signal on each range.
	Signal cable failure	While viewing the Input Board Test screen, set the gain to 100 and then disconnect the signal cable from the input board. The signal should drop from a value above 1000 to near zero.
	PMT failure	Check the PMT voltage (Service menu).
	Flash lamp assembly failure	Check the lamp voltage (Service menu).
Span calibration coefficient outside acceptable limits of 0.5 – 2.0.	Bad span gas	Verify quality of span gas.
	System leak	Perform leak test.
	Insufficient calibrator flow	Verify calibrator is providing a flow of a least 0.8 LPM.
Excessive noise or spikes on analog outputs	Defective or low sensitivity PMT	Check PMT voltage and run an optical span test. Replace PMT with known good unit if possible.
	Defective input board or BNC connection	Identify the defective component and replace.
	Noise pick-up by recorder or data logger	Check analog cable shielding and grounding.
		Try to localize source of noise by comparing analog signal to data collected through RS-232 or Ethernet.
Poor linearity	Problem with calibrator	Verify accuracy of the multipoint calibration system with an independent flow meter.

Troubleshooting Troubleshooting Guides

Malfunction	Possible Cause	Action
	Problem with input board range switching	Go to the Input Board Test screen (Service menu) and step through each range while the instrument samples a known stable source of SO ₂ .
		Stay on the Input Board Test screen, and while holding instrument on the lowest gain, step the calibrator through all SO_2 levels.
		Manually plot signal vs. concentration to verify linearity.
	Leak in sample probe line	Check for variable dilution.
Excessive response time	Averaging time is not set correctly.	Go to Averaging Time (Main Menu) and verify setting.
	Instrument is not drawing in sample at normal flow rate.	Check sample Flow and Pressure readings on the Diagnostics screen.
		Use an independent flow meter to check flows at the sample inlet and exhaust bulkheads (they should match).
		Perform a leak test, as described in the "Preventive Maintenance" chapter.
	SO ₂ is being absorbed and/or released by dirt in the tubing or filters of the sampling system, or inside the instrument.	Replace any lines made of vinyl or other plastics with fresh Teflon or stainless steel.
		Replace Teflon filter membranes that look dirty.
		Remove any filters that are not Teflon membranes.
Analog signal doesn't match expected value.	Software has not been configured.	Verify that the selected analog output has been properly configured to match the data system.
	Recorder is drawing down output.	Verify that the recorder or data logger input impedance meets minimum requirements.
Flow meter fluctuations	Dirty pump diaphragm	Clean or replace pump diaphragm.
	Capillary blocked	Clean or replace capillary.
	Clogged Teflon line	Inspect all sample lines.

Alarm Message	Possible Cause	Action
Alarm - Internal Temp	Instrument overheating	Replace fan if not operating properly.
		Clean or replace foam filter, refer to the "Preventive Maintenance" chapter in this manual.
		Check 10K thermistor on measurement interface board, replace if bad.
Alarm - Chamber Temp	Chamber temperature below set point	Check 10K thermistor, replace if bad.
		Check temperature control board to insure the LEDs are coming on. If not, temperature control board could be defective.
	Heaters have failed	Check connector pins for continuity.
Alarm - Pressure	High pressure	Check plumbing for leaks.
	indication	Check the pump for a tear in the diaphragm, replace with pump repair kit if necessary.
		Refer to the "Preventive Maintenance" chapter i this manual.
		Check that capillary is properly installed and O- rings are in good shape. Replace if necessary.
Alarm - Flow	Flow low	Check sample capillary for blockage. Replace as necessary.
		If using sample particulate filter make sure it is not blocked. Disconnect sample particulate filter from the sample bulkhead, if flow increases, replace the filter.
		Perform leak test to check for internal leaks.
	Flow high	When delivering zero air or gas to the instrument, use an atmospheric dump.
Alarm - Intensity	Low - lamp is failing	Check that the lamp and trigger pak are securely fastened.
		Replace lamp.
Alarm - Lamp voltage	Low voltage (<550V) – lamp power supply has failed	Replace the lamp power supply.
	High voltage (>1200V) - flash lamp failed	Replace the flash lamp.
Alarm - SO ₂	Concentration has	Check to insure range corresponds with expected

Table 6–4. Troubleshooting - Alarm Messages

Troubleshooting Troubleshooting Guides

Alarm Message	Possible Cause	Action
Conc.	exceeded range limit	value. If not, select proper range.
	Concentration low	Check user-defined low set point, be sure the min trigger is set as desired.
Alarm - Zero Check Alarm - Span Check	Instrument out of calibration	Recalibrate instrument.
Alarm - Zero Autocal Alarm - Span Autocal		Check gas supply. Perform manual calibration.
Alarm - Motherboard Status	Internal cables not connected properly	Check that all internal cables are connected properly. Recycle AC power to instrument. If still alarming, change board.
Alarm - Interface Status Alarm - I/O Exp Status	Board is defective	

Board-Level Connection Diagrams

Figure 6–1 and

Figure 6–2 are board-level connection diagrams for the common electronics and measurement system. These illustrations can be used along with the connector pin descriptions in **Table 6–5** through **Table 6–12** to troubleshoot board-level faults.






Figure 6–1. Board-Level Connection Diagram - Common Electronics





Connector Pin Descriptions

The connector pin descriptions in **Table 6–5** through **Table 6–12** can be used along with the board-level connection diagrams to troubleshoot board-level faults.

Table 6–5. Motherboard	Connector F	² in Descriptions
------------------------	-------------	------------------------------

2 Ethernet Output (-) 3 Ethernet Input (+) 4 NC 5 NC 6 Ethernet Input (-) 7 NC 8 NC EXPANSION BD J3 1 +5V 2 +24V 3 +24V 4 Ground 5 Ground 6 Ground 7 +RS485 to Expansion Board 8 -RS485 to Expansion Board 1 +5V 2 +24V 3 +24V 4 Ground 5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1 /0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1	Connector Label	Reference Designator	Pin	Signal Description
3-RS485 to Interface Board10-BASE-TJ21Ethernet Output (+)2Ethernet Output (-)3Ethernet Input (+)3Ethernet Input (+)4NC5NC6Ethernet Input (-)7NC8NCEXPANSION BDJ31+5V2+24V3+24V4Ground5Ground5Ground6Ground7+RS485 to Expansion Board8-RS485 to Expansion Board8J41+5V2+24V3+24V4Ground5Ground5Ground6Ground6Ground5Ground7+RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board6Ground9J41+5V2+24V3+24V4Ground5Ground5Ground6Ground6Ground6Ground7+RS485 to Spare Board81/0J51Power Fail Relay N.C. Contac2Ground3TL Input 1	INTF DATA	J1	1	Ground
10-BASE-TJ21Ethernet Output (+)2Ethernet Output (-)3Ethernet Input (+)4NC5NC6Ethernet Input (-)7NC8NCEXPANSION BDJ314Ground5Ground6Ground7+RS485 to Expansion Board8-RS485 to Expansion Board9-RS485 to Expansion Board8-RS485 to Expansion Board9-RS485 to Spare Board1/0J511Power Fail Relay N.C. Contac2Ground3TTL Input 1			2	+RS485 to Interface Board
2 Ethernet Output (-) 3 Ethernet Input (+) 4 NC 5 NC 6 Ethernet Input (-) 7 NC 8 NC EXPANSION BD J3 1 +5V 2 +24V 3 +24V 4 Ground 5 Ground 6 Ground 7 +RS485 to Expansion Board 8 -RS485 to Expansion Board 1 +5V 2 +24V 3 +24V 4 Ground 5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1			3	-RS485 to Interface Board
 SPARE DATA J4 Keyner Edata Keyner Edata	10-BASE-T	J2	1	Ethernet Output (+)
4NC5NC6Ethernet Input (-)7NC8NCEXPANSION BDJ3144544V3+24V4Ground5Ground6Ground7+RS485 to Expansion Board8-RS485 to Expansion Board9			2	Ethernet Output (-)
5NC6Ethernet Input (-)7NC8NCEXPANSION BDJ31452+24V3+24V4Ground5Ground6Ground7+RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Spare Board10J5110J5110J5110J5111Power Fail Relay N.C. Contac2Ground3TL Input 1			3	Ethernet Input (+)
6Ethernet Input (-)7NC8NCEXPANSION BDJ31+5V2+24V3+24V4Ground5Ground6Ground6Ground7+RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board9			4	NC
7 NC 8 NC EXPANSION BD J3 1 +5V 2 +24V 3 +24V 3 +24V 4 Ground 5 Ground 5 Ground 6 Ground 7 +RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 9 +24V 3 +24V 4 Ground 8 -RS485 to Expansion Board 1 +5V 9 +24V 3 +24V 3 +24V 4 Ground 6 Ground 5 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TL Input 1			5	NC
8NCEXPANSION BDJ31+5V2+24V3+24V3+24V4Ground5Ground5Ground6Ground7+RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8SPARE DATAJ41+5V2+24V3+24V3+24V3+24V4Ground5Ground5Ground5Ground6Ground6Ground7+RS485 to Spare Board81/0J51Power Fail Relay N.C. Contac21Power Fail Relay N.C. Contac2Ground3TTL Input 1			6	Ethernet Input (-)
EXPANSION BD J3 1 +5V 2 +24V 3 +24V 4 Ground 5 Ground 6 Ground 7 +RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 9 +24V 4 Ground 5 Ground 5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1			7	NC
2 +24V 3 +24V 4 Ground 5 Ground 6 Ground 7 +RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 1 +5V 2 +24V 3 +24V 4 Ground 5 Ground 5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contact 2 Ground 3 TTL Input 1			8	NC
3+24V4Ground5Ground6Ground7+RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board919+24V3+24V4Ground5Ground5Ground6Ground7+RS485 to Spare Board10J511Power Fail Relay N.C. Contac2Ground3TTL Input 1	EXPANSION BD	J3	1	+5V
4 Ground 5 Ground 6 Ground 7 +RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 8 -RS485 to Expansion Board 1 +5V 2 +24V 3 +24V 4 Ground 5 Ground 5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1			2	+24V
5Ground6Ground7+RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board919+24V3+24V4Ground5Ground5Ground6Ground7+RS485 to Spare Board1/0J511Power Fail Relay N.C. Contac2Ground3TTL Input 1			3	+24V
6Ground7+RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board9+24V1+5V2+24V3+24V4Ground5Ground6Ground6Ground7+RS485 to Spare Board1/0J511Power Fail Relay N.C. Contac2Ground3TTL Input 1			4	Ground
7+RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board8-RS485 to Expansion Board9+24V3+24V3+24V4Ground5Ground6Ground7+RS485 to Spare Board8-RS485 to Spare Board10J5111Power Fail Relay N.C. Contac2Ground3TTL Input 1			5	Ground
8-RS485 to Expansion BoardSPARE DATAJ41+5V2+24V3+24V3+24V4Ground5Ground5Ground6Ground6Ground7+RS485 to Spare Board81/0J51Power Fail Relay N.C. Contact2Ground3TTL Input 1			6	Ground
SPARE DATA J4 1 +5V 2 +24V 3 +24V 4 Ground 5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1			7	+RS485 to Expansion Board
2 +24V 3 +24V 4 Ground 5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1			8	-RS485 to Expansion Board
3 +24V 4 Ground 5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1	SPARE DATA	J4	1	+5V
4 Ground 5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1			2	+24V
5 Ground 6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1			3	+24V
6 Ground 7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contact 2 Ground 3 TTL Input 1			4	Ground
7 +RS485 to Spare Board 8 -RS485 to Spare Board 1/0 J5 1 Power Fail Relay N.C. Contact 2 Ground 3 TTL Input 1			5	Ground
8 -RS485 to Spare Board I/O J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1			6	Ground
I/O J5 1 Power Fail Relay N.C. Contac 2 Ground 3 TTL Input 1			7	+RS485 to Spare Board
2 Ground 3 TTL Input 1			8	-RS485 to Spare Board
3 TTL Input 1	I/O	J5	1	Power Fail Relay N.C. Contact
			2	Ground
4 TTI Innut 2			3	TTL Input 1
			4	TTL Input 2

Connector Label	Reference Designator	Pin	Signal Description
		5	Ground
		6	TTL Input 5
		7	TTL Input 7
		8	TTL Input 8
		9	TTL Input 10
		10	Ground
		11	TTL Input 13
		12	TTL Input 15
		13	Ground
		14	Analog Voltage Output 1
		15	Analog Voltage Output 3
		16	Ground
		17	Analog Voltage Output 5
		18	Ground
		19	Ground
		20	Power Fail Relay COM
		21	Power Fail Relay N.O. Contact
		22	Ground
		23	TTL Input 3
		24	TTL Input 4
		25	TTL Input 6
		26	Ground
		27	TTL Input 9
		28	TTL Input 11
		29	TTL Input 12
		30	TTL Input 14
		31	TTL Input 16
		32	Ground
		33	Analog Voltage Output 2
		34	Analog Voltage Output 4
		35	Ground
		36	Analog Voltage Output 6
		37	Ground
SER EN	J7	1	Serial Enable Jumper

2GroundDIGITAL OUTPUTJ141+5V2+24V3+24V3+24V4Ground5Ground5Ground6Ground6SPI Reset8SPI Input9SPI Output10SPI Board Select11SPI ClockEXT. RS485J151-RS485 to Rear Panel2+RS485 to Rear Panel3+5V4+5V5+5V6Ground7Ground7Ground8Ground8Ground10NC9NC11+24V10NC11+24V11+24V12+24V12+24V13+24V13+24V14+24V14+24V15+24V24V MONITORJ17124V Power Monitor24V MONITORJ17124V Power Monitor	Connector Label	Reference Designator	Pin	Signal Description
2GroundDIGITAL OUTPUTJ141+5V2+24V3+24V3+24V4Ground5Ground5Ground6Ground7SPI Reset8SPI Input10SPI Output10SPI Output10SPI ClockEXT. RS485J151-RS485 to Rear Panel2+RS485 to Rear Panel3+5V4+5V5+5V5+5V6Ground6Ground8Ground7Ground8Ground8Ground11+24V9NC11+24V10NC11+24V11+24V13+24V12+24V13+24V13+24V14+24V14+24V14+24V15+24V14+24V14+24V14+24V15+24V15+24V16FONT PANEL BDJ181Ground1710Ground14-24V16Ground14-24V1718-24V18-24V-24V19MC-24V10Cound-24V11-24V-24V12Ground-24V13-24V-24V14-24V-24V15-24V-24V <td< td=""><td></td><td></td><td>2</td><td>+3.3V</td></td<>			2	+3.3V
DIGITAL OUTPUT J14 1 +5V 2 +24V 3 +24V 4 Ground 5 Ground 6 Ground 7 SPI Reset 8 SPI Input 9 SPI Output 10 SPI Board Select 11 SPI Clock EXT. RS485 J15 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +5V 6 Ground 7 SI and Select 11 SPI Clock 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +5V 4 +5V 5 +5V 6 Ground 7 Ground 7 Ground 10 NC 11 +24V 12 +24V 12 +24V 13 +24V 14 +24V 14 +24V 15 +24V 14 +24V 16 HC 14 14 24V </td <td>24V IN</td> <td>J10</td> <td>1</td> <td>+24V</td>	24V IN	J10	1	+24V
2+24V3+24V4Ground5Ground6Ground7SPI Reset8SPI Input9SPI Output10SPI Board Select11SPI Clock11SPI Clock12+RS485 to Rear Panel2+RS485 to Rear Panel3+5V4+5V5+5V6Ground7Ground8Ground9NC10NC11+24V12+24V13+24V14+24V15+24V16Ground17118144Power Monitor24V MONITORJ181Ground1Ground1Ground1-24V14-24V15-24V16Ground17118110Ground			2	Ground
3 +24V 4 Ground 5 Ground 6 Ground 7 SPI Reset 8 SPI Input 9 SPI Output 10 SPI Board Select 11 SPI Clock EXT. RS485 J15 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +SV 4 +SV 4 +SV 5 +SV 4 +SV 6 Ground 7 Ground 7 Ground 1 +Z4V 8 Ground 1 +Z4V 9 NC 1 +Z4V 10 NC 1 +Z4V 11 +Z4V 1 +Z4V 12 +Z4V 1 +Z4V 14 +Z4V 1 +Z4V 15 +Z4V 1 +Z4V 16 Ground 1 +Z4V 17 +Z4V 1 +Z4V 18 +Z4V	DIGITAL OUTPUT	J14	1	+5V
4Ground5Ground6Ground7SPI Reset8SPI Input9SPI Output10SPI Board Select11SPI ClockEXT. RS485J15114-RS485 to Rear Panel2+RS485 to Rear Panel3+5V4+5V5+5V6Ground7Ground8Ground9NC10NC11+24V12+24V13+24V14+24V15+24V24V MONITORJ17110Ground11Forund2Ground14Ground15+24V16Ground17118120Ground20J18120Ground			2	+24V
5Ground6Ground7SPI Reset8SPI Input9SPI Output10SPI Board Select11SPI ClockEXT. RS485J1518+SV485 to Rear Panel2+RS485 to Rear Panel3+5V4+5V5+5V6Ground7Ground8Ground9NC10NC11+24V12+24V13+24V14+24V15+24V24V MONITORJ17110Ground11Forund2Ground14Ground15+24V16Ground17118Ground10Forund11-24V12-24V13-24V14-24V15-24V24-24V24-2424-2424-2424-2424-2424-2424-2424-2424-2424-2424-2424-2424-2424-2424-2424-2424-2424-2424-2425-2426 </td <td></td> <td></td> <td>3</td> <td>+24V</td>			3	+24V
6 Ground 7 SPI Reset 8 SPI Input 9 SPI Output 10 SPI Board Select 11 SPI Clock EXT. RS485 J15 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +5V 4 +5V 4 +5V 5 +5V 6 Ground 7 Ground 7 Ground 8 Ground 8 Ground 9 NC 11 +24V 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 14 +24V 15 +24V 15 +24V 24V MONITOR J17 1 24V Power Monitor 15 +24V 15 +24V 16 Ground 16 Ground 17 12 42V Power Monitor 2 Ground			4	Ground
7 SPI Reset 8 SPI Input 9 SPI Output 10 SPI Board Select 11 SPI Clock EXT. RS485 J15 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +5V 4 +5V 5 +5V 6 Ground 7 Ground 7 Ground 8 Ground 9 NC 11 +24V 11 +24V 12 +24V 12 +24V 13 +24V 14 +24V 14 +24V 15 +24V 15 +24V 24V MONITOR J17 1 24V Power Monitor 15 +24V 15 +24V 24V MONITOR J17 1 Ground 16 Ground 2 Ground 17 2 Ground 2			5	Ground
8 SPI Input 9 SPI Output 10 SPI Board Select 11 SPI Clock EXT. RS485 J15 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +5V 4 +5V 5 +5V 6 Ground 7 Ground 7 Ground 9 NC 11 +24V 11 +24V 12 +24V 13 +24V 13 +24V 13 +24V 14 +24V 14 +24V 13 +24V 14 +24V 14 +24V 14 +24V 15 +24V 14 +24V 14 +24V 14 +24V 15 +24V 14 +24V 16 Ground 14 -24V 17 12 Ground 14 -24V 17 14 -24V <			6	Ground
9 SPI Output 10 SPI Board Select 11 SPI Clock EXT. RS485 J15 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +5V 4 +5V 5 +5V 6 Ground 7 Ground 7 Ground 8 Ground 8 Ground 9 NC 10 NC 11 +24V 11 +24V 12 +24V 12 +24V 13 +24V 14 +24V 14 +24V 14 +24V 15 +24V 14 +24V 15 +24V 15 +24V 15 +24V 15 +24V 15 -24V 16 Ground 16 Ground 17 10 Ground 16 Ground 18 Ground 2 Ground 16 Grou			7	SPI Reset
10 SPI Board Select 11 SPI Clock EXT. RS485 J15 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +5V 4 +5V 4 +5V 5 +5V 6 Ground 7 Ground 8 Ground 8 Ground 9 NC 9 NC 11 +24V 10 NC 11 +24V 12 +24V 13 +24V 13 +24V 14 +24V 14 +24V 15 +24V 15 +24V 15 +24V 16 Ground 16 Ground 17 10 24V Power Monitor 16 24V MONITOR J17 1 24V Power Monitor 2 Ground 16 Ground FRONT PANEL BD J18 1 Ground			8	SPI Input
11 SPI Clock EXT. RS485 J15 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +5V 4 +5V 5 +5V 6 Ground 7 Ground 8 Ground 9 NC 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 16 +24V 17 12 18 +24V 14 +24V 15 +24V 16 +24V 17 12 18 +24V 19 +24V 10 +24V 11 +24V 12 +24V 14 +24V 15 +24V 16 Ground 17 12 Ground 18 FRONT PANEL BD J18 14 Ground			9	SPI Output
EXT. RS485 J15 1 -RS485 to Rear Panel 2 +RS485 to Rear Panel 3 +5V 4 +5V 5 +5V 6 Ground 7 Ground 8 Ground 9 NC 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 16 +24V 17 1 24V MONITOR J17 10 Scound FRONT PANEL BD J18 11 Ground			10	SPI Board Select
2 +RS485 to Rear Panel 3 +5V 4 +5V 5 +5V 6 Ground 7 Ground 8 Ground 9 NC 10 NC 11 +24V 12 +24V 14 +24V 15 +24V 14 +24V 15 +24V 16 24V Power Monitor 24V MONITOR J17 1 10 Ground 11 FRONT PANEL BD J18 12 Ground 20 Ground			11	SPI Clock
3 +5V 4 +5V 5 +5V 6 Ground 7 Ground 8 Ground 9 NC 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 16 24V Power Monitor 24V MONITOR J17 1 10 Cround 11 +24V 15 +24V 16 -2000000000000000000000000000000000000	EXT. RS485	J15	1	-RS485 to Rear Panel
4 +5V 5 +5V 6 Ground 7 Ground 8 Ground 9 NC 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 16 +24V 17 12 18 12 FRONT PANEL BD J18 1 Ground			2	+RS485 to Rear Panel
5 +5V 6 Ground 7 Ground 8 Ground 9 NC 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 16 Store 17 15 18 Ground 19 Store 11 Store 12 +24V 13 +24V 14 +24V 15 +24V 15 +24V 16 Ground 17 1 Ground 18 1 Ground 19 FRONT PANEL BD J18 1 10 Ground 2			3	+5V
6 Ground 7 Ground 8 Ground 9 NC 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 16 Scound 17 1 24V MONITOR J17 1 24V Power Monitor 2 Ground FRONT PANEL BD J18 1 Ground			4	+5V
7 Ground 8 Ground 9 NC 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 15 424V 16 Ground 17 15 18 Ground 19 14 10 14 11 14 12 14 14 124V 15 124V 16 124V 17 15 18 11 10 12 10 12 11 12 12 12 13 12 14 12 15 12 16 12 17 14 18 12 19 12 10 12 10 12 11 12 12 </td <td></td> <td></td> <td>5</td> <td>+5V</td>			5	+5V
8 Ground 9 NC 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 24V MONITOR J17 1 24V Power Monitor 21 Ground 1 1 1 FRONT PANEL BD J18 1 Ground			6	Ground
9 NC 10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 15 +24V 16 Ground 17 1 Ground 18 1 Ground 20 Ground 2			7	Ground
10 NC 11 +24V 12 +24V 13 +24V 14 +24V 15 +24V 24V MONITOR J17 1 24V Power Monitor 2 Ground FRONT PANEL BD J18 1 Ground 2 Ground 2 Ground			8	Ground
11 +24V 12 +24V 13 +24V 13 +24V 14 +24V 15 +24V 24V MONITOR J17 1 24V Power Monitor 2 Ground FRONT PANEL BD J18 1 Ground 2 Ground 2 Ground			9	NC
12 +24V 13 +24V 14 +24V 15 +24V 24V MONITOR J17 1 24V Power Monitor 2 Ground FRONT PANEL BD J18 1 Ground 2 Ground 2 Ground			10	NC
13 +24V 14 +24V 15 +24V 15 +24V 24V MONITOR J17 1 24V Power Monitor 2 Ground FRONT PANEL BD J18 1 Ground 2 Ground 2 Ground			11	+24V
14 +24V 15 +24V 24V MONITOR J17 1 24V Power Monitor 2 Ground FRONT PANEL BD J18 1 Ground 2 Ground 2 Ground			12	+24V
15 +24V 24V MONITOR J17 1 24V Power Monitor 2 Ground FRONT PANEL BD J18 1 Ground 2 Ground 2 Ground			13	+24V
24V MONITOR J17 1 24V Power Monitor 2 Ground FRONT PANEL BD J18 1 Ground 2 Ground 2 Ground			14	+24V
2 Ground FRONT PANEL BD J18 1 Ground 2 Ground 2 Ground			15	+24V
FRONT PANEL BD J18 1 Ground 2 Ground	24V MONITOR	J17	1	24V Power Monitor
2 Ground			2	Ground
	FRONT PANEL BD	J18	1	Ground
3 LCLK – LCD Signal			2	Ground
			3	LCLK – LCD Signal

Connector Label	Reference Designator	Pin	Signal Description
		4	Ground
		5	Ground
		6	LLP — LCD Signal
		7	LFLM — LCD Signal
		8	LD4 – LCD Signal
		9	LDO — LCD Signal
		10	LD5 – LCD Signal
		11	LD1 – LCD Signal
		12	LD6 – LCD Signal
		13	LD2 – LCD Signal
		14	LD7 – LCD Signal
		15	LD3 – LCD Signal
		16	LCD Bias Voltage
		17	+5V
		18	Ground
		19	Ground
		20	LCD_ONOFF – LCD Signal
		21	Keypad Row 2 Input
		22	Keypad Row 1 Input
		23	Keypad Row 4 Input
		24	Keypad Row 3 Input
		25	Keypad Col 2 Select
		26	Keypad Col 1 Select
		27	Keypad Col 4 Select
		28	Keypad Col 3 Select
		29	Ground
		30	Ground
		31	Ground
		32	Ground
		33	+24V
		34	+24V
	P1:A	1	NC
RS232/RS485:A	1 1.7 (
ñðz32/ñð485:A		2	Serial Port 1 RX (-RS485 IN)

Connector Label	Reference Designator	Pin	Signal Description
		4	NC
		5	Ground
		6	NC
		7	Serial Port 1 RTS (+RS485 OUT)
		8	Serial Port 1 CTS (+RS485 IN)
		9	NC
RS232/RS485:B	P1:B	1	NC
		2	Serial Port 2 RX (-RS485 IN)
		3	Serial Port 2 TX (-RS485 OUT)
		4	NC
		5	Ground
		6	NC
		7	Serial Port 2 RTS (+RS485 OUT)
		8	Serial Port 2 CTS (+RS485 IN)
		9	NC
AC IN	PJ1	1	AC-HOT
		2	AC-NEUT
		3	AC-Ground
AC 24VPWR	PJ2	1	AC-HOT
		2	AC-NEUT
		3	AC-Ground
AC INTF BD	PJ3	1	AC-HOT
		2	AC-NEUT
		3	AC-Ground

Table 6–6. Measurement Interface Board Connector Pin Description	ons
--	-----

Connector Label	Reference Designator	Pin	Signal Description
DATA	IPJ8	1	Ground
		2	+RS485 from Motherboard
		3	-RS485 from Motherboard
FLASH TRIG	FJ1	1	Flash Voltage
		2	Flash Trigger
		3	Ground
FLASH INT	FJ2	1	+15V

Troubleshooting Connector Pin Descriptions

Connector Label	Reference Designator	Pin	Signal Description
		2	-15V
		3	Ground
		4	Lamp Intensity
INPUT BD	MJ8	1	+15V
		2	Ground
		3	-15V
		4	+5V
		5	Ground
		6	Measurement Frequency Output
		7	Sample Hold
		8	NC
		9	GAIN A
		10	GAIN B
HVPS	MJ9	1	HV Power Supply Voltage Adjust
		2	Ground
		3	HV Power Supply On/Off
		4	Ground
		5	HV Power Supply Voltage Monito
		6	Ground
		7	Ground
PRES	MJ10	1	Pressure Sensor Input
		2	Ground
		3	+15V
		4	-15V
FLOW	MJ11	1	Flow Sensor Input
		2	Ground
		3	+15V
		4	-15V
		5	Ground
LED	MJ14	1	LED Drive
		2	LED Supply
AMB TEMP	MJ15	1	Ambient Temperature Thermistor
		2	Ground
BENCH HEATER	NTJ1	1	Bench Temperature Input

Connector Label	Reference Designator	Pin	Signal Description
		2	Ground
		3	AC-HOT
		4	Bench Heater AC
CONVERTER	MJ17	1	Converter Temperature Input
		2	Ground
		3	Converter Heater On/Off
		4	Ground
		5	+15V
		6	-15V
24V IN	P1	1	+24V
		2	Ground
AC PUMP	PJ5	1	AC-HOT
		2	AC-NEUT
		3	AC-Ground
FAN	PJ4	1	+24V
		2	Ground
AC IN	PJ3	1	AC-HOT
		2	AC-NEUT
		3	AC-Ground
AC CONVERTER	PJ12	1	AC-HOT
		2	AC-NEUT
		3	AC-Ground
Z/S SOL.	PJ7	1	+24V
		2	Zero/Span Solenoid Control
SAMPLE SOL.	PJ8	1	+24V
		2	Sample Solenoid Control
CONV SOL.	PJ9	1	+24V
		2	Spare 1 Solenoid Control
SPAN2 SOL.	PJ10	1	+24V
		2	Spare 2 Solenoid Control
PERM OVEN THERM	POJ1	1	Perm Oven Gas Thermistor
		2	Ground
PERM OVEN	POJ3	1	Perm Oven Heater On/Off
		2	+15V Power

Connector Label	Reference Designator	Pin	Signal Description
		3	Perm Oven Heater Thermistor
		4	Ground

Table 6–7. Front Panel Board Connector Pin Diagram

Connector Label	Reference Designator	Pin	Signal Description
MOTHER BOARD	J1	1	Ground
		2	Ground
		3	LCLK – LCD Signal
		4	Ground
		5	Ground
		6	LLP – LCD Signal
		7	LFLM – LCD Signal
		8	LD4 — LCD Signal
		9	LDO — LCD Signal
		10	LD5 — LCD Signal
		11	LD1 — LCD Signal
		12	LD6 — LCD Signal
		13	LD2 — LCD Signal
		14	LD7 — LCD Signal
		15	LD3 — LCD Signal
		16	LCD Bias Voltage
		17	+5V
		18	Ground
		19	Ground
		20	LCD_ONOFF – LCD Signal
		21	Keypad Row 2 Input
		22	Keypad Row 1 Input
		23	Keypad Row 4 Input
		24	Keypad Row 3 Input
		25	Keypad Col 2 Select
		26	Keypad Col 1 Select
		27	Keypad Col 4 Select
		28	Keypad Col 3 Select
		29	Ground

Connector Label	Reference Designator	Pin	Signal Description
		30	Ground
		31	Ground
		32	Ground
		33	+24V
		34	+24V
LCD DATA	J2	1	LD0_5V – LCD Signal
		2	LD1_5V — LCD Signal
		3	LD2_5V — LCD Signal
		4	LD3_5V — LCD Signal
		5	LCD_ONOFF_5V – LCD Signal
		6	LFLM_5V — LCD Signal
		7	NC
		8	LLP_5V — LCD Signal
		9	LCLK_5V – LCD Signal
		10	+5V
		11	Ground
		12	-25V
		13	LCD Bias Voltage
		14	Ground
KEYBOARD	J3	1	Keypad Row 1 Input
		2	Keypad Row 2 Input
		3	Keypad Row 3 Input
		4	Keypad Row 4 Input
		5	Keypad Col 1 Select
		6	Keypad Col 2 Select
		7	Keypad Col 3 Select
		8	Keypad Col 4 Select
LCD BACKLIGHT	J4	1	+5V Supply
		2	NC
		3	Ground

Connector Label	Reference Designator	Pin	Signal Description
EXPANSION I/O	J1	1	Analog Voltage Input 1
		2	Analog Voltage Input 2
		3	Analog Voltage Input 3
		4	Ground
		5	Analog Voltage Input 4
		6	Analog Voltage Input 5
		7	Analog Voltage Input 6
		8	Ground
		9	Analog Voltage Input 7
		10	Analog Voltage Input 8
		11	Ground
		12	NC
		13	Current Output Return
		14	Ground
		15	Current Output 1
		16	Current Output Return
		17	Current Output 2
		18	Current Output Return
		19	Current Output 3
		20	Current Output Return
		21	Current Output 4
		22	Current Output Return
		23	Current Output 5
		24	Current Output Return
		25	Current Output 6
Mother BD	J2	1	+5V
		2	+24V
		3	+24V
		4	Ground
		5	Ground
		6	Ground
		7	+RS485 to Motherboard
		8	-RS485 to Motherboard

Table 6-8. I/O Expansion	Board (Optional) Connector	Pin Descriptions
--------------------------	----------------------------	------------------

Connector Label	Reference Designation	Pin	Signal Description
MOTHER BD	J1	1	+5V
	-	2	+24V
		3	+24V
		4	Ground
		5	Ground
		6	Ground
		7	SPI Reset
		8	SPI Input
		9	SPI Output
		10	SPI Board Select
		11	SPI Clock
DIGITAL OUTPUTS	J2	1	Relay 1 Contact a
		2	Relay 2 Contact a
		3	Relay 3 Contact a
		4	Relay 4 Contact a
		5	Relay 5 Contact a
		6	Relay 6 Contact a
		7	Relay 7 Contact a
		8	Relay 8 Contact a
		9	Relay 9 Contact a
		10	Relay 10 Contact a
		11	NC
		12	Solenoid Drive Outpu
		13	Solenoid Drive Outpu
		14	Solenoid Drive Outpu
		15	Solenoid Drive Outpu
		16	Solenoid Drive Outpu
		17	Solenoid Drive Outpu
		18	Solenoid Drive Outpu
		19	Solenoid Drive Outpu
		20	Relay 1 Contact b
		21	Relay 2 Contact b

Table 6–9. Digital Output Board Connector Pin Descriptions

Connector Label	Reference Designation	Pin	Signal Description
		22	Relay 3 Contact b
		23	Relay 4 Contact b
		24	Relay 5 Contact b
		25	Relay 6 Contact b
		26	Relay 7 Contact b
		27	Relay 8 Contact b
		28	Relay 9 Contact b
		29	Relay 10 Contact b
		30	+24V
		31	+24V
		32	+24V
		33	+24V
		34	+24V
		35	+24V
		36	+24V
		37	+24V

Table 6–10.	Input Board	Connector Pin	Descriptions

Connector Label	Reference Designator	Pin	Signal Description
PMT IN	J1	1	PMT Input
		2	Ground
INTF BD	J2	1	+15V
		2	Ground
		3	-15V
		4	+5V
		5	Ground
		6	Measurement Frequency Output
		7	Sample Hold
		8	NC
		9	Gain A
		10	Gain B

Connector Label	Reference Designator	Pin	Signal Description
FLASH TRIG	T0 J01	1	Flash Voltage
		2	Flash Trigger
		3	Ground

Table 6–11. Flas	n Trigger Pack Pin	Descriptions
------------------	--------------------	--------------

 Table 6–12. Flash Intensity Assembly Pin Descriptions

Connector Label	Reference Designator	Pin	Signal Description
FLASH INT		1	+15V
		2	-15V
		3	Ground
		4	Lamp Intensity

Service
LocationsFor additional assistance, service is available from exclusive distributors
worldwide. Contact one of the phone numbers below for product support
and technical information or visit us on the web at www.thermo.com/aqi.

1-866-282-0430 Toll Free

1-508-520-0430 International

Chapter 7 Servicing

This chapter explains how to replace the Model 43*i* Trace Level-Enhanced subassemblies. It assumes that a subassembly has been identified as defective and needs to be replaced.

For fault location information refer to the "Preventive Maintenance" chapter and the "Troubleshooting" chapter in this manual.

The service mode, described in the "Operation" chapter, includes parameters and functions that are useful when making adjustments or diagnosing problems.

For additional service assistance, see "Service Locations" at the end of this chapter.

Safety Precautions

Read the safety precautions before beginning any procedures in this chapter.



WARNING The service procedures in this manual are restricted to qualified representatives. ▲

If the equipment is operated in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired. \blacktriangle



CAUTION Carefully observe the instructions in each procedure.



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component (**Figure 7–1**). If an antistatic wrist strap is not available, be sure to touch a grounded metal object before touching any internal components. When the instrument is unplugged, the chassis is not at earth ground. ▲

DO NOT point the photomultiplier tube at a light source. This can permanently damage the tube. \blacktriangle

DO NOT attempt to clean the mirrors in the optical bench. These mirrors do not come in contact with the sample gas and should not be cleaned. Cleaning the mirrors can damage the mirrors. ▲

Handle all printed circuit boards by the edges.

Do not remove the LCD panel or frame from the LCD module. \blacktriangle

The polarizing plate is very fragile, handle it carefully.

Do not wipe the polarizing plate with a dry cloth, it may easily scratch the plate. \blacktriangle

Do not use alcohol, acetone, MEK or other Ketone based or aromatic solvents to clean the LCD module, use a soft cloth moistened with a naphtha cleaning solvent. ▲

Do not place the LCD module near organic solvents or corrosive gases.

Do not shake or jolt the LCD module. \blacktriangle




Figure 7–1. Properly Grounded Antistatic Wrist Strap

Firmware Updates

The firmware can be updated by the user in the field via the serial port or over the Ethernet. This includes both the main processor firmware and the firmware in all low-level processors. Refer to the *iPort* manual for the firmware update procedure.

Accessing the Service Mode

If the Service Menu is not displayed on the Main Menu, use the following procedure to display it.

The Service Mode screen appears.

- 2. Press 🖝 to toggle the Service Mode to ON.
- 3. Press > to return to the Main Menu.
- 4. Return to the procedure.

Replacement Parts List

Table 7–1 lists the replacement parts for the Model 43*i* Trace Level-Enhanced major subassemblies. Refer to **Figure 7–2** to identify the component location.

Table 7–1. Replacement Parts

Part Number	Description
100480-00	Front Panel Pushbutton Board
101491-08	Processor Board
100533-00	Motherboard Assembly
100539-00	Digital Output Board
100542-00	I/O Expansion Board (Optional)
102340-00	Front Panel Connector Board
102496-00	Front Panel Display
101399-00	Transformer, Step-Down, 220-240V (Optional)
101863-00	Transformer, 100V, Step-up Transformer
100862-00	Measurement Interface Board Assembly
100883-00	Input Board Assembly
8392	Trigger Board Assembly
101023-00	Pressure Transducer Assembly
102055-00	Flow Transducer
8666	Lamp, Flashtube
8884	Flash Intensity (PhotoceII) Assembly
101583-00	Kicker Assembly (Standard)
57P7104	Kicker Assembly (Heated)
8391	Photomultiplier Tube (PMT)
101024-00	PMT High Voltage Power Supply
100727-00	PMT Base Socket Assembly
101426-00	Pump 110VAC w/Plate and Fittings
8606	Pump Repair Kit (for 101426-00)
101055-00	AC Receptacle Assembly

Part Number	Description
4510	Fuse, 250VAC, 3.0 Amp, SlowBlow (for 100VAC and 110VAC models)
14007	Fuse, 250VAC, 1.60 Amp, SlowBlow (for 220-240VAC models)
101681-00	Power Supply Assembly, 24VDC, w/Base Plate and Screws
101688-00	Ambient Temperature Thermistor with Connector
100907-00	Fan, 24VDC
8630	Filter Guard Assembly (w/foam)
8919	Capillary, 0.013-inch ID (~0.5 LPM flow rate standard)
4125	Capillary, 0.020-inch ID (~1.0 LPM flow rate option)
4800	Capillary O-ring
4119	Capillary, 0.008-inch ID (Perm Oven Option)

Cable List Table 7–2 describes the Model 43*i* Trace Level-Enhanced cables. See the "Troubleshooting" chapter for associated connection diagrams and board connector pin descriptions.

Table 7–2. Model 43i Trace Level-Enhanced Cables

Part Number	Description
101036-00	00DC Power Supply, 24V Output
101037-00	115VAC Supply to Measurement Interface Board
101048-00	RS-485/Data
101038-00	Power Switch to Motherboard
101364-00	DC Power Supply Status Monitor
101054-00	Motherboard to Front Panel Board
101035-00	DC Power Supply AC Input
101033-00	AC from Receptacle
101377-00	AC to Power Switch
101355-00	Signal Output Ribbon
101695-00	Permeation Oven
101055-00	Main AC Receptacle Assembly
101267-00	Fan Power Cable

External Device Connection Components

Table 7–3 lists the standard and optional cables and components used for connecting external devices such as PCs and data loggers to an *i*Series instrument.

Table 7–3. External Device Connection Compo

Part Number	Description
101562-00	Terminal Block and Cable Kit (DB25) (optional)
101556-00	Terminal Block and Cable Kit (DB37) (optional)
102645-00	Cable, DB37M to Open End, Six Feet (optional)
102646-00	Cable, DB37F to Open End, Six Feet (optional)
102659-00	Cable, DB25M to Open End, Six Feet (optional)
6219	Cable, RS-232 (optional)
102888-00	Terminal Board PCB Assembly, DB37F (standard with all instruments)
102891-00	Terminal Board PCB Assembly, DB37M (standard with all instruments)
103084-00	Terminal Board PCB Assembly, DB25M (included with optional I/O Expansion Board in all instruments)






Figure 7–2. Model 43i Trace Level-Enhanced Component Layout

Removing the Measurement Bench and Lowering the Partition Panel

The measurement bench can be removed and the partition panel can be lowered to improve access to connectors and components. Refer to the following steps when a procedure requires lowering the partition panel (**Figure 7–3**).





Equipment Required:

Philips screwdriver



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

- 1. Turn instrument OFF and unplug the power cord.
- 2. If the instrument is mounted in a rack, remove it from the rack.
- 3. Remove the cover.
- 4. Disconnect the plumbing connections at the rear of the measurement bench.

Servicing

	5. Disconnect the connectors that pass through the center of the partition panel.
	6. Remove two screws from the left side of the case (viewed from front).
	7. Remove one screw from the bottom rear of the case.
	8. Remove one screw from the top front of the partition panel.
	9. While holding the case securely, loosen the captive screw at the rear of the measurement bench, and pull the measurement bench from the rear of the case.
	10. Remove the screw at the top rear of the partition panel securing the top of partition panel to the measurement bench, and lower the panel being careful not to put excessive tension on the cables.
	11. Replace the measurement bench by following previous steps in reverse.
Fuse	Use the following procedure to replace the fuse.
Replacement	Equipment Required:
•	Replacement fuses (refer to the "Replacement Parts List" in this chapter).
	1. Turn instrument OFF and unplug the power cord.
	2. Remove fuse drawer, located on the AC power connector.
	3. If either fuse is blown, replace both fuses.
	4. Insert fuse drawer and reconnect power cord.
Pump Replacement	Use the following procedure to replace the pump (Figure 7–4). To rebuild the pump, see "Pump Rebuilding" in the "Preventive Maintenance" chapter.
	Equipment Required:

Pump

Philips screwdriver



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect the pump power cable from the AC PUMP connector on the measurement interface board.
- 3. Remove both lines from the pump.
- 4. Loosen the four captive screws holding the pump bracket to the shock mounts and remove the pump assembly.




Figure 7-4. Replacing the Pump

- 5. Install the new pump by following the previous steps in reverse.
- 6. Perform a leak test as described in the "Preventive Maintenance" chapter.

Fan Replacement Use the following procedure to replace the fan (Figure 7–5). Equipment Required:

Fan

Philips screwdriver



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

- Turn instrument OFF, unplug the power cord, and remove the cover. 1.
- Remove the fan guard from the fan and remove the filter. 2.
- Pull the power connector off the fan. 3.
- Remove the four fan mounting screws and remove the fan. 4.
- 5. Install a new fan following the previous steps in reverse.




Figure 7–5. Replacing the Fan

Optical Bench Replacement

Use the following procedure to replace the optical bench (**Figure 7–6**). Equipment Required: Allen wrench, 5/32-inch

Philips screwdriver



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect the electrical cables from the optical bench:
 - a. Flash intensity assembly cable from the FLASH INT connector on the measurement interface board
 - b. Heater cable from AC BENCH connector on the measurement interface board
 - c. PMT BNC cable from the input board connector
 - d. PMT power cable from the HVPS
 - e. LED cable from the LED connector on the measurement interface board
 - f. Flasher assembly from the FLASH TRIG connector on the measurement interface board
 - g. Green ground wire from the floor plate
- 3. Disconnect the optical bench plumbing.
- 4. Using a 5/32-inch Allen wrench, remove the four optical bench retaining screws, and lift the optical bench off the floor plate.
- 5. Replace the optical bench by following the previous steps in reverse order.
- 6. Calibrate the instrument. Refer to the "Calibration" chapter in this manual.




Figure 7–6. Replacing the Optical Bench

Cleaning the Mirrors

The mirrors located in the optical bench do not come in contact with the sample gas and DO NOT need cleaning. Read the Equipment Damage warning that follows.



Equipment Damage DO NOT attempt to clean the mirrors in the optical bench. These mirrors do not come in contact with the sample gas and should not be cleaned. Cleaning the mirrors can damage the mirrors.

Flash Lamp Replacement

Use the following procedure to replace the flash lamp (**Figure 7–7**).

Equipment Required:

Flash lamp

Philips screwdriver




Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

1. Turn instrument OFF, unplug the power cord, and remove the cover.

- 2. Disconnect the flash trigger cable from the FLASH TRIG connector the measurement interface board.
- 3. Remove the bench (see "Optical Bench Replacement" in this chapter).
- 4. Loosen the retaining screw on the top of the lamp housing and pull out the socket assembly and lamp.

Flash Trigger Assy





- 5. Remove the old lamp from the socket assembly by pulling straight out and insert the new lamp.
- 6. Insert the socket assembly into the lamp housing, tighten the retaining screw, and reconnect the flash trigger cable.
- 7. Re-install the bench.

8.	Adjust the lamp voltage. Refer to the "Flash Lamp Voltage
	Adjustment" procedure that follows.

Flash Lamp Voltage Adjustment

Use the following procedure to adjust the flash lamp voltage.

Note The service procedures in this manual are restricted to qualified service representatives. ▲

9. From the Main Menu, press → to scroll to Service > press → to scroll to Flash Voltage Adjustment > and press →.

The Set Flash Voltage Adjustment - Man screen appears.

Note If Service Mode is not displayed, refer to "Accessing the Service Mode" in this chapter, then return to the beginning of this step. ▲

- 11. Press 🗲 to store the value.
- 12. Perform a PMT Voltage Adjustment, and recalibrate the instrument. Refer to "PMT Voltage Adjustment" in this chapter and the calibration procedures in the "Calibration" chapter.

Flash Trigger Assembly Replacement

Use the following procedure to replace the flash trigger assembly (**Figure 7–7**).

Equipment Required:

Flash trigger assembly

Philips screwdriver



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

1. Turn instrument OFF, unplug the power cord, and remove the cover.

- 2. Disconnect the flash trigger cable from the FLASH TRIG connector on the measurement interface board.
- 3. Remove the bench (see "Optical Bench Replacement" in this chapter).
- 4. Loosen the retaining screw on the top of the lamp housing and pull out the trigger assembly and lamp.
- 5. Remove the lamp from the trigger assembly by pulling straight out and insert the lamp into the new trigger assembly.
- 6. Insert the new flash trigger assembly into the lamp housing, tighten the retaining screw, and reconnect the flash trigger cable.
- 7. Re-install the bench.

Flash Intensity Assembly Replacement

Use the following procedure to replace the flash intensity assembly.

Equipment Required:

Flash intensity assembly

Phillips screwdriver, small



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component. ▲

- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect the flash intensity cable from the FLASH INT connector on the measurement interface board.
- 3. Remove the three screws securing the flash intensity assembly to the reaction chamber (**Figure 7–8**).
- 4. Install the new flash intensity assembly by following this procedure in reverse.




Figure 7–8. Replacing the Flash Intensity Assembly

Photomultiplier Tube Replacement

f Use the following procedure to replace the photomultiplier tube.

Equipment Required:

Photomultiplier tube

Philips screwdriver



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

- 1. Turn analyzer OFF, unplug the power cord, and remove the cover.
- 2. Disconnect the high voltage cable from the PMT power supply cable connector and unplug the BNC cable from the input board connector.




Figure 7–9. Replacing the PMT

- 3. Remove the three retaining screws holding the PMT cover to the PMT housing, and pull back the cover to access the two PMT base retaining screws.
- 4. Pull PMT and PMT base from the PMT housing by twisting it slightly back and forth.
- 5. To install a new PMT, follow previous steps in reverse.
- 6. Perform a photomultiplier tube calibration. See "PMT Voltage Adjustment" in this chapter.

PMT High Voltage Power Supply Replacement

Use the following procedure to replace the PMT high voltage power supply (**Figure 7–10**).

Equipment Required:

PMT high voltage power supply

Philips screwdriver



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect the two PMT high voltage supply cables.
- 3. Loosen the two retaining screws securing the power supply bracket to the floor plate and slide the power supply towards the rear slightly and lift it off the base screws.




Figure 7–10. Replacing the PMT High Voltage Power Supply (HVPS)

- 4. Loosen two screws on the input box assembly and lift the input box assembly off the bracket.
- 5. Remove the four screws securing the power supply to the bracket and remove the power supply.
- 6. To install the power supply, follow the previous steps in reverse.
- 7. Recalibrate the instrument. Refer to the calibration procedures in the "Calibration" chapter.

PMT Voltage Adjustment

Use the following procedure to adjust the PMT voltage after replacing the PMT, High Voltage Power Supply, or switching from standard to extended ranges or vice versa.

Note: The service procedures in this manual are restricted to qualified service representatives. ▲

- 1. Select the SO₂, range. Refer to "Range Menu" in the "Operation" chapter.
- 2. Reset the SO₂ BKG calibration factors to 0.0. Refer to "Calibration Factors Menu" in the "Operation" chapter.
- 3. Reset the SO_2 COEF to 1.000.
- 4. Set the Averaging Time to 10 seconds. Refer to "Averaging Time" in the "Operation" chapter.
- 5. Connect the calibration gas and allow the instrument to sample calibration gas until the reading stabilizes.
- 6. From the Main Menu, press → to scroll to Service > press → to scroll to PMT Supply Settings > and press →.

The PMT Supply Settings screen appears.

Note If Service Mode is not displayed, refer to "Accessing the Service Mode" in this chapter, then return to the beginning of this step. ▲

The Set PMT Voltage - Manual screen appears.

At the Set PMT Voltage - Manual screen, use to increment/decrement the counts until the instrument displays the calibration gas concentration value.

DC Power Supply Replacement

Use the following procedure to replace the DC power supply (**Figure 7–11**).

Equipment Required: DC power supply

Philips screwdriver



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect all the power supply electrical connections. Note connector locations to facilitate re-connection.
- 3. Loosen the captive screw securing the power supply to the chassis plate and lift out the power supply.
- 4. To install the DC power supply, follow the previous steps in reverse.




Figure 7–11. Replacing the DC Power Supply

Analog Output Testing

The analog outputs should be tested if the concentration value on the front panel display disagrees with the analog outputs. To check the analog outputs, you connect a meter to an analog output channel (voltage or current) and compare the meter reading with the output value displayed on the Test Analog Outputs screen.

Equipment Required:

Multimeter

Use the following procedure to test the analog outputs.

- 1. Connect a meter to the channel to be tested. **Figure 7–12** shows the analog output pins and **Table 7–4** identifies the associated channels.
- 2. From the Main Menu, press to scroll to Diagnostics, press
 > to scroll to Test Analog Outputs, and press

The Test Analog Outputs screen displays.

3. Press • to scroll to the desired channel corresponding to the rear panel terminal pins where the meter is connected, and press •.

The Set Analog Outputs screen displays.

4. Press 🕨 to set the output to zero.

The Output Set To line displays Zero.

- 5. Check that the meter is displaying a zero value. If the meter reading differs by more than one percent, the analog outputs should be adjusted. Refer to the "Analog Output Calibration" procedure that follows.
- 6. Press **•** to set the output to full scale.

The Output Set To line displays Full Scale.

- 7. Check that the meter is displaying the full scale value. If the meter reading differs by more than one percent, the analog outputs should be adjusted. Refer to the "Analog Output Calibration" procedure that follows.
- 8. Press to reset the analog outputs to normal.




Figure 7–12. Rear Panel Analog Input and Output Pins

Voltage Channel	Pin	Current Channel	Pin
1	14	1	15
2	33	2	17
3	15	3	19
4	34	4	21
5	17	5	23
6	36	6	25
Ground	16, 18, 19, 35, 37	Current Output Return	16, 18, 20, 22, 24

Table 7–4. Analog Output Channels and Rear Panel Pin Connections

Input Channel	Pin
1	1
2	2
3	3
4	5
5	6
6	7
7	9
8	10
Ground	4, 8, 11

Table 7–5. Analog Input Channels and Rear Panel Pin Connections

Analog Output Calibration

Use the following procedure to calibrate the analog outputs if a meter reading in the "Analog Output Testing" procedure differed by more than one percent or after replacing the motherboard or optional I/O expansion board.

Equipment Required:

Multimeter

- Connect a meter to the channel to be adjusted and set to voltage or current as appropriate. Figure 7–12 shows the analog output pins and Table 7–4 identifies the associated channels.
- 2. From the Main Menu, press → to scroll to Service, press → to scroll to Analog Out Calibration, and press →.

The Analog Output Cal screen displays.

Note If Service Mode is not displayed, refer to "Accessing the Service Mode" in this chapter, then return to the beginning of this step. ▲

- 3. At the Analog Output Cal screen, press → to scroll to the voltage channel or current channel corresponding to the rear panel terminal pins where the meter is connected, then press ←.
- 4. With the cursor at Calibrate Zero, press 🗲 .

The Analog Output Cal line displays Zero.

Note When calibrating the analog output, always calibrate zero first and then calibrate full scale. \blacktriangle

- 5. Use $(\bullet) (\bullet)$ until the meter reads the value shown in the Set Output To line, then press [🛏] to save the value.
- 6. Press [] to return to the previous screen.
- 7. Press [↓ ←) to select Calibrate Full Scale.
- 8. Use | **↑** ↓ until the meter reads the value shown in the Set Output To line, then press [←] to save the value.

Analog Input Calibration

Use the following procedures to calibrate the analog inputs after replacing the optional I/O expansion board. These procedures include selecting analog input channels, calibrating them to zero volts, and then calibrating them to full scale using a known voltage source.

Use the following procedure to calibrate the input channels to zero volts.

Channels to Zero Volts

Calibrating the Input 1. From the Main Menu, press 🔸 to scroll to Service, press 🗲 ↓] to scroll to Analog Input Calibration, and press [←

The Analog Input Cal screen displays.

Note If Service Mode is not displayed, refer to "Accessing the Service Mode" in this chapter, then return to the beginning of this step.

- 2. At the Analog Input Cal screen, press (🔸) to scroll to a channel, and press [🖊
- 3. With the cursor at Calibrate Zero, press [

The screen displays the input voltage for the selected channel.

4. Make sure that nothing is connected to the channel input pins and press to calibrate the input voltage on the selected channel to zero volts.

The screen displays 0.00 V as the voltage setting.

- 5. Press > to return to the Analog Input Cal screen and repeat Steps 2 through 4 to calibrate other input channels to zero as necessary.
- 6. Continue with the "Calibrating the Input Channels to Full Scale" procedure that follows.

Use the following procedure to calibrate the input channels to full scale by applying a known voltage to the channels.

Equipment Required:

DC voltage source (greater than 0 volts and less than 10 volts)

- Connect the known DC voltage source to the input channel (1-8) to be calibrated. Figure 7–12 shows the analog output pins and Table 7–4 identifies the associated channels.
- 2. From the Main Menu, press to scroll to Service, press >
 ↓ to scroll to Analog Input Calibration, and press .

The Analog Input Cal screen displays input channels 1-8.

- At the Analog Input Cal screen, press to scroll to the channel selected in Step 1, and press
- 4. Press 🔸 to scroll to Calibrate Full Scale, and press 🗲.

The screen displays the current input voltage for the selected channel.

Calibrating the Input Channels to Full Scale

- 5. Use • and • to enter the source voltage, and press
 to calibrate the input voltage for the selected channel to the source voltage.
- Press > to return to the input channels display and repeat Steps 3-5 to calibrate other input channels to the source voltage as necessary.

Pressure Transducer Assembly Replacement

Use the following procedure to replace the pressure transducer assembly (Figure 7–13). Equipment Required: Pressure transducer assembly Philips screwdriver



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect plumbing from the pressure transducer assembly. Note the plumbing connections to facilitate reconnection.
- 3. Disconnect the pressure transducer cable from the measurement interface board.
- 4. Loosen the two pressure transducer assembly retaining screws and remove the pressure transducer assembly by sliding it down then taking it out.
- 5. To install the pressure transducer assembly, follow the previous steps in reverse.
- 6. Calibrate the pressure transducer. Refer to the "Pressure Transducer Calibration" procedure that follows.




Figure 7–13. Replacing the Pressure Transducer Assembly

Use the following procedure to calibrate the pressure transducer.

Pressure Transducer Calibration

Notes An error in the zero setting of the pressure transducer does not introduce a measurable error in the output concentration reading. Therefore, if only a barometer is available and not a vacuum pump, adjust

A rough check of the pressure accuracy can be made by obtaining the current barometric pressure from the local weather station or airport and comparing it to the pressure reading. However, since these pressures are usually corrected to sea level, it may be necessary to correct the reading to local pressure by subtracting 0.027 mm Hg per foot of altitude.

Do not try to calibrate the pressure transducer unless the pressure is known accurately. \blacktriangle

Equipment Required:

only the span setting. \blacktriangle

Vacuum pump



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

- 1. Remove the cover.
- 2. Disconnect the tubing from the pressure transducer and connect a vacuum pump known to produce a vacuum less than 1 mm Hg.
- 3. From the Main Menu, press → to scroll to Service > press → to scroll to Pressure Calibration > and press →.

The Pressure Sensor Cal menu appears.

Note If Service Mode is not displayed, refer to "Accessing the Service Mode" in this chapter, then return to the beginning of this step. ▲

- 5. Wait at least 10 seconds for the zero reading to stabilize, then pressto save the zero pressure value.
- 6. Disconnect the pump from the pressure transducer.
- 7. Press to return to the Pressure Sensor Cal screen.
- 8. At the Pressure Sensor Cal screen, press

 to select Span.

 The Calibrate Pressure Span screen appears.
- 9. Wait at least 10 seconds for the ambient reading to stabilize, use
 and
 to enter the known barometric pressure, and press
 to save the pressure value.
- 10. Reconnect the instrument tubing to the pressure transducer.
- 11. Install the cover.

Flow Transducer Replacement

Use the following procedure to replace the flow transducer (**Figure 7–14**). Equipment Required: Flow transducer

Philips screwdriver



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect the plumbing connections from the flow transducer. Note the plumbing connections to facilitate reconnection.
- 3. Disconnect the flow transducer cable from the FLOW connector on the measurement interface board.
- 4. Remove the two screws securing the flow transducer to the kicker bracket and remove the flow transducer.
- 5. Install the new flow transducer following the previous steps in reverse.
- 6. Calibrate the flow transducer. Refer to the "Flow Transducer Calibration" procedure that follows.




Figure 7–14. Replacing the Flow Transducer

Flow Transducer Calibration

Use the following procedure to calibrate the flow transducer. Equipment Required:

Calibrated flow sensor



WARNING The service procedures in this manual are restricted to qualified representatives. ▲

If the equipment is operated in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired. \blacktriangle



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

1. Remove the cover.

- 2. Disconnect the pump cable from AC PUMP connector on the measurement interface board.
- 3. From the Main Menu, press to scroll to Service > press >
 ↓ to scroll to Flow Calibration > and press .

The Flow Sensor Cal screen appears.

Note If Service Mode is not displayed, refer to "Accessing the Service Mode" in this chapter, then return to the beginning of this step. ▲

4. At the Flow Sensor Cal screen, press *to* select **Zero**.

The Calibrate Flow Zero screen appears.

- 5. Wait at least 10 seconds for the zero reading to stabilize, then pressto save the zero flow value.
- 6. Reconnect the pump cable to the AC PUMP connector on the measurement interface board.
- 7. Connect a calibrated flow sensor at the SAMPLE bulkhead on the rear panel.
- 8. Press **•** to return to the Flow Sensor Cal screen.
- 9. At the Flow Sensor Cal screen, press 🔸 🖝 to select **Span**.

The Calibrate Flow Span screen appears.

10. Wait at least 10 seconds for the reading to stabilize, use
and
to enter the flow sensor reading, and press
to save the value.

11. Install the cover.

Heater Assembly Replacement

Use the following procedure to replace the heater assembly (**Figure 7–15**). Equipment Required: Heater assembly Heat sink grease Philips screwdriver Allen wrench, 5-32-inch



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect heaters from the AC BENCH cable.
- 3. Using the 5-32-inch wrench, remove the four screws securing the optical bench to the floor plate (**Figure 7–6**).
- 4. Lift the optical bench from the floor plate to gain access to the heater assembly.
- 5. Remove two retaining screws and washers from each heater and remove the heaters (**Figure 7–15**).
- 6. Apply heat sink grease to the new heaters as appropriate.
- 7. Fasten each heater with the two retaining screws and washers.
- 8. Secure the optical bench to the floor plate with the four screws.
- 9. Connect the heaters to the AC BENCH cable.
- 10. Replace the cover and plug in the power cord.




Figure 7–15. Replacing the Heater Assembly

Kicker Replacement

Use the following procedure to replace the kicker assembly (**Figure 7–16**). Equipment Required:

Kicker assembly

Cable ties



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect the plumbing connections from the flow transducer, the optical bench, and the rear bulkhead. Note the plumbing connections to facilitate reconnection.




Figure 7–16. Replacing the Kicker Assembly

- 3. Cut the ties securing the kicker assembly to the kicker bracket and remove the kicker.
- 4. Install the new kicker, following the previous steps in reverse.

Thermistor Replacement

Use the following procedure to replace the ambient temperature thermistor (**Figure 7–17**).

Equipment Required:

Thermistor



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Squeeze the thermistor latch and pull the thermistor from the AMB TEMP connector on the measurement interface board.
- 3. Snap the new thermistor into the AMB TEMP connector.




Figure 7–17. Replacing the Thermistor

Ambient Temperature Calibration

Use the following procedure to calibrate the ambient internal temperature for the instrument.

Equipment Required:

Calibrated thermometer or 10K ±1% resistor



WARNING The service procedures in this manual are restricted to qualified representatives. ▲

If the equipment is operated in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired. \blacktriangle



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

1. Remove the instrument cover.

2. Tape the thermistor (plugged into the measurement interface board) to a calibrated thermometer

Note Since the thermistors are interchangeable to an accuracy of ± 0.2 °C, and have a value of 10K ohms at 25 °C, an alternate procedure is to connect an accurately known 10K resistor to the thermistor input (AMB TEMP) on the measurement interface board, and enter the temperature reading.

A 1 °C change corresponds to a \pm 5% change in resistance, thus this alternative procedure can be quite accurate as a check; however, it clearly is not NIST traceable.

3. From the Main Menu, press → to scroll to Service > press → to scroll to **Temperature Calibration** > and press →.

The Calibrate Ambient Temperature screen appears.

Note If Service Mode is not displayed, refer to "Accessing the Service Mode" in this chapter, then return to the beginning of this step. ▲

- 4. Wait at least 10 seconds for the ambient reading to stabilize, use

 and
 to enter the known temperature, and press
 to save the temperature value.
- 5. Install the cover.

Input BoardUse the following procedure to replace the input board (Figure 7–18).ReplacementEquipment Required:

Input board

Philips screwdriver

- 1. Disconnect the BNC signal cable and the ribbon cable.
- 2. Loosen the two screws securing the bracket holding the input board to the floor plate, slide the bracket towards the optical bench slightly, and lift it off the base screws.




Figure 7–18. Replacing the Input Board

- 3. Loosen the two screws securing the input board assembly to the bracket, slide the assembly up, and remove from bracket.
- 4. Install the input board assembly by following the previous steps in reverse.

I/O Expansion Board (Optional) Replacement

Use the following procedure to replace the optional I/O expansion board (**Figure 7–19**).

Note After replacing the optional I/O expansion board, calibrate the current outputs and the analog voltage inputs. See the "Analog Output Calibration" procedure and the "Analog Input Calibration" procedure in this chapter. ▲

Equipment Required:

I/O expansion board

Nut driver, 3/16-inch



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Unplug the I/O expansion board cable from the EXPANSION BD connector on the motherboard.
- 3. Remove the two standoffs holding the I/O expansion board connector to the rear panel (**Figure 7–20**).
- 4. Pop off the board from the mounting studs and remove the board.
- 5. To install the I/O expansion board, follow previous steps in reverse.
- 6. Calibrate the analog current outputs and analog voltage inputs per the procedure earlier in this chapter.




Figure 7–19. Replacing the I/O Expansion Board (Optional)




Figure 7–20. Rear Panel Board Connectors

Digital Output Board Replacement

Use the following procedure to replace the digital output board (**Figure 7–18** and **Figure 7–19**).

Equipment Required:

Digital output board

Nut driver, 3/16-inch



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Remove the I/O expansion board (optional), if used. See the "I/O Expansion Board Replacement" procedure in this chapter.
- 3. Disconnect the digital output board ribbon cable from the motherboard.
- 4. Using the nut driver, remove the two standoffs securing the board to the rear panel (**Figure 7–19**).

- Motherboard Replacement
- 5. Pop off the digital output board from the mounting studs and remove the board.
- 6. To install the digital output board, follow previous steps in reverse.

Use the following procedure to replace the motherboard (Figure 7–18).

Equipment Required:

Motherboard Philips screwdriver Nut driver, 3/16-inch



- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Remove the I/O expansion board (optional), if used. See the "I/O Expansion Board Replacement" procedure in this chapter.
- 3. Remove the digital output board. See the "Digital Output Board Replacement" procedure in this chapter.
- 4. Unplug all connectors from the motherboard. Note connector locations to facilitate reconnection.
- 5. Using the nut driver, remove the standoffs securing the board to the rear panel (**Figure 7–19**).
- 6. Pop off the motherboard from motherboard support bracket, and remove the motherboard.
- 7. To install the motherboard, follow previous steps in reverse.
- 8. Calibrate the analog voltage outputs. Refer to "Analog Output Calibration" in this chapter.

Measurement Interface Board Replacement

Use the following procedure to replace the measurement interface board (**Figure 7–21**).

Equipment Required:

Measurement interface board

Philips screwdriver



- 1. Refer to "Removing the Measurement Bench and Lowering the Partition Panel" in this chapter to lower the partition panel, then proceed to the next step below.
- 2. Unplug all connectors. Note the locations of the connectors to facilitate reconnection.
- 3. Unscrew the two screws at the top of the measurement interface board. Pop off the measurement interface board from the two bottom mounting studs and remove the board.
- 4. To install the measurement interface board, follow previous steps in reverse.
- 5. Re-install the measurement bench. Refer to "Removing the Measurement Bench and Lowering the Partition Panel" in this chapter.




Figure 7–21. Replacing the Measurement Interface Board

Front Panel Board Replacement

Equipment Required: Front panel board



Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

Use the following procedure to replace the front panel board (Figure 7–22).

- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Remove the three ribbon cables and the two-wire connector from the front panel board.
- 3. Pop off the board from the two top mounting studs and remove the board by lifting it up and off the slotted bottom support.
- 4. Replace the front panel board by following previous steps in reverse.




Figure 7–22. Replacing the Front Panel Board and the LCD Module

LCD Module Replacement

Use the following procedure to replace the LCD module (**Figure 7–22**).

Equipment Required:

LCD module

Philips screwdriver



it off immediately using soap and water. ▲Equipment Damage Some internal components can be damaged by small

CAUTION If the LCD panel breaks, do not to let the liquid crystal contact your skin or clothes. If the liquid crystal contacts your skin or clothes, wash

Equipment Damage Some internal components can be damaged by small amounts of static electricity. A properly ground antistatic wrist strap must be worn while handling any internal component.

Do not remove the panel or frame from the module. \blacktriangle

The polarizing plate is very fragile, handle it carefully.

Do not wipe the polarizing plate with a dry cloth, it may easily scratch the plate. \blacktriangle

Do not use alcohol, acetone, MEK or other Ketone based or aromatic solvents to clean the module, use a soft cloth moistened with a naphtha cleaning solvent. ▲

Do not place the module near organic solvents or corrosive gases.

Do not shake or jolt the module. \blacktriangle

- 1. Turn instrument OFF, unplug the power cord, and remove the cover.
- 2. Disconnect the ribbon cable and the two-wire connector from the front panel board.
- 3. Remove the four screws at the corners of the LCD module.
- 4. Slide the LCD module out towards the top of the instrument.
- 5. Replace the LCD module by following previous steps in reverse.

Service Locations

For additional assistance, service is available from exclusive distributors worldwide. Contact one of the phone numbers below for product support and technical information or visit us on the web at www.thermo.com/aqi.

1-866-282-0430 Toll Free

1-508-520-0430 International

Chapter 8 System Description

This chapter describes the function and location of the system components, provides an overview of the software structure, and includes a description of the system electronics and input/output connections and functions as follows.

Hardware

Model 43*i* Trace Level-Enhanced hardware components (**Figure 8–1**) include:

- Hydrocarbon kicker
- Optics
 - Flash lamp
 - Condensing lens
 - Mirror assembly
 - Relay Lens
 - Light baffle
- Trigger pack
- Reaction chamber
 - Bandpass filter
- Photomultiplier tube
- Photodetector
- Flow sensor
- Pressure transducer
- Capillary
- Vacuum Pump




Figure 8–1. Hardware Components

Hydrocarbon Kicker The hydrocarbon kicker removes hydrocarbons from the gas stream while leaving the SO₂ concentration unaffected. It operates on a selective permeation principle using differential pressure to force hydrocarbon molecules to pass through the tube wall. The differential pressure is created across the tube wall as sample gas passes through a capillary tube which reduces its pressure. The sample gas is then fed to the shell side of the hydrocarbon kicker. The kicker may be optionally mounted to the bench to provide heating.

Optics The optics section provides the light source for the fluorescence reaction and optimizes the reaction with a system of lenses and mirrors. It includes a flash lamp, condensing lens, mirror assembly, relay lens, and light baffle.

Flash Lamp	The flash lamp provides the ultraviolet light source that causes the fluorescence reaction in the SO ₂ molecules.	
Condensing Lens	The condensing lens focuses light from the flash lamp into the mirror assembly.	
Mirror Assembly	A set of eight mirrors selectively reflects only those wavelengths used in exciting SO_2 molecules. This reflective filtering causes the radiation reaching the detection chamber to be more intense and more stable throughout the lifetime of the instrument.	
Relay Lens	The relay lens is used to optically couple the primary and secondary monochromaters.	
Light Baffle	The circular baffle helps keep stray light from entering the detection volume.	
Flash Lamp Trigger Assembly	The flash lamp trigger assembly pulses the UV flash lamp at a rate of 10 times per second for improved signal-to-noise ratio and long term stability.	
	 The lamp is operated in the pulsed mode for six major reasons: Long life High optical intensity – improved signal to noise ratio Small size Low power requirements – less than 1 watt Long-term stability Chopped signal processing – no dark current drift 	
Reaction Chamber	In the reaction chamber pulsating light from the flash lamp excites the SO ₂ molecules. A condenser lens collects and focuses light from fluorescing SO ₂ molecules onto the mirror assembly.	

Bandpass Filter	The bandpass filter restricts the light reaching the photomultiplier tube to the SO_2 fluorescence wavelengths.
Photomultiplier Tube	The PMT converts optical energy from the reaction to an electrical signal. This signal is sent to the input board which transmits it to the processor.
Photodetector	The photodetector is located in the fluorescence chamber and continuously monitors the pulsating UV flash lamp. This photodetector is connected to a circuit that automatically compensates for fluctuations in flash lamp output.
Flow Sensor	The flow sensor is used for measuring the flow of sample gas in the measurement system.
Pressure Transducer	The pressure transducer or pressure sensor measures the reaction chamber pressure.
Capillary	The capillary along with the pump is used to control flow in the sample line.
Vacuum Pump	The vacuum pump draws the reacted gases out of the reaction chamber.
Software	 The processor software tasks are organized into four areas: Instrument Control Monitoring Signals Measurement Calculations Output Communication
Instrument Control	Low-level embedded processors are used to control the various functions on the boards, such as analog and digital I/O, and heater control. These processors are controlled over a serial interface with a single high-level

	processor that also controls the front-panel user interface. The low-level processors all run common firmware that is bundled with the high-level firmware and loaded on power-up if a different version is detected.
	Each board has a specific address that is used to identify to the firmware what functions are supported on that board. This address is also used for the communications between the low-level processors and the high-level processor.
	Every tenth of a second the frequency counters, analog I/O, and digital I/O are read and written to by the low-level processor. The counters are accumulated over the past second and the analog inputs are averaged over that second. The high-level processor polls the low-level processors once per second to exchange the measurement and control data.
Monitoring Signals	Signals are gathered from the low-level processors once per second, and then processed by the high-level processor to produce the final measurement values. The one-second accumulated counts are accumulated and reported for the user-specified averaging time. If this averaging time is greater than ten seconds, the measurement is reported every 10 seconds. The one-second average of the other analog inputs are reported directly (no additional signal conditioning is performed by the high-level processor).
Measurement Calculations	The calculation begins by flashing the lamp 10 times per second. After the lamp flash, a sample and hold circuit on the input board is used to sample the PMT output. The raw accumulated counts are scaled according to the gain setting of the input board.
	Next, the uncorrected values are determined according to a unique averaging algorithm which minimizes errors resulting from rapidly changing gas concentrations. This algorithm results in values which are stored in RAM in a circular buffer that holds all the ten second data from the previous five minutes. This data is averaged over the selected time interval, which can be any multiple of ten between 1 and 300 seconds.
	The background values, which are corrected for temperature, are subtracted from their respective averages. The reading is corrected by the stored span factor and by the temperature factor.
Output Communication	The front panel display, serial and Ethernet data ports, and analog outputs are the means of communicating the results of the above calculations. The front panel display presents the SO ₂ concentrations. The display is updated every 1-10 seconds, depending on the averaging time.

The analog output ranges are user selectable via software. The analog	
outputs are defaulted based on the measurement range. The defaults are	
calculated by dividing the data values by the full-scale range for each of the	
three parameters and then multiplying each result by the user-selected	
output range. Negative concentrations can be represented as long as they	
are within -5% of full-scale. The zero and span values may be set by the	
user to any desired value.	

Electronics All electronics operate from a universal switching supply, which is capable of auto-sensing the input voltage and working over the entire operating range.

The internal pump and heaters all operate on 110VAC. An optional transformer is required if operating on the 210-250VAC or 90-110VAC ranges.

An on/off switch controls all power to the instrument, and is accessible on the front panel.

Motherboard The motherboard contains the main processor, power supplies, a subprocessor and serves as the communication hub for the instrument.

The motherboard receives operator inputs from the front panel mounted function key panel and/or over I/O connections on the rear panel and sends commands to the other boards to control the functions of the instrument and to collect measurement and diagnostic information.

The motherboard outputs instrument status and measurement data to the front-panel mounted graphics display and to the rear-panel I/O.

The motherboard also contains I/O circuitry and the associated connector to monitor external digital status lines and to output analog voltages that represent the measurement data.

Connectors located on the motherboard include:

External Connectors External connectors include:

- External Accessory
- RS-232/485 Communications (two connectors)
- Ethernet Communications
- I/O connector with Power Fail Relay, 16 Digital Inputs, and 6 Analog Voltage Outputs.

Internal Connectors Internal connectors include:

- Function key panel and Display
- Measurement Interface Board Data
- I/O Expansion Board Data
- Digital Output Board
- AC distribution

Measurement Interface Board

Measurement Interface Board Connectors

The measurement interface board serves as a central connection area for all measurement electronics in the instrument. It contains power supplies and interface circuitry for sensors and control devices in the measurement system. It sends status data to the motherboard and receives control signals from the motherboard.

Connectors located on the measurement interface board include:

- Data communication with the motherboard
- 24V and 120VAC power supply inputs
- Fan and solenoid outputs
- 120VAC outputs for the pump and temperature control
- Flow and pressure sensors
- Ambient temperature sensor
- Bench heater
- PMT high voltage supply
- Input board
- Flash trigger
- Flash intensity
- Diagnostic LED

Flow Sensor Assembly

The flow sensor assembly consists of a board containing an instrumentation amplifier and a flow transducer with input and output gas fittings. The flow transducer output is produced by measuring the pressure difference across a precision orifice. This unit is used for measuring the flow of sample gas in the measurement system.

Pressure Sensor Assembly	The pressure sensor assembly consists of a board containing an instrumentation amplifier and a pressure transducer with a gas input fitting. The pressure transducer output is produced by measuring the pressure difference between the sample gas pressure and ambient air pressure.
Bench Heater	The fluorescence chamber temperature is measured with a thermistor. The voltage across the thermistor is fed to the main processor for use in calculating and displaying the reaction chamber temperature. The voltage across the thermistor is also compared to a set-point voltage and used to control that the reaction chamber heaters to maintain a constant temperature.
PMT Power Supply Assembly	The PMT power supply produces high voltage to operate the photomultiplier tube used in the measurement system. The output voltage is adjustable from approximately 600 to 1200 volts under software control.
Diagnostic LED	The diagnostic LED is used to provide an alternate light source to the PMT to determine if the PMT is operating when the operating condition of the flash lamp is unknown.
Input Board	The input board accepts the current signal from the PMT and converts it to a voltage, which is scaled by a factor of approximately 1, 10, or 100 depending on the full-scale range of the SO_2 channel. The scaled voltage signal is converted to a frequency and sent to the microprocessor.
Digital Output Board	The digital output board connects to the motherboard and provides solenoid driver outputs and relay contact outputs to a connector located on the rear panel of the instrument. Ten relay contacts normally open (with power off) are provided which are electrically isolated from each other. Eight solenoid driver outputs (open collector) are provided along with a corresponding +24VDC supply pin on the connector.
Front Panel Connector Board	The front panel connector board interfaces between the motherboard and the front panel mounted function key panel and Graphics display. It serves as central location to tie the three connectors required for the function key panel, the graphics display control lines, and the graphics display backlight to a single ribbon cable extending back to the motherboard. This board

	also includes signal buffers for the graphics display control signals and a high voltage power supply for the graphics display backlight.
Flash Trigger Board	The flash trigger board is located in the base of the flash lamp assembly. It receives high voltage and the trigger signal from the measurement interface board and uses a small transformer to produce a short, high-voltage pulse to fire the flash lamp.
Flash Intensity Board	The flash intensity board amplifies the lamp intensity signal detected by the photodetector which is used to control the lamp voltage.
I/O Expansion Board (Optional)	The I/O expansion board connects to the motherboard and adds the capability to input external analog voltage inputs and to output analog currents via a connector located on the rear panel of the instrument. It contains local power supplies, a DC/DC isolator supply, a sub-processor and analog circuits. Eight analog voltage inputs are provided with an input voltage range of 0V to10VDC. Six current outputs are provided with a normal operating range of 0 to 20 mA.
I/O Components	External I/O is driven from a generic bus that is capable of controlling the following devices:
	Analog output (voltage and current)
	Analog input (voltage)
	Digital output (TTL levels)
	• Digital input (TTL levels)
	Note The instrument has spare solenoid valve drivers and I/O support for future expansion. ▲
Analog Voltage Outputs	The instrument provides six analog voltage outputs. Each may be software configured for any one of the following ranges, while maintaining a minimum resolution of 12 bits:
	• 0-100mV
	• 0-1V
	• 0-5V
	• 0-10V

	The user can calibrate each analog output zero and span point through firmware. At least 5% of full-scale over and under range are also supported.
	The analog outputs may be assigned to any measurement or diagnostic channel with a user-defined range in the units of the selected parameter. The voltage outputs are independent of the current outputs.
Analog Current Outputs (Optional)	The optional I/O Expansion board includes six isolated current outputs. These are software configured for any one of the following ranges, while maintaining a minimum resolution of 11 bits:
	• 0-20 mA
	• 4-20 mA
	The user can calibrate each analog output zero and span point through firmware. At least 5% of full-scale over and under range are also supported.
	The analog outputs may be assigned to any measurement or diagnostic channel with a user-defined range in the units of the selected parameter. The current outputs are independent of the voltage outputs. The current outputs are isolated from the instrument power and ground, but they share a common return line (Isolated GND).
Analog Voltage Inputs (Optional)	The optional I/O expansion board includes eight analog voltage inputs. These inputs are used to gather measurement data from third-party devices such as meteorological equipment. The user may assign a label, unit, and a voltage to user-defined unit conversion table (up to 16 points). All voltage inputs have a resolution of 12 bits over the range of 0 to 10 volts.
Digital Relay Outputs	The instrument includes one power fail relay on motherboard and ten digital output relays on the digital output board. These are reed relays rated for at least 500 mA @ 200VDC.
	The power fail relay is Form C (both normally opened and normally closed contacts). All other relays are Form A (normally opened contacts) and are used to provide alarm status and mode information from the analyzer, as well as remote control to other devices, such as for controlling valves during calibration. The user may select what information is sent out each relay and whether the active state is opened or closed.

Digital Inputs Sixteen digital inputs are available which may be programmed to signal instrument modes and special conditions including:

- Zero Gas Mode
- Span Gas Mode
- Set Background
- Cal to low span
- Cal to high span
- Analog outputs to zero
- Analog outputs to full scale

The actual use of these inputs will vary based on analyzer configuration.

The digital inputs are TTL level compatible and are pulled up within the analyzer. The active state can be user defined in firmware.

Serial Ports Two serial ports allow daisy chaining so that multiple analyzers may be linked using one PC serial port.

The standard bi-directional serial interface can be configured for either RS-232 or RS-485. The serial baud rate is user selectable in firmware for standard speeds from 1200 to 19,200 baud. The user can also set the data bits, parity, and stop bits. The following protocols are supported:

- C-Link
- Streaming Data
- Modbus Slave
- Geysitech (Bayern-Hessen)

The Streaming Data protocol transmits user-selected measurement data via the serial port in real-time for capture by a serial printer, data logger, or PC.

RS-232 Connection A null modem (crossed) cable is required when connecting the analyzer to an IBM Compatible PC. However, a straight cable (one to one) may be required when connecting the analyzer to other remote devices. As a general rule, when the connector of the host remote device is female, a straight cable is required and when the connector is male, a null modem cable is required.

Data Format:

1200, 2400, 4800, 9600, 19200, 38400, 57600, or 115200 BAUD 8 data bits 1 stop bit no parity

All responses are terminated with a carriage return (hex 0D)

Refer to **Table 8–1** for the DB9 connector pin configuration.

Table 8–1. RS-232 DB Connector Pin Configurations

DB9 Pin	Function
2	RX
3	ТХ
7	RTS
8	CTS
5	Ground

RS-485 Connection The instrument uses a four wire RS-485 configuration with automatic flow control (SD). Refer to **Table 8–2** for the DB9 connector pin configuration.

Table 8–2. RS-485 DB Connector Pin Configuration

DB9 Pin	Function
2	+ receive
8	- receive
7	+ transmit
3	- transmit
5	ground

Ethernet Connection An RJ45 connector is used for the 10Mbs Ethernet connection supporting TCP/IP communications via standard IPV4 addressing. The IP address may be configured for static addressing or dynamic addressing (set using a DHCP server).

Any serial port protocols may be accessed over Ethernet in addition to the serial port.

External Accessory Connector

The external accessory connector is not used in the Model 43*i* Trace Level-Enhanced analyzer.

This port is used in other models to communicate with smart external devices that may be mounted hundreds of feet from the analyzer using an RS-485 electrical interface.

System Description I/O Components

Internal Zero/Span and Sample Valves

Internal Permeation Span Source

Chapter 9 Optional Equipment

With the zero/span assembly option, a source of span gas is connected to the SPAN port and a source of zero air is connected to the ZERO port. Zero and span gas should be supplied at atmospheric pressure. It may be necessary to use an atmospheric dump bypass plumbing arrangement to accomplish this.

See the "Installation" and "Operation" chapters for more information.

The Internal Permeation Span Source option is designed to provide a simple span check. This option is intended as a quick, convenient check to be used between zero and span calibrations for determining instrument malfunction or drift. Because this option does not precisely control dilution gas flow, it should not be used as a basis for instrument zero and span adjustments, calibration updates or adjustment of ambient data.

Whenever there is an indication of possible instrument drift or malfunction, a full zero and multipoint calibration (Level 1) should be performed prior to corrective action. For further information on zero, span and calibration of air pollution monitors, refer to Section 2.0.9 of the US EPA's *Quality Assurance Handbook for Air Pollution Measurement Systems* (Volume II).

Figure 9–1 shows how this option is integrated with the Model 43i Trace Level-Enhanced components. Energizing the sample valve V1 shuts off the sample flow and permits the flow of zero air for analysis. When valves V1 and V2 are energized, the flow of zero air mixes with air containing SO₂ from the permeation oven. This mode of operation provides a single point span check.




Figure 9–1. Internal Permeation Span Source Flow Diagram

Permeation Tube Installation

Use the following procedure to install the permeation tube.

- 1. Remove the oven cover.
- 2. Remove the glass chamber assembly by loosening the white plastic retaining collar, loosening (not removing) the knurled screw, and gently pulling the assembly upward. Completely remove the oven.
- 3. Separate the glass chamber from the top assembly by twisting and gently pulling the glass away from the top.

Note Keep the glass clean when handling it. \blacktriangle

- 4. Place the permeation tube(s) in the glass chamber.
- 5. Attach the glass chamber to the top assembly by gently pushing the two together with a slight twisting motion.
- 6. Replace the glass chamber assembly into the oven until the top of the assembly is flush or slightly below the top of the oven.



Equipment Damage Do not use tools to tighten the knurled screw in the following step. ▲

- 7. Tighten the knurled screw finger tight. Do not use tools to tighten.
- 8. Tighten the white plastic retaining collar.
- 9. Replace the oven cover being careful to place the tubing and wiring into the cover slot.

Computation of Concentrations

The computation of SO_2 output level is shown in the following information. Note that is assumed that all devices are properly calibrated and that all flows are corrected to 25 °C and 1 atm.

Permeation Tube:

$$Output (ppm) = \frac{(R)(K)}{Q_o}$$

Where:

R = permeation rate in ng/min

 Q_0 = flow rate of gas (scc/min) into the charcoal scrubber during span mode

K = constant for the specific permeant = 24.45 / MW

MW = molecular weight

 $\mathrm{K(SO_2)}=0.382$

Oven Installation and Configuration

Use the following procedure to install and configure the permeation oven.

- 1. Physically install the permeation oven and valves into the instrument and connect the cables and plumbing.
- 2. From the Perm Oven Settings menu in the Service menu, select **Perm Oven Selection**, then select **45** °C.
- 3. Remove the thermistor from POJ1 on the measurement interface board.
- 4. Connect a resistance of approximately 3.8 K Ω across pins 1 and 2 of POJ1.

- 5. Go to the Factory Cal Gas Therm menu from the Perm Oven Settings menu in the Service menu. Select Low Point, enter the exact value of the resistor and press to calibrate the low resistance point.
- 6. Press **•** to return to the Factory Cal Gas Therm menu.
- 7. Connect a resistance of approximately 5 K Ω across pins 1 and 2 of POJ1.
- 9. Press **•** to return to the Factory Cal Gas Therm menu.
- 10. Remove resistor from POJ1 and re-attach the gas thermistor.
- 11. Connect a resistance of approximately 3.8 K Ω across pins 3 and 4 of POJ3.
- 13. Press **b** to return to the Factory Cal Oven Therm menu.
- 14. Connect a resistance of approximately 5 K Ω across pins 3 and 4 of POJ3.
- 15. Go to the High Point screen, enter the exact value of the resistor and press to calibrate the high resistance point.
- 16. Press **•** to return to the Factory Cal Oven Therm menu.
- 17. Remove resistor from POJ3 and re-attach the permeation oven.
- 18. Perform a thermistor calibration using the "Permeation Tube Oven Calibration" procedure that follows.

Permeation Tube Oven Calibration	There are two general approaches that can be used to calibrate the permeation tube oven. The first is to calibrate the temperature indicator very accurately (to better than 0.02 °C) and to use a permeation tube whose weight loss has been previously determined at that temperature.				
	Note An error of approximately 0.1 °C corresponds to an error of 1% in release rate. ▲				
	The second approach is to note that the thermistors used to measure temperature are interchangeable to better than ± 0.2 °C. Thus a 1% resistor of the proper value (4.369 K Ω for 45 °C) can be used to set the span on the measurement interface board. The release rate for the permeation tube is then determined by weight loss in the actual oven being used.				
Setting Perm Oven Temperature	-				
	Alternatively, you can perform the "Setting Perm Oven Temperature" procedure and then continue with the "Setting Temperature with Known Resistance" procedure.				
	In either case, use the following procedure for setting the perm oven temperature.				
	1. Unplug POJ3 from the measurement interface board. Place a 4.369 $K\Omega$ resistor across pins 3 and 4 on the board.				
	 From the Permeation Oven menu in the Service menu, select Cal Oven Thermistor (Figure 9–2). 				
	CAL OVEN THERM (RESISTOR): CURRENTLY: 4369 Ohms SET TO: 04369 Ohms				
	←→ MOVE CURSOR ★↓ CHANGE VALUE ← SAVE				

Figure 9–2. Cal Oven Therm Resistor Screen

AVG

DIAGS ALARM

RANGE

•	
	 Enter the exact value of the attached resistor and press to save the offset.
	4. Press to return to the Permeation Oven menu.
	5. Remove the resistor and re-attach the permeation oven to POJ3.
Setting Temperature with Water Bath	Use the following procedure for setting the measure temperature with water bath.
	1. Remove the thermistor from the permeation tube oven, but leave the thermistor connected to the measurement interface board. Insert the thermistor into the water bath next to an NIST traceable thermometer (if necessary, use an extension cable to reach).
	2. Turn on the power to the water bath. Using an NIST traceable thermometer with a resolution of ±0.01 °C, adjust the water bath to 45 °C.
	3. From the Permeation Oven menu, in the Service menu, select Cal Gas Thermistor > Water Bath . Enter the thermistor temperature from the

thermometer and press (Figure 9–3).




Figure 9–3. Cal Gas Therm Bath Screen

- 4. Remove the thermistor from the water bath, dry, and replace the permeation tube oven.
- 5. Make sure the charcoal scrubber is connected to the ZERO bulkhead on the rear panel.

6. Wait for the permeation gas temperature reading to stabilize.

Setting Temperature with Known Resistance

Use the following procedure to set the gas temperature with an accurate known resistance.

- 1. Remove the thermistor from POJ1 on the measurement interface board.
- 2. Connect a 4.369 K Ω resistor across pins 1 and 2 of POJ1 (use a resistance substitution box and an accurate meter, if necessary).
- 3. From the Permeation Oven menu, select **Cal Gas Thermistor**, then select known resistor.




Figure 9–4. Cal Gas Therm Resistor Screen

- 4. Enter the exact value of the attached resistor and press 🗲 to save the offset.
- 5. Remove the resistor and reconnect the gas thermistor.
- 6. Make sure the charcoal scrubber is connected to the ZERO bulkhead on the rear panel.
- 7. Wait for the permeation gas temperature reading to stabilize.

Determining Permeation Rate by Weight Loss

Use the following procedure to determine the permeation rate by weight loss.

1. Make sure the oven has been calibrated as described in the "Permeation Tube Oven Calibration" procedure described previously.

- 2. Insert the permeation tube carefully. Do not touch with fingers.
- 3. Turn on the instrument.
- 4. Wait 48-72 hours for the permeation tube to stabilize.
- 5. Carefully remove the permeation tube from the oven and weigh to an accuracy of 0.1mg. Perform this measurement as quickly as possible.
- 6. Replace the permeation tube into the oven of the instrument.
- 7. Repeat Steps 5 and 6 after two weeks.
- 8. Compute the weight loss of the permeation tube from the values determined in Steps 5 through 7.
- 9. Repeat Steps 5 through 8 until the weight loss has been determined to a precision of 1-2%.
- 10. For the most accurate work, use the permeation tube in the same oven that was used to determine the weight loss of permeation tube.

Determining Release Rate by Transfer Standard

Use the following procedure to determine the release rate by transfer standard.

- 1. Make sure the oven has been calibrated as described in the "Permeation Tube Oven Calibration" procedure described previously. Also make sure that the Transfer Standard has been properly calibrated.
- 2. Determine the permeation rate for the permeation tube in the Transfer Standard, or install a certified permeation tube.
- 3. Allow the permeation tubes in both the 43*i* and the Transfer Standard to stabilize for at least 48 hours.
- 4. Carefully calibrate the 43*i* using the Transfer Standard. The output of the Transfer Standard should be connected to the SAMPLE bulkhead on the rear panel of the 43*i*.

- 5. Switch the calibrated 43i into the span mode.
- 6. Measure the flow rate into the ZERO bulkhead on the rear panel of the 43i. Be sure that the charcoal scrubber is connected. Note the flow and measured SO₂ concentration.
- 7. From the flow and measured concentration, compute the permeation tube release rate.

A 5-10 micron pore size, two-inch diameter Teflon[®] element is available for the Model 43*i* Trace Level-Enhanced. This filter should be installed just prior to the **SAMPLE** bulkhead. When using a filter, all calibrations and span checks must be performed through the filter.

The I/O expansion board provides six analog current output channels (0-20 mA or 4-20 mA) and eight analog voltage inputs (0-10V). The DB25 connector on the rear panel provides the interface for these inputs and outputs.

The 25-pin terminal board assembly is included with the optional I/O expansion board. Refer to "Terminal Board PCB Assemblies" in the Installation" chapter for information on attaching the cable to the connector board. For associated part numbers, refer to the "Servicing" chapter.

The optional terminal block and cable kits provide a convenient way to connect devices to the instrument. These kits break out the signals on the rear panel connector to individual numbered terminals.

Two types of terminal block and cable kits are available. One kit is for the DB37 connectors and can be used for either the analog output connector or the relay output connector. The other kit is for the DB25 connector and can be used for the optional I/O expansion board. For associated part numbers, refer to the "Servicing" chapter.

Each kit consists of:

Teflon

Particulate Filter

I/O Expansion

25-Pin Terminal

Board Assembly

Terminal Block

and Cable Kits

Board Assembly

- one six-foot cable
- one terminal block
- one snap track

Note Supporting all of the connections on units with the optional I/O expansion board requires:

- two DB37 kits
- one DB25 kit

Cables Table 9–1 identifies the optional individual cables that are available for the instrument and **Table 9–2** provides the cable color codes. For associated part numbers, refer to the Servicing chapter.

Note Table 9–2 provides the color coding for both 25-pin cables and 37-pin cables. Color codes for pins 1-25 are for 25-pin cables; color codes for pins 1-37 are for 37-pin cables. ▲

Table 9–1. Cable Options

Description	Cable Length
DB37M to open end	Six feet
DB37F to open end	Six feet
DB25M to open end	Six feet
RS-232	

Table 9–2. Color Codes for 25-Pin and 37-Pin Cables

Pin	Color	Pin	Color		
1	BLACK	20	RED/BLACK		
2	BROWN	21	ORANGE/BLACK		
3	RED	22	YELLOW/BLACK		
4	ORANGE	23	GREEN/BLACK		
5	YELLOW	24	GRAY/BLACK		
6	GREEN	25	PINK/BLACK		
7	BLUE		End color codes for 25-pin cables continue for 37-pin cables.		
8	VIOLET	26	PINK/GREEN		
9	GRAY	27	PIND/RED		
19	WHITE	28	PINK/VIOLET		
11	PINK	29	LIGHT BLUE		
12	LIGHT GREEN	30	LIGHT BLUE/BROWN		
13	BLACK/WHITE	31	LIGHT BLUE/RED		
14	BROWN/WHITE	32	LIGHT BLUE/VIOLET		

Pin	Color	Pin	Color
15	RED/WHITE	33	LIGHT BLUE/BLACK
16	ORANGE/WHITE	34	GRAY/GREEN
17	GREEN/WHITE	35	GRAY/RED
18	BLUE/WHITE	36	GRAY/VIOLET
19	VIOLET/WHITE	37	LIGHT GREEN/BLACK

Mounting Options

The analyzer can be installed in the configuration described in **Table 9–3** and shown in **Figure 9–5** through **Figure 9–8**.

Table 9–3. Mounting Options

Mounting Type	Description
Bench	Positioned on bench, includes mounting feet, and front panel side-trim handles.
EIA rack	Mounted in an EIA-style rack, includes mounting slides, and front panel EIA-rack mounting handles.
Retrofit rack	Mounted in a Thermo non-EIA rack, includes mounting slides, and retrofit front panel rack-mounting handles.




Figure 9–5. Rack Mount Option Assembly




Figure 9–6. Bench Mounting




Figure 9–7. EIA Rack Mounting




Figure 9–8. Retrofit Rack Mounting

Appendix A Warranty

Seller warrants that the Products will operate or perform substantially in conformance with Seller's published specifications and be free from defects in material and workmanship, when subjected to normal, proper and intended usage by properly trained personnel, for the period of time set forth in the product documentation, published specifications or package inserts. If a period of time is not specified in Seller's product documentation, published specifications or package inserts, the warranty period shall be one (1) year from the date of shipment to Buyer for equipment and ninety (90) days for all other products (the "Warranty" Period"). Seller agrees during the Warranty Period, to repair or replace, at Seller's option, defective Products so as to cause the same to operate in substantial conformance with said published specifications; provided that (a) Buyer shall promptly notify Seller in writing upon the discovery of any defect, which notice shall include the product model and serial number (if applicable) and details of the warranty claim; (b) after Seller's review, Seller will provide Buyer with service data and/or a Return Material Authorization ("RMA"), which may include biohazard decontamination procedures and other product-specific handling instructions; and (c) then, if applicable, Buyer may return the defective Products to Seller with all costs prepaid by Buyer. Replacement parts may be new or refurbished, at the election of Seller. All replaced parts shall become the property of Seller. Shipment to Buyer of repaired or replacement Products shall be made in accordance with the Delivery provisions of the Seller's Terms and Conditions of Sale. Consumables, including but not limited to lamps, fuses, batteries, bulbs and other such expendable items, are expressly excluded from the warranty under this warranty.

Notwithstanding the foregoing, Products supplied by Seller that are obtained by Seller from an original manufacturer or third party supplier are not warranted by Seller, but Seller agrees to assign to Buyer any warranty rights in such Product that Seller may have from the original manufacturer or third party supplier, to the extent such assignment is allowed by such original manufacturer or third party supplier.

In no event shall Seller have any obligation to make repairs, replacements or corrections required, in whole or in part, as the result of (i) normal wear and tear, (ii) accident, disaster or event of force majeure, (iii) misuse, fault or negligence of or by Buyer, (iv) use of the Products in a manner for which

they were not designed, (v) causes external to the Products such as, but not limited to, power failure or electrical power surges, (vi) improper storage and handling of the Products or (vii) use of the Products in combination with equipment or software not supplied by Seller. If Seller determines that Products for which Buyer has requested warranty services are not covered by the warranty hereunder, Buyer shall pay or reimburse Seller for all costs of investigating and responding to such request at Seller's then prevailing time and materials rates. If Seller provides repair services or replacement parts that are not covered by the warranty provided in this warranty, Buyer shall pay Seller therefor at Seller's then prevailing time and materials rates. ANY INSTALLATION, MAINTENANCE, REPAIR, SERVICE, RELOCATION OR ALTERATION TO OR OF, OR OTHER TAMPERING WITH, THE PRODUCTS PERFORMED BY ANY PERSON OR ENTITY OTHER THAN SELLER WITHOUT SELLER'S PRIOR WRITTEN APPROVAL, OR ANY USE OF REPLACEMENT PARTS NOT SUPPLIED BY SELLER, SHALL IMMEDIATELY VOID AND CANCEL ALL WARRANTIES WITH RESPECT TO THE AFFECTED PRODUCTS.

THE OBLIGATIONS CREATED BY THIS WARRANTY STATEMENT TO REPAIR OR REPLACE A DEFECTIVE PRODUCT SHALL BE THE SOLE REMEDY OF BUYER IN THE EVENT OF A DEFECTIVE PRODUCT. EXCEPT AS EXPRESSLY PROVIDED IN THIS WARRANTY STATEMENT, SELLER DISCLAIMS ALL OTHER WARRANTIES, WHETHER EXPRESS OR IMPLIED, ORAL OR WRITTEN, WITH RESPECT TO THE PRODUCTS, INCLUDING WITHOUT LIMITATION ALL IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR ANY PARTICULAR PURPOSE. SELLER DOES NOT WARRANT THAT THE PRODUCTS ARE ERROR-FREE OR WILL ACCOMPLISH ANY PARTICULAR RESULT.

Appendix B C-Link Protocol Commands

This appendix provides a description of the C-Link protocol commands that can be used to remotely control a Model 43*i* Trace Level-Enhanced analyzer using a host device such as a PC or a datalogger. C-Link protocol may be used over RS-232, RS-485, or Ethernet. C-Link functions can be accessed over Ethernet using TCP/IP port 9880. Streaming data may be accessed over Ethernet using TCP/IP port 9881.

- "Instrument Identification Number" on page B-1.
- "Commands" on page B-2.
- "Measurements" on page B-7
- "Alarms" on page B-11.
- "Diagnostics" on page B-14.
- "Datalogging" on page B-16.
- "Calibration" on on page B-23.
- "Keys/Display" on page B-26.
- "Measurement Configuration" on page B-27.
- "Hardware Configuration" on page B-31.
- "Communications Configuration" on page B-34.
- "I/O Configuration" on page B-38.
- "I/O Configuration" on page B-38.

Instrument Identification Number

Each command sent to the analyzer must begin with the American Standard Code for Information Interchange (ASCII) symbol or byte value equivalent of the instrument's identification number plus 128. For example, if the instrument ID is set to 25, then each command must begin with the ACSII character code 153 decimal. The analyzer ignores any command that does not begin with its instrument identification number. If the instrument ID is set to 0, then this byte is not required. For more information on changing Instrument ID, see Chapter 3, "Operation".

Commands

The analyzer must be in the remote mode in order to change instrument parameters via remote. However, the command "set mode remote" can be sent to the analyzer to put it in the remote mode. Report commands (commands that don't begin with "set") can be issued either in the remote or local mode. For information on changing modes, see Chapter 3, "Operation."

The commands can be sent in either uppercase or lowercase characters. Each command must begin with the proper instrument identification number (ASCII) character. The command in the example that follows begins with the ASCII character code 171 decimal, which directs the command to the Model 43*i* Trace Level-Enhanced, and is terminated by a carriage return "CR" (ASCII character code 13 decimal).

<ascii 171=""></ascii>	Т	Ι	М	E	<cr></cr>
------------------------	---	---	---	---	-----------

If an incorrect command is sent, a "bad command" message will be received. The example that follows sends the incorrect command "set unit ppm" instead of the correct command "set gas unit ppm."

Send:	set unit ppm	
Receive:	set unit ppm bad c	md

The "save" and "set save params" commands stores parameters in FLASH. It is important that each time instrument parameters are changed, that this command be sent. If changes are not saved, they will be lost in the event of a power failure.

Streaming data is sent out the serial port or the Ethernet port on a userdefined periodic basis. Streaming data over Ethernet is only generated when a connection is made on TCP port 9881.

When interfacing to an instrument via C-link commands, always enter the concentration values in ppb or μ g/m³ units. For example, to set a background value to 20 ppm, enter 20000 (ppb) as the value for the set background command.

Table B–1 lists the 43*i* Trace Level-Enhanced C-Link protocol commands. The interface will respond to the command strings outlined below.

Table B-1. C-Link Protocol Commands

Command	Description	Page
addr dns	Reports/sets dns address	B-34

Accessing Streaming Data

Entering Units in PPB

Accessing Streaming Data

Command	Description	Page
addr gw	Reports/sets default gateway address	B-34
addr ip	Reports/sets IP address	B-35
addr nm	Reports/sets netmask address	B-35
agc int	Reports current AGC intensity	B-14
alarm chamber temp max	Reports/sets chamber temperature alarm maximum value	B-11
alarm chamber temp min	Reports/sets chamber temperature alarm minimum value	B-11
alarm conc so2 max	Reports/sets current SO_2 concentration alarm maximum value	B-11
alarm conc so2 min	Reports/sets current SO_2 concentration alarm minimum value	B-11
alarm converter temp max	Reports/sets SO_2 converter temperature alarm maximum value (Model 450 <i>i</i> only)	B-12
alarm converter temp min	Reports/sets SO ₂ converter temperature alarm minimum value (Model 450 <i>i</i> only)	B-12
alarm internal temp max	Reports/sets internal temperature alarm maximum value	B-12
alarm internal temp min	Reports/sets internal temperature alarm minimum value	B-12
alarm pressure max	Reports/sets pressure alarm maximum value	B-13
alarm pressure min	Reports/sets pressure alarm minimum value	B-13
alarm sample flow max	Reports/sets sample flow alarm maximum value	B-13
alarm sample flow min	Reports/sets sample flow alarm minimum value	B-13
alarm trig conc so2	Reports/sets current SO_2 concentration alarm warning value	B-13
analog iout range	Reports analog current output range per channel	B-38
analog vin	Retrieves analog voltage input data per channel	B-39
analog vout range	Reports analog voltage output range per channel	B-39
avg time	Reports/sets averaging time	B-7
baud	Reports/sets current baud rate	B-35
cal high so2 coef	Sets/auto-calibrates high range SO_2 coefficient	B-23
cal low so2 coef	Sets/auto-calibrates low range SO ₂ coefficient	B-23
cal pres	Sets current measured pressure as pressure during calibration	B-26

Command	Description	Page
	(for pressure compensation)	
cal so2 bkg	Sets/auto-calibrates SO_2 background	B-24
cal so2 coef	Sets/auto-calibrates SO2 coefficient	B-23
clr lrecs	Clears away only long records that have been saved	B-16
clr records	Clears away all logging records that have been saved	B-16
clr srecs	Clears away only short records that have been saved	B-16
contrast	Reports/sets current screen contrast	B-31
conv set temp	Reports/sets temperature setpoint for SO ₂ converter (Model 450 <i>i</i> only)	B-32
conv temp	Reports current SO_2 converter temperature (Model 450 <i>i</i> only)	B-8
copy lrec to sp	Sets/copies current lrec selection into the scratch pad	B-22
copy sp to lrec	Sets/copies current selections in scratch pad into Irec list	B-21
copy sp to srec	Sets/copies current selections in scratch pad into srec list	B-21
copy sp to stream	Sets/copies current selections in scratch pad into stream list	B-22
copy srec to sp	Sets/copies current srec selection into the scratch pad	B-22
copy stream to sp	Sets/copies current streaming data selection into the scratch pad	B-22
custom	Reports/sets defined custom range concentration	B-29
data treatment lrec/srec	Reports/sets the current selection of data treatment for concentrations in the lrecs or srecs	B-21
date	Reports/sets current date	B-32
default params	Sets parameters to default values	B-33
dhcp	Reports/sets state of use of DHCP	B-36
diag volt iob	Reports diagnostic voltage level for I/O expansion board	B-15
diag volt mb	Reports diagnostic voltage level for motherboard	B-14
diag volt mib	Reports diagnostic voltage level for measurement interface board	B-14
dig in	Reports status of the digital inputs	B-40
din	Reports/sets digital input channel and active state	B-40
do (down)	Simulates pressing down pushbutton	B-26
dout	Reports/sets digital output channel and active state	B-40
dtoa	Reports outputs of the digital to analog converters per channel	B-41
en (enter)	Simulates pressing enter pushbutton	B-26
er	Returns a brief description of the main operating conditions in the format specified in the commands	B-17

Accessing Streaming Data

Command	Description	Page
erec	Returns a brief description of the main operating conditions in the format specified in the command	B-17
erec format	Reports/sets erec format (ASCII or binary)	B-18
erec layout	Reports current layout of erec data	B-19
flags	Reports 8 hexadecimal digits (or flags) that represent the status of the ozonator, PMT, gas mode, and alarms	B-10
flow	Reports current measured sample flow in LPM	B-9
format	Reports/sets current reply termination format	B-36
gas mode	Reports current mode of sample, zero, or span	B-29
gas unit	Reports/sets current gas units	B-30
he (help)	Simulates pressing help pushbutton	B-26
high avg time	Reports/sets high range averaging time	B-7
high range	Reports/selects current SO_2 high range	B-27
high so2	Reports SO_2 concentration calculated with high range coefficients	B-8
high so2 coef	Reports/sets high range SO_2 coefficients	B-24
high sp conc	Reports/sets high span concentration	B-25
host name	Reports/sets host name string	B-37
instr name	Reports instrument name	B-37
instrument id	Reports/sets instrument id	B-37
internal temp	Reports current internal instrument temperature	B-9
isc (iscreen)	Retrieves framebuffer data used for the display	B-26
lamp setpoint	Reports/sets flash lamp setpoint	B-15
lamp status	Reports/sets flash lamp status on or off	B-33
lamp int	Reports the current lamp intensity	B-15
lamp voltage	Reports flash lamp voltage	B-15
layout ack	Disables stale layout/layout changed indicator ('*')	B-38
le (left)	Simulates pressing left pushbutton	B-26
led status (led)	Reports/sets optical test LED status on or off	B-15
list din	Lists current selection for digital input	B-16
list dout	Lists current selection for digital output	B-16
list lrec	Lists current selection Irec logging data	B-16
list sp	Lists current selection in the scratchpad list	B-16
list srec	Lists current selection srec logging data	B-16
list stream	Lists current selection streaming data output	B-16

Command	Description	Page
list var aout	Reports list of analog output, index numbers, and variables	B-41
list var din	Reports list of digital input, index numbers, and variables	B-41
list var dout	Reports list of digital output, index numbers, and variables	B-41
low avg time	Reports/sets low averaging time	B-7
low range	Reports/sets current SO_2 low range	B-27
low so2	Reports SO_2 concentration calculated with low range coefficients	B-8
low so2 coef	Reports/sets low range SO_2 coefficient	B-24
low sp conc	Reports/sets low span concentration	B-25
lr	Outputs long records in the format specified in the command	B-17
lrec	Outputs long records	B-17
lrec format	Reports/sets output format for long records (ASCII or binary)	B-18
lrec layout	Reports current layout of Irec data	B-19
lrec mem size	Reports maximum number of long records that can be stored	B-19
lrec per	Reports/sets long record logging period	B-20
malloc lrec	Reports/sets memory allocation for long records	B-20
malloc srec	Reports/sets memory allocation for short records	B-20
me (menu)	Simulates pressing menu pushbutton	B-26
mode	Reports operating mode in local, service, or remote	B-38
no of Irec	Reports/sets number of long records stored in memory	B-20
no of srec	Reports/sets number of short records stored in memory	B-20
pmt status	Reports/sets PMT on or off	B-33
pmt voltage	Reports current PMT voltage	B-9
pres	Reports current reaction chamber pressure	B-9
pres cal	Reports/sets pressure used for calibration	B-25
pres comp	Reports/sets pressure compensation on or off	B-31
program no	Reports analyzer program number	B-38
push	Simulates pressing a key on the front panel	B-26
range	Reports/sets current SO_2 range	B-27
range mode	Reports/sets current range mode	B-29
react temp	Reports current reaction chamber temperature	B-10
relay stat	Reports/sets relay logic status to for the designated relay(s)	B-42
ri (right)	Simulates pressing right pushbutton	B-26
ru (run)	Simulates pressing run pushbutton	B-26

Command	Description	Page
sample	Sets zero/span valves to sample mode	B-30
sample gas		
save	Stores parameters in FLASH	B-33
save params	Stores parameters in FLASH	B-33
sc (screen)	C-series legacy command that reports a generic response (Use iscreen instead)	B-27
so2	Reports current SO ₂ concentration	B-8
so2 bkg	Reports/sets current SO_2 background	B-24
so2 coef	Reports/sets current SO ₂ coefficient	B-24
sp conc	Reports/sets span concentration	B-25
sp field	Reports/sets item number and name in scratch pad list	B-22
span	Sets zero/span valves to span mode	B-30
span gas		
sr	Reports last short record stored	B-17
srec	Reports maximum number of short records	B-17
srec <u>f</u> ormat	Reports/sets output format for short records (ASCII or binary)	B-18
srec layout	Reports current layout of short record data	B-19
srec mem size	Reports maximum number of short records	B-19
srec per	Reports/sets short record logging period	B-20
stream per	Reports/sets current set time interval for streaming data	B-22
stream time	Reports/sets a time stamp to streaming data or not	B-23
temp comp	Reports/sets temperature compensation on or off	B-31
time	Reports/sets current time (24-hour time)	B-34
up	Simulates pressing up pushbutton	B-26
zero	Sets zero/span valves to zero mode	B-30
zero gas		

Measurements

avg time high avg time low avg time

These commands report the averaging time in seconds when operating in single range, or averaging time used with the high and low ranges when operating in dual or auto range mode. The example that follows shows that the averaging time is 300 seconds, according to **Table B–2**.

Send:	avg	time		
Receive:	avg	time	11:300	sec

set avg time selection

set high avg time selection

set low avg time selection

These commands set the averaging time, high and low averaging times, according to **Table B–2**. The example that follows sets the low range averaging time to 120 seconds.

Send:	set	low	avg	time	8	
Receive:	set	low	avg	time	8	ok

Table B-2. Averaging Times

Selection	Averaging Time (seconds)
0	1 seconds
1	2
2	5
3	10
4	20
5	30
6	60
7	90
8	120
9	180
10	240
11	300

so2

high so2

low so2

These commands report the measured SO_2 concentration when operating in single range, or high and low SO_2 when operating in dual or auto range mode. The example that follows shows that the SO_2 concentration is 40 ppm.

Send: so2 Receive: so2 0040E+0 ppm

conv temp

This command reports the current SO_2 converter temperature. The example that follows reports that the current converter temperature is 45 °C.

Send:	conv	temp			
Receive:	conv	temp	45.0	deg	С

flow

This command reports the current sample flow. The example that follows reports that the current sample flow is 0.503 liters/minute.

Send:	flow		
Receive:	flow	0.503	1/m

internal temp

This command reports the current internal instrument temperature. The first reading is the temperature being used in instrument calculations. The second temperature is the actual temperature being measured. If temperature compensation is on, then both temperature readings are the same. If temperature compensation is off, a temperature of 30 °C is used as the default temperature even though the actual internal temperature is 27.2 °C. The example that follows shows that temperature compensation is on and that the internal temperature is 27.2 °C.

Send:	internal	temp			
Receive:	internal	temp	27.2	deg	С

pmt voltage

This command reports the current PMT voltage. The example that follows reports that the current PMT voltage is -510 volts.

Send:	pmt	voltage		
Receive:	pmt	voltage	-510	volts

pres

This command reports the current reaction chamber pressure. The first pressure reading is the pressure reading being used in instrument calculations. The second pressure is the actual pressure reading being measured. If pressure compensation is on, then both pressure readings are the same. If pressure compensation is off, a pressure of 760 mmHg is used as default pressure even though the actual pressure is 753.4 mmHg. The example that follows shows that the actual reaction chamber pressure is 753.4 mmHg.

Send:	pres		
Receive:	pres	753.4	mmHg

react temp


This command reports the current reaction chamber temperature. The example that follows reports that the current reaction chamber temperature is 45.2 °C.

Send:	react	temp			
Receive:	react	temp	45.2	deg	С

flags

This reports 8 hexadecimal digits (or flags) that represent the status of the flash lamp, LED, pressure and temperature compensation status, gas units, gas mode, and alarms. To decode the flags, each hexadecimal digit is converted to binary as shown in the **Table B–1**. It is the binary digits that define the status of each parameter. In the example that follows, the instrument is reporting that the flash lamp is on, and the SO₂ high concentration alarm is activated.

Send: flags Receive: flags 40028000



Alarms alarm chamber temp min alarm chamber temp max

These commands report the chamber temperature alarm minimum and maximum value current settings. The example that follows reports that the chamber temperature alarm minimum value is 35.0 °C.

Send: alarm chamber temp min Receive: alarm chamber temp min 35.0 deg C

set alarm chamber temp min *value* set alarm chamber temp max *value*

These commands set the chamber temperature alarm minimum and maximum values to *value*, where *value* is a floating-point number representing chamber temperature alarm limits in degrees C. The example that follows sets the chamber temperature alarm maximum value to 55.0 °C.

Send: set alarm chamber temp max 55.0 Receive: set alarm chamber temp max 55.0 ok

alarm conc so2 min alarm conc so2 max

These commands report the SO_2 concentration alarm minimum and maximum values current setting. The example that follows reports that the SO_2 concentration minimum is 5.2 ppb.

Send: alarm conc so2 min Receive: alarm conc so2 min 5.2 ppb

set alarm conc so2 min value set alarm conc so2 max value

These commands set the SO_2 concentration alarm minimum and maximum values to *value*, where *value* is a floating-point representation of the concentration alarm limits. Values must be in the ppb or μ g/m³. Refer to "Entering Units in PPB" in this chapter. The example that follows sets the SO₂ concentration alarm maximum value to 80 ppm.

Send: set alarm conc so2 max 80000 Receive: set alarm conc so2 max 80000 ok

alarm converter temp min alarm converter temp max

These commands report the converter temperature alarm minimum and maximum value current settings. The example that follows reports that the converter temperature alarm minimum value is 205.0 °C.

Send: alarm converter temp min Receive: alarm converter temp min 205.0 deg C

set alarm converter temp min *value* set alarm converter temp max *value*

These commands set the converter temperature alarm minimum and maximum values to *value*, where *value* is a floating-point number representing converter temperature alarm limits in degrees C. The example that follows sets the converter temperature alarm maximum value to 215.0 °C.

```
Send: set alarm converter temp max 215
Receive: set alarm converter temp max 215 ok
```

alarm internal temp min alarm internal temp max

These commands report the internal temperature alarm minimum and maximum value current settings. The example that follows reports that the internal temperature alarm minimum value is 15.0 °C.

```
Send: internal temp alarm min
Receive: internal temp alarm min 15.0 deg C
```

set internal temp alarm min value set internal temp alarm max value

These commands set the internal temperature alarm minimum and maximum values to *value*, where *value* is a floating-point number representing internal temperature alarm limits in degrees C. The example that follows sets the internal temperature alarm maximum value to 45.0 °C.

Send: set internal temp alarm max 45 Receive: set internal temp alarm max 45 ok

alarm pressure min alarm pressure max

These commands report the pressure alarm minimum and maximum value current settings. The example that follows reports that the pressure alarm minimum value is 205 mmHg.

Send: pressure alarm min Receive: pressure alarm min 205 mmHg

set alarm pressure min value set alarm pressure max value

These commands set the pressure alarm minimum and maximum values to *value*, where *value* is a floating-point number representing pressure alarm limits in millimeters of mercury. The example that follows sets the pressure alarm maximum value to 215 mmHg.

Send: set alarm pressure max 215 Receive: set alarm pressure max 215 ok

alarm sample flow min alarm sample flow max

These commands report the sample flow alarm minimum and maximum value current settings. The example that follows reports that the sample flow alarm minimum value is 2 LPM.

Send: alarm sample flow min Receive: alarm sample flow min 2 l/min

set alarm sample flow min value set alarm sample flow max value

These commands set the sample flow alarm minimum and maximum values to *value*, where *value* is a floating-point number representing sample flow alarm limits in liters per minute. The example that follows sets the sample flow alarm maximum value to 1 LPM.

Send: set alarm sample flow max 1 Receive: set alarm sample flow max 1 ok

alarm trig conc so2

This command reports the SO_2 concentration alarm trigger action for minimum alarm, current setting, to either floor or ceiling. The example that follows shows the SO_2 concentration minimum alarm trigger set to ceiling, according to **Table B–3**.

Send:	alarm	trig	conc	so2	
Receive:	alarm	trig	conc	so2	1

These commands set the SO₂ concentration alarm minimum *value*, where *value* is set to either floor or ceiling, according to **Table B–3**. The example that follows sets the SO₂ concentration minimum alarm trigger to ceiling.

Send:	set	alarm	trig	conc	so2	1	
Receive:	set	alarm	trig	conc	so2	1	ok

Table B–3. Alarm Trigger Values

Value	Alarm Trigger	Value
00	Floor	00
01	Ceiling	01

Diagnostics

agc int

This command reports the current of the reference channel AGC circuit. The example that follows reports that the current AGC intensity is 90 percent.

Send:	agc	int			
Receive:	agc	int	90	%	

diag volt mb

This command reports the diagnostic voltage measurements on the motherboard. The sequence of voltages is: Positive 24, positive 15, positive 5, positive 3.3, and negative 3.3. Each voltage value is separated by a space.

Send:	diag volt	mb					
Receive:	diag volt	mb	24.1	14.9	4.9	3.2	-3.2

diag volt mib

This command reports the diagnostic voltage measurements on the measurement interface board. The sequence of voltages is: Positive 24, positive 15, negative 15, positive 5, and positive 3.3. Each voltage value is separated by a space.

```
Send: diag volt mib
Receive: diag volt mib 24.1 14.9 -14.9 4.9 3.2
```

diag volt iob

This command reports the diagnostic voltage measurements on the I/O expansion board. The sequence of voltages is: Positive 24, positive 5, positive 3.3, and negative 3.3. Each voltage value is separated by a space.

Send:	diag	volt	iob				
Receive:	diag	volt	iob	24.1	4.9	3.2	-3.2

lamp setpoint

This command reports the set lamp setpoint. The example that follows reports the lamp setpoint is 1000 counts.

Send:	lamp	setpoint		
Receive:	lamp	setpoint	1000	counts

set lamp setpoint value

value = 0 < *value* < 4095

These commands set the lamp setpoint in counts. The example that follows sets the lamp setpoint to 100 counts.

Send:	set	lamp	setpoint	100	
Receive:	set	lamp	setpoint	100	ok

lamp int

This command reports the current flash lamp intensity. The example that follows reports that the current flash lamp intensity is 3867 Hz.

Send:	lamp	int		
Receive:	lamp	int	3867	Hz

lamp voltage

This command reports the current flash lamp voltage. The example that follows reports that the current flash lamp voltage is -810 volts.

```
Send: lamp voltage
Receive: lamp voltage -810 V
```

led status

led

These commands report the status of the optical test LED on or off. The example that follows reports that the optical test LED is on.

Send: lamp status Receive: lamp status on

set led onoff

These commands set the optical test LED *on* or *off*. The example that follows turns the optical test LED off.

Send: set lamp off Receive: set lamp off ok

Datalogging clr records

This command will clear all long and short records that have been saved.

Send:	clear	records	
Receive:	clear	records	ok

set clr lrecs

set clr srecs

These commands will clear only the long records or only the short records that have been saved. The example that follows clears short records.

Send: set clr srecs Receive: set clr srecs ok

list din

list dout

These commands report the current selection for the digital outputs in the format. Output no Index number variable name active state. The active state for digital outputs is open or closed. The active state for digital inputs is high or low.

Send: list dout Receive: list dout output index variable state 1 28 CONC ALARM closed 2 2 LOCAL/REMOTE open 3 4 UNITS closed 4 11 HI SO2 CONC open 7 7 SAMPLE MODE open 8 8 SO2 MODE open

list lrec

list srec

list stream

list sp

These commands report the list of current selections for long record logging data, short record logging data, streaming data output, or the scratch pad (sp) list. The example that follows shows the list for streaming data output.

Send: Receive:	list stream list stream field index variable x x time 1 1 so2 2 18 pmtv
er xy lr xy sr xy x = 0 1	: Reply termination format (see "set format <i>format</i> "
1 1 1	command)
y = 0 1 2 format" comm	

These commands report the last long or short records stored and dynamic data. In the example that follows, the command requests a long record with no checksum, in ASCII format with text. For details on how to decode the flag fields within these records, see the "flags" command.

```
Send: lr01
Receive: lr01
18:09 05-12-03 flags 5c000044 S02 9658E-5 low S02 8920E-5
Intt 28.6 Rctt 25.6 Pgast 0.00 Pres 720.3 Smpfl 0.489 PMt V
-808 LmpV 449 Lmpi 4740E+1
```

erec

This command returns a brief description of the main operating conditions at the time the command is issued (i.e. dynamic data). The example that follows shows a typical response.

The format is defined by the current settings of "format" and "erec format" commands. For details on how to decode the flag fields within these records, see the "flags" command.

```
Send: erec
Receive: erec
09:45 04-07-05 flags 5C040000 so2 0.001 4 loso2 0.001 4
pmtv 595.331 FlshV 797.227 Intt 29.263 Rctt 44.938 PGast
0.000 Smpfl 0.440 Pres 715.478 avgt 10 lo avgt 10 S02bkg
6.795 S02 coef 1.000 lo S02 coef 1.000 S02range 10000.000 lo
S02range 10000.000 Lmpi 92.000
```

lrec

srec lrec xxxx yy srec xxxx yy **lrec** *aa:bb oo-pp-qq yy* **srec** *aa:bb oo-pp-qq yy xxxx* = the number of past records *yy* = the number of records to return (1 to 10) *aa* = hours (01 to 24) *bb* = minutes (01 to 59) *oo* = month (01 to 12) *pp* = day (01 to 31) *qq* = year

These commands output long or short records. The output format is determined by the "set lrec format" and "set srec format" commands. The logging time is determined by the "set lrec per" and "set srec per" commands.

In the following example, there are 740 long records currently stored in memory. When the command lrec 100 5 is sent, the instrument counts back 100 records from the last record collected (record 740), and then returns 5 records: 640, 641, 642, 643, and 644. For details on how to decode the flag fields within these records, see the "flags" command.

Send: Receive:	lrec 5 lrec 100 5
	18:09 05-12-03 flags 5c000044 SO2 9658E-5 low SO2 8920E-5
	Intt 28.6 Rctt 25.6 Pgast 0.00 Pres 720.3 Smpfl 0.489 PMt V
	-808 LmpV 449 Lmpi 4740E+1
	18:10 05-12-03 flags 5c000044 SO2 6923E-5 low SO2 6429E-5
	Intt 28.6 Rctt 25.6 Pgast 0.00 Pres 720.3 Smpfl 0.489 PMt V
	-808 LmpV 449 Lmpi 4740E+1
	18:11 05-12-03 flags 5c000044 SO2 8814E-5 low SO2 9488E-5
	Intt 28.6 Rctt 25.6 Pgast 0.00 Pres 720.3 Smpfl 0.489 PMt V
	-808 LmpV 449 Lmpi 4740E+1
	18:12 05-12-03 flags 5c000044 SO2 7313E-5 low SO2 6997E-5
	Intt 28.6 Rctt 25.6 Pgast 0.00 Pres 720.3 Smpfl 0.489 PMt V
	-808 LmpV 449 Lmpi 4740E+1
	18:13 05-12-03 flags 5c000044 SO2 8168E-5 low SO2 8237E-5
	Intt 28.6 Rctt 25.6 Pgast 0.00 Pres 720.3 Smpfl 0.489 PMt V
	-808 LmpV 449 Lmpi 4740E+1

erec format lrec format srec format

These commands report the output format for long and short records, and dynamic data in various formats such as ASCII without text, ASCII with text, or binary. The example that follows shows the output format for long records is ASCII with text, according to **Table B–4**.

Send:	lrec	format	
Receive:	lrec	format	01

set erec format format set lrec format format set srec format format

These commands set the output format for long and short records, and dynamic data, according to Table B-4. The example that follows sets the long record output format to ASCII with text.

Send:	set	lrec	format	1	
Receive:	set	lrec	format	1	ok

lable B–	4. Record Output Forn
Format	Output Format
0	ASCII no text

J 0...+ mats

1	ASCII with tex
2	binary data

erec layout lrec layout

srec layout

These commands reports the layout (string indicating the data formats) for data that is sent out in response to the erec, lrec, srec, and related commands The example that follows shows a typical response. For details on how to interpret the strings, see "Record Layout Definition" later in this appendix.

Send: lrec layout Receive: lrec layout %s %s %lx %f %f %f %f %f %f t D L ffffff so2 pmtv lmpv ain4 ain5 lmpi

lrec mem size

srec mem size

These commands report the long and short records that can be stored with the current settings and the number of blocks reserved for long and short records. To calculate the number of short records per block, add 2 to the number of records, and then divide by the number of blocks. The example that follows shows that 7 blocks were reserved for long records, and the maximum number of long records that can be stored in memory is 1426.

Send: lrec mem size lrec mem size 1426 recs, 7 blocks Receive:

lrec per

srec per

These commands report the long and short records logging period. The example that follows shows that the short record logging period is 5 minutes.

Send: srec per Receive: srec per 5 min set srec per value set srec per value

value = | 1 | 5 | 15 | 30 | 60 |

These commands set the long and short records logging period to *value* in minutes. The example that follows sets the long record logging period to 15 minutes.

Send: set lrec per 15 Receive: set lrec per 15 ok

no of lrec

no of srec

These commands report the number of long and short records stored in the long and short records memory. The example that follows shows that 50 long records have been stored in the memory.

Send: no of lrec Receive: no of lrec 50 recs

malloc lrec

malloc srec

These commands report the currently set memory allocation for long and short records in percent of total memory.

Send: malloc lrec Receive: malloc lrec 10%

set malloc lrec *value* **set malloc srec** *value value* = 0 to 100

These commands set the percent of memory space allocated for long and short records to *value*, where *value* is a floating-point number representing

percent. The example that follows sets the memory allocation for long records to 10.

Note Issuing these commands will clear all the logging data memory. All the existing records should be retrieved using appropriate commands, if required. ▲

Send: set malloc lrec 10 Receive: set malloc lrec 10 ok

data treatment lrec data treatment srec

These commands report the current selection of data treatment for concentrations in the long records (lrecs) or short records (srecs). The example that follows reports the data treatment for concentrations in lrec is minimum.

Send: data treatment lrec Receive: data treatment lrec min set data treatment lrec string set data treatment srec string string = | cur | avg | min | max |

These commands set the data treatment to *string*, where *string* is current, average, minimum, or maximum for the concentration values recorded in the long records (lrecs) or short records (srecs). The example that follows sets the data treatment for concentrations in lrec to minimum.

Send: set data treatment lrec min Receive: set data treatment lrec min ok

set copy sp to lrec set copy sp to srec set copy sp to stream

These commands copy the current selections in scratch pad (sp) into the long record, short record, or streaming data list. The example that follows copies the current list in scratch pad into the long records list.

Send: set copy sp to lrec Receive: set copy sp to lrec ok

set copy lrec to sp set copy srec to sp set copy stream to sp

These commands copy the current contents of the long record, short record, or streaming data list into the scratch pad (sp). These commands are useful in easy modification of current long record, short record, or streaming data lists. The example that follows copies the current list of long records into the scratch pad.

```
Send: set copy lrec to sp
Receive: set copy lrec to sp ok
```

sp field number

This command reports the variable *number* and name stored at index in the scratch pad list. The example that follows shows that the field 1 in the scratch pad is set to index number 3, which is for the variable SO₂ concentration.

Send: sp field 1 Receive: sp field 1 1 so2

set sp field number value

number = 1-32 is the maximum number of fields in long and short record lists.

number = 1-18 is for streaming data lists.

This command sets the scratch pad field *number* (item number in scratch pad list) to *value*, where *value* is the index number of a variable in the analog out variable list. Available variables and their corresponding index numbers may be obtained using the command "list var aout". The "set sp field" command is used to create a list of variables which can then be transferred into the long record, short record, or streaming data lists, using the "set copy sp to lrec", "set copy sp to srec", or "set copy sp to stream" commands.

Send:	set	sp	field	1	34	
Receive:	set	sp	field	1	34	ok

stream per

This command reports the currently set time interval in seconds for streaming data.

Send:	stream	per	
Receive:	stream	per	10

set stream per *number value number value* = | 1 | 2 | 5 | 10 | 20 | 30 | 60 | 90 |120 | 180 | 240 | 300 |

This command sets the time interval between two consecutive streaming data strings to *number value* in seconds. The example that follows sets the number value to 10 seconds.

Send: set stream per 10 Receive: set stream per 10 ok

stream time

This command reports if the streaming data string will have a time stamp attached to it or not, according to **Table B–5**.

Send:	stream	time	
Receive:	stream	time	0

set stream time value

This command enables *value*, where *value* is to attach or disable time stamp to streaming data string, according to **Table B–5**. The example that follows attaches a time stamp to streaming data.

Send:	set	stream	time	0	
Receive:	set	stream	time	0	ok

Table B–5. Stream Time Values

Value	Stream Time
00	Attaches time stamp to streaming data string
01	Disables time stamp to streaming data string

Calibration

set cal so2 coef set cal high so2 coef set cal low so2 coef

These commands will auto-calibrate SO_2 coefficients based on SO_2 span gas concentrations. The high and low commands are only available in dual and auto range mode. If the mode is incorrect, the instrument responds with "can't, wrong settings". The example that follows shows a successful auto-calibration of the low SO_2 coefficient.

Send: set cal low so2 coef Receive: set cal low so2 coef ok

set cal so2 bkg

This command will auto-calibrate the SO₂ background. The example that follows shows a successful auto-calibration of the SO₂ background.

Send: set cal so2 bkg Receive: set cal so2 bkg ok

so2 coef

coef so2 high so2 coef low so2 coef

These commands report SO_2 coefficients in single range mode, or the high and low range coefficients in dual or auto range mode. If the mode is incorrect, the instrument responds with "can't, wrong settings". The example that follows reports that the SO_2 coefficient is 1.200.

Send:	so2	coef	
Receive:	so2	coef	1.200

set so2 coef value set coef so2 value set high so2 coef value set low so2 coef value

These commands set the SO₂ coefficients to user-defined values to *value*, where *value* is a floating-point representation of the coefficient. The example that follows sets the SO₂ coefficient to 1.200.

Send: set so2 coef 1.200 Receive: set so2 coef 1.200 ok

so2 bkg

This command reports the current SO_2 backgrounds. The example that follows reports that the SO_2 background is 21.4 ppb.

Send: so2 bkg Receive: so2 bkg 21.4 ppb

set so2 bkg value

This command is used to set SO₂ backgrounds to user-defined values to *value*, where *value* is a floating-point representation of the background in current selected units. The example that follows sets the SO₂ background to 21.4 ppb.

Send:	set so2	bkg	21.4	
Receive:	set so2	bkg	21.4	ok

sp conc high sp conc low sp conc

These commands report span concentration in single range mode, or the high and low span concentrations in dual or auto range mode. If the mode is incorrect, the instrument responds with "can't, wrong settings". The example that follows reports the span gas concentration in single range mode.

Send: sp conc Receive: sp conc 1000

set sp conc value

set high sp conc value set low sp conc value

These commands set the span concentrations to user-defined values to *value*, where *value* is a floating-point representation of the span concentration in current selected units. The example that follows sets the span concentration to 80 ppm in the single range mode.

Send:	set	sp	conc	80000	
Receive:	set	sp	conc	80000	ok

pres cal

This command reports the pressure recorded at the time of calibration. The example that follows shows that the pressure at calibration is 85.5 mmHg.

```
Send: pres cal
Receive: pres cal 85.5 mmHg
```

set pres cal

This command automatically sets the current pressure as the calibration pressure. The example that follows successfully sets the calibration pressure to 120.5 mmHg.

```
Send: set pres cal 120.5
Receive: set pres cal 120.5 ok
```

set cal pres

Send:

This command automatically sets the current pressure as the calibration pressure. The example that follows successfully sets the calibration pressure.

Keys/Display

Receive: set cal pres ok **push** *button*

set cal pres

button = | do | down | en | enter | he | help | le | left | me | menu | ri | right | ru | run | up | 1 | 2 | 3 | 4 |

These commands simulates pressing the front panel pushbuttons. The numbers represent the front-panel soft keys, from left to right.

Send:	push	enter	
Receive:	push	enter	ok

isc

iscreen

This command retrieves the framebuffer data used for the display on the iSeries instrument. It is 19200 bytes in size, 2-bits per pixel, 4 pixels per byte arranged as 320 by 240 characters. The data is sent in RLE encoded form to save time in transmission. It is sent as a type '5' binary c_link response with no checksum.

The RLE encoding consists of a 0 followed by an 8-bit count of consecutive 0xFF bytes. The following 'c' code will expand the incoming data.

```
unpackDisplay ( void far* tdib, unsigned char far* rlescreen )
Void
int i,j,k;
unsigned char far *sc4bpp, *sc2bpp, *screen, *ptr;
       ptr = screen = (unsigned char far *)malloc(19200);
       //RLE decode the screen
         for (i=0; i<19200 && (ptr - screen) < 19200; i++)
                    *(ptr++) = *(rlescreen + i);
                 if (*(rlescreen + i) == 0)
                    unsigned char rlecount = *(unsigned char *)(rlescreen + ++i);
                        while (rlecount)
                                 *(ptr++) = 0;
                                rlecount --;
                        }
                    ł
                else if (*(rlescreen + i) == 0xff)
                unsigned char rlecount = *(unsigned char *)(rlescreen + ++i);
                while (rlecount)
                    £
                       *(ptr++) = 0xff;
                       rlecount--;
                }
        }
}
```

To convert this data into a BMP for use with windows, it needs to be turned into a 4BPP as that is the smallest windows can display. Also note that BMP files are upside down relative to this data, i.e. the top display line is the last line in the BMP.

SC

screen

This command is meant for backward compatibility on the C series. Screen information is reported using the "iScreen" command above.

Send:	screen
Receive:	screen
	This is an I series
	Instrument. Screen
	Information not
	available

Measurement Configuration

range range so2 high range

low range

These commands report SO_2 range in single range mode, or the high and low ranges in dual or auto range mode. If the mode is incorrect, the instrument responds with "can't, wrong settings". The example that follows reports that the SO_2 full-scale range to 50 ppm, according to **Table B–6** and **Table B–7**.

Send:	range	
Receive:	range 6:	5000E-2 ppm

set range Selection

set high range Selection

set low range Selection

These commands select the SO_2 full-scale ranges, according to **Table B–6** and **Table B–7**. The example that follows sets the SO_2 full-scale range to 100 ppm.

Send:	set	range	3	
Receive:	set	range	3	ok

Table B-6. Standard Ranges

Selection	ppm	mg/m ³
0	0.05	0.2
1	0.1	0.5
2	0.2	1
3	0.5	2
4	1	5
5	2	10
6	5	20
7	10	25
8	C1	C1
9	C2	C2
10	С3	С3

Table B–7. Extended Ranges

Selection	ppm	mg/m ³
0	0.5	2
1	1	5
2	2	10
3	5	20
4	10	50
5	20	100
6	50	200

Selection	ppm	mg/m ³
7	100	250
8	C1	C1
9	C2	C2
10	C3	C3

custom range

range = | 1 | 2 | 3 |

This command reports the user-defined value of custom *range* 1, 2, or 3. The example that follows reports that custom range 1 is defined to 5.50 ppm.

Send: custom 1 Receive: custom 1 550E-2 ppm

set custom range range value set custom 1 range value set custom 2 range value set custom 3 range value

These commands are used to set the maximum concentration for any of the three custom *ranges* 1, 2, or 3 to range *value*, where *value* is a floating-point number representing concentration in ppm or mg/m^3 . The example that follows sets the custom 1 range to 55.5 ppm.

Send: set custom 1 range 55500 Receive: set custom 1 range 55500 ok

range mode

This command reports the current range mode.

Send: range mode Receive: range mode single

set range mode mode

This command sets the current range mode to single, dual, or auto. The example that follows sets the range mode to single.

Send: set range mode single Receive: set range mode single ok

gas mode

This command reports the current mode of sample, zero, or span. The example that follows reports that the gas mode is sample.

Send:	gas	mode	
Receive:	gas	mode	sample

set sample set sample gas

This command sets the zero/span valves to the sample mode. The example that follows sets the instrument to sample mode, that is, the instrument is reading the sample gas.

Send: set sample Receive: set sample ok

set zero

set zero gas

This command sets the zero/span valves to the zero mode. The example that follows sets the instrument to zero mode that is, the instrument is reading the sample gas.

Send: set zero Receive: set zero ok

set span

set span gas

This command sets the zero/span valves to the span mode. The example that follows sets the instrument to span mode that is, the instrument is sampling span gas.

Send: set span Receive: set span ok

gas unit

This command reports the current gas units (ppb or μ g/m³). The example reports that the gas unit is set to ppm.

```
Send: gas unit
Receive: gas unit ppm
```

set gas unit

```
unit = |ppm| mg/m^3|
```

This command sets the gas units to ppm or mg/m^3 . The example that follows sets the gas units to mg/m^3 .

Send:	set	gas	unit	mg/m3	
Receive:	set	gas	unit	mg/m3	ok

pres comp

This command reports whether pressure compensation is on or off. The example that follows shows that pressure compensation is on.

Send: pres comp Receive: pres comp on

set pres comp onoff

These commands turn the pressure compensation *on* or *off*. The example that follows turns pressure compensation off.

Send:	set pres	s comp	off	
Receive:	set pres	s comp	off	ok

temp comp

This command reports whether temperature compensation is on or off. The example that follows shows the temperature compensation is off.

Send:	temp	comp	
Receive:	temp	comp	off

set temp comp onoff

These commands turn the temperature compensation *on* or *off*. The example that follows turns temperature compensation off.

Send:	set t	temp	comp	off	
Receive:	set t	temp	comp	off	ok

Hardware Configuration

contrast

This command reports the screen's level of contrast. The example that follows shows the screen contrast is 50%, according to **Table B–8**.

Send: contrast Receive: contrast 5:50%

set contrast level

This command sets the screen's *level* of contrast, according to **Table B–8**. The example that follows sets the contrast level to 50%.

Send:	set	contrast	5	
Receive:	set	contrast	5	ok

Level	Contrast Level
0	0%
1	10%
2	20%
3	30%
4	40%
5	50%
6	60%
7	70%
8	80%
9	90%
10	100%

Table B-8. Contrast Level

conv set temp

This command reports the temperature that the SO_2 converter is set to. The example that follows reports that the converter temperature is set to 50.1 °C.

Send:	conv	set	temp			
Receive:	conv	set	temp	50.1	deg	С

set conv set temp value

This command sets the temperature that the SO_2 converter is set to *value*, where *value* is an integer representing degrees C. The example that follows sets the converter temperature to 50.1 °C.

```
Send: set conv set temp 50.1
Receive: set conv set temp 50.1 ok
```

date

This command reports the current date. The example that follows reports the date as December 1, 2004.

```
Send: date
Receive: date 12-01-04
```

set date mm-dd-yy
mm = month
dd = day
yy = year

This command sets the date of the analyzer's internal clock. The example that follows sets the date to December 1, 2004.

```
Send: set date 12-01-04
Receive: set date 12-01-04 ok
```

set default params

This command sets all the parameters to their default values. This does not affect the factory-calibrated parameters.

Send:	set	default	params	
Receive:	set	default	params	ok

lamp status

This command reports the status of the flash lamp on or off. The example that follows reports the flash lamp is on.

Send: lamp status Receive: lamp status on

set lamp onoff

These commands set the flash lamp *on* or *off*. The example that follows turns the flash lamp off.

Send:	set	lamp	off	
Receive:	set	lamp	off	ok

pmt status

This command reports the status of the PMT on or off. The example that follows reports that the PMT is on.

```
Send: pmt status
Receive: pmt status on
```

set pmt onoff

These commands set the PMT *on* or *off*. The example that follows turns the PMT off.

Send:	set pmt off
Receive:	set pmt off ok

save

set save params

This command stores all current parameters in FLASH memory. It is important that each time instrument parameters are changed, that this command be sent. If changes are not saved, they will be lost in the event of a power failure. The example that follows saves the parameters to FLASH memory.

Send: set save params Receive: set save params ok

time

This command reports the current time (24-hour time). The example that follows reports that the internal time is 2:15:30 pm.

Send: time Receive: time 14:15:30 set time hh:mm:ss hh = hours mm = minutes ss = seconds

This command sets the internal clock (24-hour time). The example that follows sets the internal time to 2:15 pm.

Note If seconds are omitted, the seconds default to 00. ▲

Send: set time 14:15 Receive: set time 14:15 ok

Communications addr dns Configuration

This command reports the TCP/IP address for the domain name server.

Send: addr dns Receive: addr dns 192.168.1.1

set addr dns address

This command sets the dns *address*, where *address* consists of four numbers ranging from 0-255 inclusive, separated by ".".

Send:	set	addr	dns	192.168.1.1	
Receive:	set	addr	dns	192.168.1.1	ok

addr gw

This command reports the default TCP/IP gateway address.

Send: addr gw Receive: addr gw 192.168.1.1

set addr gw address

This command sets the default gateway *address*, where *address* consists of four numbers ranging from 0-255 inclusive, separated by ".".

Send:	set	addr	gw	192.168.1.1	
Receive:	set	addr	gw	192.168.1.1	ok

addr ip

This command reports the IP address of the analyzer.

Send:	addr	ip	
Receive:	addr	ip	192.168.1.200

set addr ip address

This command sets the analyzer's IP *address*, where *address* consists of four numbers ranging from 0-255 inclusive, separated by ".".

Send: set addr ip 192.168.1.200 Receive: set addr ip 192.168.1.200 ok

addr nm

This command reports the IP netmask.

Send: addr nm Receive: addr nm 255.255.255.0

set addr nm address

This command sets the nm *address*, where *address* consists of four numbers ranging from 0-255 inclusive, separated by ".".

Send: set addr nm 255.255.255.0 Receive: set addr nm 255.255.255.0 ok

baud

This command reports the current baud rate for the serial port (RS232/RS485). The example that follows reports that the current baud rate is 9600 baud.

Send: baud Receive: baud 9600 **set baud** *rate rate* = | 1200 | 2400 | 4800 | 9600 | 19200 | 38400 | 57600 | 115200 |

This command sets the instrument baud *rate*. The example that follows sets the instrument's baud rate to 9600.

Note After the command is sent, the baud rate of the sending device must be changed to agree with the instrument. ▲

Send:	set	baud	9600	
Receive:	set	baud	9600	ok

dhcp

This command reports the current state of use of DHCP on or off. DHCP is used to assign an IP address to the analyzer automatically. The example that follows shows that DHCP is on.

Send: dhcp Receive: dhcp on

set dhcp onoff

These commands enables and disables the DHCP service by either *on* or *off*. Changes to this parameter will only take effect when the analyzer is powered up. The example that follows sets the DHCP service on.

Note When DHCP is set to on, the user-supplied addr gw, addr dns, addr ip, and addr nm parameters are not used. ▲

```
Send: set dhcp on
Receive: set dhcp on ok
```

format

This command reports the current reply termination format. The example that follows shows that the reply format is 00, which means reply with no checksum, according to **Table B–9**.

Send:	format
Receive:	format 00

set format format

This command sets the reply termination *format*, where *format* is set according to **Table B–9**. The example that follows sets the reply termination format to checksum.

Send:	set format	01
Receive:	set format	01 ok

Table B–9. Reply Te	rmination Formats
---------------------	-------------------

Format	Reply Termination
00	<cr></cr>
01	<nl> sum xxxx <cr></cr></nl>

where xxxx = 4 hexadecimal digits that represent the sum of all the characters (bytes) in the message

host name

This command reports the host name string.

Send:	host	name	
Receive:	host	name	analyzer01

set host name string

This command sets the host name *string*, where *string* is 1-13 alphanumeric characters.

Send:	set host name	analyzer01
Receive:	set host name	analyzer01 ok

instr name

This command reports the instrument name.

Send:	instr name
Receive:	instr name
	SO2 Analyzer
	SO2 Analyzer

instrument id

This command reports the instrument id.

Send:	instrument	id	
Receive:	instrument	id	12

set instrument id value

This command sets the instrument id to *value*, where *value* is a decimal number between 0 and 127 inclusive.

Note Sending this command via RS-232 or RS-485 will require the host to use the new id for subsequent commands. ▲

```
Send: set instrument id 12
Receive: set instrument id 12 ok
```

mode

This command reports what operating mode the instrument is in: local, service, or remote. The example that follows shows that the instrument is in the remote mode.

Send:	mode	
Receive:	mode	remote

set mode local set mode remote

These commands set the instrument to local or remote mode. The example that follows sets the instrument to the local mode.

Send:	set	mode	local	
Receive:	set	mode	local	ok

program no

This command reports the analyzer's model information and program version number, which will be dependent on the current version.

Send:	program	no			
Receive:	program	no	iSeries	43i	01.01.10.003

set layout ack

This command disables the stale layout/layout change indicator ('*') that is attached to each response if the layout has changed.

Send:	set	layout	ack	
Receive:	set	layout	ack	ok

I/O Configuration analog iout range channel

This command reports the analog current output range setting for *channels*, where *channel* must be between 1 and 6, inclusive. The example that follows reports current output channel 4 to the 4-20 mA range, according

to **Table B–10**. This command responds with "feature not enabled" if the I/O expansion board is not detected.

```
Send: analog iout range 4
Receive: analog iout range 4 2
```

set analog iout range channel range

This command sets analog current output *channel* to the *channel range* where *channel* is between 1 and 6 inclusive, and *range* is set according to **Table B–10**. The example that follows sets current output channel 4 to the 0-20 mA range. This command responds with "feature not enabled" if the I/O expansion board is not detected.

```
Send: set analog iout range 4 1
Receive: set analog iout range 4 1 ok
```

Table B–10. Analog Current Output Range Values

Range	Output Range
1	0-20 mA
2	4-20 mA
0 [cannot be set to this, but may report]	Undefined

analog vin channel

This command retrieves the analog voltage input *channel* data, both the calculated value and the actual voltage. In the example that follows, the "calculated" value of channel 1 is 75.325 degrees F, volts are 2.796. This command responds with "feature not enabled" if the I/O expansion board is not detected.

Send:	analog	vin	1		
Receive:	analog	vin	1	75.325	2.796

analog vout range channel

This command reports the analog voltage output *channel* range, where *channel* is between 1 and 6 inclusive, according to Table B-11.

```
Send: analog vout range 2
Receive: analog vout range 2 3
```

set analog vout range channel range

This command sets analog voltage output *channel* to the range, where *channel* is between 1 and 6 inclusive, and *range* is set according to **Table B–11**. The example that follows sets channel 2 to the 0-10 V range.

Send:	set	analog	vout	range	2	3
Receive:	set	analog	vout	range	2	3 ok

Table B-	11. Analog	Voltage	Output	Range Valu	ies

Range	Output Range
1	0-1 V
2	0-100 mV
3	0-10 V
4	0-5 V
0 [cannot be set to this, but may report]	Undefined

dig in

This command reports the status of the digital inputs as a 4-digit hexadecimal string with the most significant bit (MSB) being input 16.

Send:	dig ir	า
Receive:	dig in	n Oxff7f

din channel

This command reports the action assigned to input *channel* and the corresponding active state. The example that follows reports the input 1 to be assigned an index number 3 corresponding to action of SO₂ mode with the active state being high.

Send: din 1 Receive: din 1 3 SO2 MODE high

set din channel index state

This command assigns digital input *channel* (1-16) to activate the action indicated by *index* (1-35), when the input transitions to the designated *state* (high or low). Use "list din var" command to obtain the list of supported *index* values and corresponding actions.

```
Send: set din 5 9 high
Receive: set din 1 9 high ok
```

dout channel

This command reports the index number and output variable and the active state assigned to output *channel*. The example that follows reports the input 4 to be assigned an index number 11 corresponding to general alarm with the active state being open.

Send:	dout	4				
Receive:	dout	4	11	GEN	ALARM	open

set dout *channel index state*

This command assigns digital output *channel* to be assigned to the action associated with *index*, and assigns it an active state of *state* (open or closed).

Send:	set	dout	4	11	open	
Receive:	set	dout	4	11	open	ok

dtoa channel

This reports the outputs of the 6 or 12 Digital to Analog converters, according to **Table B–12**. The example that follows shows that the D/A #1 is 97.7% full-scale.

Send:	dtoa	1	
Receive:	dtoa	1	97.7%

Note All channel ranges are user definable. If any customization has been made to the analog output configuration, the default selections may not apply.

D to A	Function	Single Range	Dual Range	Autorange
1	Voltage Output	Low SO ₂	Low SO_2	$High/Low SO_2$
2	Voltage Output	Low SO ₂	High SO_2	Range Status
3	Voltage Output	Not Assigned	Not Assigned	Not Assigned
4	Voltage Output	Not Assigned	Not Assigned	Not Assigned
5	Voltage Output	Not Assigned	Not Assigned	Not Assigned
6	Voltage Output	Not Assigned	Not Assigned	Not Assigned
7	Current Output	Low SO ₂	Low SO ₂	High/Low SO_2
8	Current Output	Low SO ₂	High SO_2	Range Status
9	Current Output	Not Assigned	Not Assigned	Not Assigned
10	Current Output	Not Assigned	Not Assigned	Not Assigned
11	Current Output	Not Assigned	Not Assigned	Not Assigned
12	Current Output	Not Assigned	Not Assigned	Not Assigned

Table B–12. Default Output Assignment

list var aout list var dout list var din

These commands report the list of index numbers, and the variables (associated with that index number) available for selection in the current mode (determined by single/dual/auto, gas mode) for analog output, digital output and digital inputs. The index number is used to insert the variable in a field location in a list using "set sp *field index*". The example that follows reports the list of analog output, index numbers, and variables.

Send: Receive:	list var aout list var aout index variable
	0 none
	1 SO2
	11 intt
	12 rctt
	16 pres
	17 smplfl
	18 pmtv
	19 lmpv
	20 lmpi
	21 ain1
	22 ain2
	23 ain3
	24 ain4
	25 ain5
	26 ain6
	27 ain7
	28 ain8

relay stat

This command reports the current relay logic normally "open" or normally "closed," if all the relays are set to same state, that is all open or all closed. The example that follows shows that the status when all the relays logic is set to normally "open".

Send:	relay	stat	
Receive:	relay	stat	open

Note If individual relays have been assigned different logic then the response would be a 4-digit hexadecimal string with the least significant byte (LSB) being relay no 1. ▲

For example:

Receive: relay stat 0x0001 (indicates relay no 1 is set to normally open logic, all others are normally closed) Receive: relay stat 0x0005 (indicates relay no 1 and 3 are set to be normally open logic, all others are normally closed)

set relay open set relay open *value* set relay closed set relay closed *value*

These commands set the relay logic to normally open or closed for relay number *value*, where *value* is the relay between 1 and 16. The example that follows sets the relay no 1 logic to normally open.

Note If the command is sent without an appended relay number then all the relays are assigned the set logic of normally open/closed. ▲

Send: set relay open 1 Receive: set relay open 1 ok

Record Layout Definition

Format Specifier for ASCII Responses

The Erec, Lrec Srec layouts contain the following:

- A format specifier for parsing ASCII responses
- A format specifier for parsing binary responses,

In addition to these the Erec Layout contains

• A format specifier for producing the front-panel displays.

In operation, values are read in using either the ASCII or binary format specifiers and converted to uniform internal representations (32-bit floats or 32-bit integers). These values are converted into text for display on the screen using the format specifier for the front-panel display. Normally, the specifier used to parse a particular datum from the input stream will be strongly related to the specifier used to display it (e.g., all of the floating point inputs will be displayed with an 'f output specifier, and all of the integer inputs will be displayed with a 'd' specifier).

The first line of the Layout response is the scanf-like parameter list for parsing the fields from an ASCII ERec response. Parameters are separated by spaces and the line is terminated by a \n (the normal line separator character). Valid fields are:

%x - parse a hexadecimal number %1x - parse a long (32-bit) hex number %* - ignore the field Note Signed versus unsigned for the integer values does not matter; it is

%s - parse a string

handled automatically. \blacktriangle

%d - parse a decimal number

%ld - parse a long (32-bit) decimal number

%f - parse a floating point number

Format Specifier for Binary Responses

The second line of the Layout response is the binary parameter list for parsing the fields from a binary response. Parameters MUST be separated by spaces, and the line is terminated by a '\n'. Valid fields are:

```
t - parse a time specifier (2 bytes)
D - parse a date specifier (3 bytes)
i - ignore one 8-bit character (1 byte)
e - parse a 24-bit floating point number (3 bytes: n/x)
E - parse a 24-bit floating point number (3 bytes: N/x)
f - parse a 32-bit floating point number (4 bytes)
c - parse an 8-bit signed number (1 byte)
C - parse an 8-bit unsigned number (1 byte)
n - parse a 16-bit signed number (2 bytes)
N - parse a 16-bit unsigned number (2 bytes)
M - parse a 24-bit signed number (3 bytes)
M - parse a 24-bit unsigned number (3 bytes)
l - parse a 32-bit signed number (4 bytes)
L - parse a 32-bit unsigned number (4 bytes)
```

There is an optional single digit d which may follow any of the numeric fields which indicates that after the field has been parsed out, the resulting value is to be divided by 10^{d} . Thus the 16-bit field 0xFFC6 would be interpreted with the format specifier 'n3' as the number -0.058.

Format Specifier for Front-Panel Layout The subsequent lines in the ERec Layout response describe the appearance of the full panel. The full instrument panel as it appears on the screen has two columns of lines. Each line is composed of three major components: (1) a text field, (2) a value field, and (3) a button. None of these three components is required. The text field contains statically displayed text.

The value field displays values which are parsed out of the response to a DATA/ERec command. It also displays, though background changes, alarm status. The button, when pressed, triggers input from either a dialog box or a selection list. There are five kinds of buttons, B, I, L, T, and N.

Each line in the layout string corresponds to one line on the display. The
layout string describes each of the three major fields as well as translation
mechanisms and corresponding commands.

Text	The first field in the layout string is the text. It is delimited by a ':'. The
	string up to the first ':' will be read and inserted in the text field of the line.

Value String This is followed by a possible string, enclosed in quotes. This is used to place a string into the value field.

Value Source The value source, which is the item (or word) number in the DATA/ERec response, appears next. This is followed by an optional bitfield designator. The datum identified by the value source can be printed as a string 's', hexadecimal 'x', decimal 'd', or floating point 'f, or binary 'b' number. Typically, bitfield extractions are only done for decimal or hexadecimal numbers.

Floating-point numbers can be followed with an optional precision specifier which will be used as an argument to printf's %f format (e.g., a field of '4' would be translated into the printf command of '%.3f'). Alternately, the special character '*' can precede the precision specifier; this causes an indirection on the precision specifier (which now becomes a field number).

This is useful when formatting, for example, numbers which have varying precision depending on the mode of the instrument.

Binary numbers can also have an optional precision specifier which is used to determine how many bits to print. For example, the specifier 'b4' will print the lowest four bits of the parsed number.

There are serious restrictions on where an 's' field may appear: currently sources 1 and 2 must be 's', and no others may be 's'.

- Alarm Information The value source is followed by optional alarm information, indicated by a commercial at sign '@' with a source indicator and a starting bit indicator. All alarm information is presumed to be two bits long (low and high). The bitfield extraction is performed on the integer part of the source. Typical alarm information would appear as '@6.4'.
- **Translation Table** Then, there appears an optional translation table within braces '{}'. This is a string of words separated by spaces. An example translation table would be '{Code_0 Code_1 Code_2 Code_3}'. The value, once extracted is used

as a zero-based index into the translation table to determine the string to display.

Selection Table	Then there appears an optional selection table within parentheses '()'. This is a string of numbers separated by spaces '(0 1)'. The selection table lists the translation table entries which the user may select from when setting the parameter. This is not necessarily the same as the entries which may be displayed.
Button Designator	Then there appears an optional button designator. This will be one of 'B', 'I', 'L', 'T', or 'N'.
	B- Indicates a button which pops up an input dialog prompting the user for a new value using the designated input format. The input format is specified from the 'B' through the subsequent semicolon.
	I—Indicates a button which pops up a selection list with input translation. That is, the values read are translated before they are compared to the selection list options.
	L—Indicates a button which pops up a selection list without any translation. The output value is number of the selected option.
	T—Indicates a button which pops up a selection list with output translation. The number of the option selected is used as an index into the translation table to generate an output string.
	N—Indicates a button which only sends the subsequent command to the instrument. No user-prompting happens.
Examples	Some examples ('\n' is the C syntax for an end-of-line character):
	'Concentrations\n'
	This is a single text-only line.
	'\n'

This is a single blank line.

' NO:3s\n'

This is a line which appears slightly indented. The text field is 'NO', the value is taken from the third element of the data response, and interpreted as a string.

' NO:18sBd.ddd;set no coef %s\n'

This is a line which also appears slightly indented. The next field is also 'NO', but the value is taken from the eighteenth element of the data response, again interpreted as a string. A button appears on this line which, when pressed, pops up an input dialog which will state "Please enter a new value for NO using a d.ddd format." The string entered by the user is used to construct the output command. If the user enters, for example, '1.234', the constructed command will be 'set no coef 1.234'.

' NO:21f{Code_0 Code_1 Code_2 Code_3 Code_4 Code_5 Code_6 Code_7 Code 8 Code 9 Code 10 Code 11}Lset range no %d\n'

This is a line which appears slightly indented, the title is again 'NO', and the value the twenty-first element of the data response, interpreted as a floating-point number. There is a no-translation button which creates a selection list of twelve "Code nn" options. The number of the user selection is used to create the output command.

'Mode:6.12-13x{local remote service service}(0 1)Tset mode %s\n'

This is a line which has a title of 'Mode', and value taken from the sixth field of the data response. There is a bitfield extraction of bits 12 through 13 from the source (the value type is not important here because the value is being translated to an output string). Once the bits have been extracted, they are shifted down to the bit-zero position. Thus, the possible values of this example will be 0 through 3. The translation list shows the words which correspond to each input value, the zeroth value appearing first (0 -> local, 1 -> remote, etc.). The selection list shows that only the first two values, in this case, are to be shown to the user when the button is pressed. The 'T' button indicates full translation, input code to string, and user selection number to output string.

'\xC'

This is a line that starts a new column (the \xC or ^L),

'Comp:6.11x{off on}Tset temp comp %s\n'

This shows that the bitfield end (the second part of a bitfield specification) is optional. The bitfield will be one bit long, starting in this case at the eleventh bit.

'Background:7f*8Bd.ddd;set o3 bkg %s\n'

This shows the use of indirect precision specifiers for floating point displays. The background value is taken from the 7th element, and the precision specifier is taken from the 8th. If the asterisk were not present, it would indicate instead that 8 digits after the decimal point should be displayed.

Appendix C MODBUS Protocol

This appendix provides a description of the MODBUS Protocol Interface and is supported both over RS-232/485 (RTU protocol) as well as TCP/IP over Ethernet.

The MODBUS Commands that are implemented are explained in detail in this document. The MODBUS protocol support for the iSeries enables the user to perform the functions of reading the various concentrations and other analog values or variables, read the status of the digital outputs of the analyzer, and to trigger or simulate the activation of a digital input to the instrument. This is achieved by using the supported MODBUS commands listed below.

For details of the Model 43*i* Trace Level-Enhanced MODBUS Protocol specification, see the following topics:

- "Serial Communication Parameters" on page C-2.
- "TCP Communication Parameters" on page C-2.
- "Application Data Unit Definition" on page C-2.
- "Function Codes" on page C-3.
- "MODBUS Commands Supported" on page C-8.

Additional information on the MODBUS protocol can be obtained at <u>http://www.modbus.org</u>. References are from MODBUS Application Protocol Specification V1.1a MODBUS-IDA June 4, 2004.

Serial Communication Parameters

The following are the communication parameters that are used to configure the serial port of the *i*Series to support MODBUS RTU protocol.

Number of Data bits: 8Number of Stop bits: 1Parity: NoneData rate: from 1200-115200 Baud (9600 is default)

TCP Communication Parameters

iSeries Instruments support the MODBUS/TCP protocol. The register definition is the same as for the serial interface.

TCP connection port for MODBUS: 502

Application Data Unit Definition

Here are the MODBUS ADU (Application Data Unit) formats over serial and TCP/IP:

Serial:	Slave Address	Function Code	Data	Error Check
TCP/IP:	MBAP Header	Function Code	Data	

Slave Address The MODBUS slave address is a single byte in length. This is the same as the instrument ID used for C-Link commands and can be between 1 and 127 decimal (i.e. 0x01 hex to 0x7F hex). This address is only used for MODBUS RTU over serial connections.

Note Device ID '0' used for broadcast MODBUS commands, is not supported. Device IDs 128 through 247 (i.e. 0x80 hex to 0xF7 hex) are not supported because of limitations imposed by C-Link. ▲

MBAP Header In MODBUS over TCP/IP, a MODBUS Application Protocol Header (MBAP) is used to identify the message. This header consists of the following components:

Transaction Identifier	2 Bytes	0x0000 to 0xFFFF (Passed back in response)
Protocol Identifier	2 Bytes	0x00 (MODBUS protocol)
Length	2 Bytes	0x0000 to 0xFFFF (Number of following bytes)
Unit Identifier	1 Byte	0x00 to 0xFF (Passed back in response)

A Slave address is not required in MODBUS over TCP/IP because the higher-level protocols include device addressing. The unit identifier is not used by the instrument.

Function Code	The function code is a single byte in length. The following function codes are supported by the instrument:		
	Read Coils	:	0x01
	Read Inputs	:	0x02
	Read Holding Registers	:	0x03
	Read Input Registers	:	0x04
	Force (Write) Single Coil	:	0x05
	Read Exception Status	:	0x07
	If a function code is received that is not in this list, and invalid function exception is returned.		
Data	The data field varies depending on the function. For more description of these data fields, see "Function Codes" below.		
Error Check	In MODBUS over Serial an error check is included in the message. This is not necessary in MODBUS over TCP/IP because the higher-level protocols ensure error-free transmission. The error check is a two-byte (16-bit) CRC value.		
Function Codes	This section describes the various function codes that are supported by the Model 43 <i>i</i> Trace Level-Enhanced.		
(0x01/0x02) Read Coils / Read Inputs	Read Coils/Inputs reads the status of the digital outputs (relays) in the instrument. Issuing either of these function codes will generate the same response.		
	These requests specify the starting address, i.e. the address of the first output specified, and the number of outputs. The outputs are addressed starting at zero. Therefore, outputs numbered 1–16 are addressed as 0–15.		
	field. Status is indicated as 1 = of the first data byte contains outputs follow toward the hig to high order in subsequent b	= Active the out h order ytes. If	are packed as one per bit of the data (on) and 0 = Inactive (off). The LSB put addressed in the query. The other end of this byte, and from low order the returned output quantity is not a in the final data byte will be padded

with zeros (toward the high order end of the byte). The Byte Count field specifies the quantity of complete bytes of data.

Note The values reported may not reflect the state of the actual relays in the instrument, as the user may program these outputs for either active closed or open. \blacktriangle

Request

Function code	1 Byte	0x01 or 0x02
Starting Address	2 Bytes	0x0000 to maximum allowed by instrument
Quantity of outputs	2 Bytes	1 to maximum allowed by instrument
Unit Identifier	1 Byte	0x00 to 0xFF (Passed back in response)

Response

Function code	1 Byte	0x01 or 0x02
Byte count	1 Byte	N*
Output Status	n Byte	N = N or N+1

N =Quantity of Outputs / 8, if the remainder not equal to zero, then N=N+1

Error Response		
Function code	1 Byte	0x01 or 0x02
Exception code	1 Byte	01=Illegal Function, 02=Illegal Address,
		03=Illegal Data, 04=Slave Device Failure

Here is an example of a request and response to read outputs 2–15:

Request

Field Name	(Hex)
Function	0x01
Starting Address Hi	0x00
Starting Address Lo	0x02
Quantity of Outputs Hi	0x00
Quantity of Outputs Lo	0x0D

Response

Field Name	(Hex)
Function	0x01
Byte Count	0x03
Output Status 2–10	OxCD
Output Status 11–15	0x0A

The status of outputs 2-10 is shown as the byte value 0xCD, or binary 1100 1101. Output 10 is the MSB of this byte, and output 2 is the LSB. By convention, bits within a byte are shown with the MSB to the left, and the LSB to the right. Thus the outputs in the first byte are '10 through 2', from left to right. In the last data byte, the status of outputs 15-11 is shown as the byte value 0x0A, or binary 0000 1010. Output 15 is in the fifth bit position from the left, and output 11 is the LSB of this byte. The four remaining high order bits are zero filled.

Read holding/input registers reads the measurement data from the instrument. Issuing either of these function codes will generate the same response. These functions read the contents of one or more contiguous Registers registers.

> These registers are 16 bits each and are organized as shown below. All of the values are reported as 32-bit IEEE standard 754 floating point format. This uses 2 sequential registers, least significant 16 bits first.

The request specifies the starting register address and the number of registers. Registers are addressed starting at zero. Therefore registers numbered 1-16 are addressed as 0-15. The register data in the response message are packed as two bytes per register, with the binary contents right justified within each byte. For each register, the first byte contains the high order bits and the second contains the low order bits.

The status of outputs 2–10 is shown as the byte value 0xCD, or binary 1100 1101. Output 10 is the MSB of this byte, and output 2 is the LSB. By convention, bits within a byte are shown with the MSB to the left, and the LSB to the right. Thus, the outputs in the first byte are '10 through 2', from left to right. In the last data byte, the status of outputs 15-11 is shown as the byte value 0x0A, or binary 0000 1010. Output 15 is in the fifth bit position from the left, and output 11 is the LSB of this byte. The four remaining high order bits are zero filled.

(0x03/0x04) Read Holding **Registers / Read Input** Registers

Read holding / input registers reads the measurement data from the instrument. Issuing either of these function codes will generate the same

(0x03/0x04) Read Holding **Registers / Read Input**

response. These functions read the contents of one or more contiguous registers.

These registers are 16 bits each and are organized as shown below. All of the values are reported as 32-bit IEEE standard 754 floating point format. This uses 2 sequential registers, least significant 16 bits first.

The request specifies the starting register address and the number of registers. Registers are addressed starting at zero. Therefore, registers numbered 1-16 are addressed as 0-15. The register data in the response message are packed as two bytes per register, with the binary contents right justified within each byte. For each register, the first byte contains the high order bits and the second contains the low order bits.

Request

Function code	1 Byte	0x03 or 0x04
Starting Address	2 Bytes	0x0000 to maximum allowed by instrument
Quantity of Registers	2 Bytes	1 to maximum allowed by instrument

Response

Function code	1 Byte	0x03 or 0x04
Byte count	1 Byte	2 x N*
Register value	N* x 2 Bytes	N = N or N+1

*N = Quantity of Registers

Error Response

Function code	1 Byte	Function code + 0x80
Exception code	1 Byte	01=Illegal Function, 02=Illegal Address,
		03=Illegal Data, 04=Slave Device Failure

Here is an example of a request and response to read registers 10–13:

Request	
Field Name	(Hex)
Function	0x03
Starting Address Hi	0x00
Starting Address Lo	0x09
No. of Registers Hi	0x00
No. of Registers Lo	0x04

Response

Field Name	(Hex)
Function	0x03
Byte Count	0x06
Register value Hi (10)	0x02
Register value Lo (10)	0x2B
Register value Hi (11)	0x00
Register value Lo (11)	0x00
Register value Hi (12)	0x00
Register value Lo (12)	0x64
Register value Hi (13)	0x00
Register value Lo (13)	0x64

The contents of register 10 are shown as the two byte values of 0x02 0x2B. Then contents of registers 11–13 are 0x00 0x00, 0x00 0x64 and 0x00 0x64 respectively.

(0x05) Force (Write) Single Coil

The force (write) single coil function simulates the activation of the digital inputs in the instrument, which triggers the respective action.

This function code is used to set a single action to either ON or OFF. The request specifies the address of the action to be forced. Actions are addressed starting at zero. Therefore, action number 1 is addressed as 0. The requested ON/OFF state is specified by a constant in the request data field. A value of 0xFF00 requests the action to be ON. A value of 0x0000 requests it to be OFF. All other values are illegal and will not affect the output. The normal response is an echo of the request, returned after the state has been written.

Request		
Function code	1 Byte	0x05
Starting Address	2 Bytes	0x0000 to maximum allowed by instrument
Output Value	2 Bytes	0x0000 or 0xFF00
Response		
пезропае		
Function code	1 Byte	0x05
Starting Address	2 Bytes	0x0000 to maximum allowed by instrument
Output Value	2 Bytes	0x0000 or 0xFF00

Error Response

Function code	1 Byte	Function code + 0x80
Exception code	1 Byte	01=Illegal Function, 02=Illegal Address,
		03=Illegal Data, 04=Slave Device Failure

Here is an example of a request to write Coil 5 ON:

Request

Field Name	(Hex)
Function	05
Output Address Hi	00
Output Address Lo	05
Output Value Hi	FF
Output Value Lo	00

Response

Field Name	(Hex)
Function	05
Output Address Hi	00
Output Address Lo	05
Output Value Hi	FF
Output Value Lo	00

MODBUS Commands Supported

Tables C1 through C3 list the MODBUS commands supported for the Model 43*i* Trace Level-Enhanced.

Table C-1. Read Registers for 43i Trace Level-Enhanced

Register Number	Variable
40001&40002	SO2 CONC
40003&40004	NOT USED
40005&40006	NOT USED
40007&40008	LO SO2 CONC (Dual/Auto Range mode)
40009&40010	NOT USED
40011&40012	NOT USED

Register Number	Variable
40013&40014	HI SO2 CONC (Dual/Auto Range mode)
40015&40016	NOT USED
40017&40018	NOT USED
40019&40020	RANGE (SO2) (Dual/Auto Range mode)
40021&40022	INTERNAL TEMP
40023&40024	CHAMBER TEMP
40025&40026	NOT USED
40027&40028	NOT USED
40029&40030	NOT USED
40031&40032	CHAMBER PRESSURE
40033&40034	SAMPLE FLOW
40035&40036	PMT VOLTS
40037&40038	FLASH VOLTS
40039&40040	FLASH REF
40041&40042	ANALOG IN 1 (I/O Expansion Board installed)
40043&40044	ANALOG IN 2 (I/O Expansion Board installed)
40045&40046	ANALOG IN 3 (I/O Expansion Board installed)
40047&40048	ANALOG IN 4 (I/O Expansion Board installed)
40049&40050	ANALOG IN 5 (I/O Expansion Board installed)
40051&40052	ANALOG IN 6 (I/O Expansion Board installed)
40053&40054	ANALOG IN 7 (I/O Expansion Board installed)
40055&40056	ANALOG IN 8 (I/O Expansion Board installed)
40057&40058	NOT USED
40059&40060	NOT USED
40061&40062	NOT USED
40063&40064	EXTERNAL ALARMS
40065&40066	02 % (02 Sensor installed)
40067&40068	02 SENSOR TEMP (02 Sensor installed)
40069&40070	NOT USED
40071&40072	NOT USED
40073&40074	NOT USED
40075&40076	CORRECTED SO2 (O2 Sensor installed)
40077&40078	LO CORRECTED SO2 (02 Sensor installed)
40079&40080	HI CORRECTED SO2 (O2 Sensor installed)

Register Number	Variable
40081&40082	SO2 BACKGROUND
40083&40084	LO SO2 COEFFICIENT
40085&40086	HI SO2 COEFFICIENT

Table C–2. Write Coils for 43i Trace Level-Enhanced

Coil Number	Action Triggered
101	ZERO MODE
102	SPAN MODE
103	SO2 MODE
104	NOT USED
105	SET BACKGROUND
106	CAL TO LOW SPAN
107	AOUTS TO ZERO
108	AOUTS TO FS
109	CAL TO HIGH SPAN

Table C-3.	Read	Coils for 43i	Trace	Level-Enhanced
------------	------	---------------	-------	----------------

Coil Number	Status
1	AUTORANGE
2	LOCAL/REMOTE
3	SERVICE
4	UNITS (0 = ppb; 1 = $\mu g/m^3$)
5	ZERO MODE
6	SPAN MODE
7	SAMPLE MODE
8	NOT USED
9	NOT USED
10	GEN ALARM
11	SO2 CONC MAX ALARM
12	SO2 CONC MIN ALARM
13	NOT USED
14	NOT USED
15	NOT USED

Coil Number	Status
16	NOT USED
17	INT TEMP ALARM
18	CHAMB TEMP ALARM
19	CONVERTER TEMP
20	PGAS TEMP
21	PRESSURE ALARM
22	SAMPLE FLOW ALARM
23	FLASH REF ALARM
24	FLASH VOLTAGE ALARM
25	MOTHERBOARD STATUS ALARM
26	MEASUREMENT INTERFACE BOARD STATUS ALARM
27	I/O EXP BD STATUS ALARM
28	CONC ALARM
29	PURGE MODE
30	ZERO CHK/CAL ALARM (Zero/Span Option)
31	SPAN CHK/CAL ALARM (Zero/Span Option)

MODBUS Protocol MODBUS Commands Supported

Appendix D Geysitech (Bayern-Hessen) Protocol

This appendix provides a description of the Geysitech (Bayern-Hessen or BH) Protocol Interface and is supported both over RS-232/485 as well as TCP/IP over Ethernet.

The Geysitech Commands that are implemented are explained in detail in this document. The Geysitech protocol support for the *i*Series enables the user to perform the functions of reading the various concentrations and to trigger the instrument to be in sample/zero/span mode if valid for that instrument. This is achieved by using the supported Geysitech commands listed below.

For details of the Model 43*i* Trace Level-Enhanced Geysitech Protocol specification, see the following topics:

"Serial Communication Parameters" on page D-1 "TCP Communication Parameters" on page D-2 "Instrument Address" on page D-2 "Abbreviations Used" on page D-2 "Basic Command Structure" on page D-2

"Block Checksum" on page D-3

"Geysitech Commands" on page D-3

Serial Communication Parameters

The following are the communication parameters that are used to configure the serial port of the *i*Series to support Geysitech protocol.

Number of Data bits	: 8
Number of Stop bits	:1
Parity	: None
Data rate	: from 1200-115200 Baud (9600 is default)

TCP Communication Parameters	<i>i</i> Series Instruments support the Geysitech/TCP protocol over TCP/IP. The register definition is the same as for the serial interface.					
	TCP connection port for Geysitech: 9882					
Instrument Address	The Geysitech instrument address has a value between 0 and 127 and is represented by 3 digit ASCII number with leading zeros or leading spaces if required (e.g. Instrument address of 1 is represented as 001 or <sp><sp>1)</sp></sp>					
	The instrument Address is the same as the Instrument ID used for C-Link and MODBUS commands. This can be set via the front panel.					
	The Instrument Address is represented by <address> in the examples throughout this document.</address>					
	Note Device IDs 128 through 247 are not supported because of limitations imposed by the C-Link protocol. ▲					
Abbreviations Used	The following is a list of abbreviations used in this document:					
	<cr> is abbreviation for Carriage Return (ASCII code 0x0D)</cr>					
	<stx> is abbreviation for Start of Text (ASCII code 0x02)</stx>					
	<etx> is abbreviation for End of Text (ASCII code 0x03)</etx>					
	<sp> is abbreviation for space (ASCII code 0x20)</sp>					
Basic Command	The following is the basic structure of a Geysitech command:					
Structure	<stx>Command text<etx><bcc></bcc></etx></stx>					
	OR					
	<stx>Command text<cr></cr></stx>					
	Each Command is framed by control characters, <stx> at the start and terminated with either <etx> or <cr>.</cr></etx></stx>					
	If a command is terminated with <etx> then additional two characters <bcc> is attached after <etx>, this is the block checksum.</etx></bcc></etx>					

Block Checksum <bcc></bcc>	The block checksum is calculated beginning with a seed value of 00000000, binary (0x00), and bitwise exclusive ORing with each of the characters of the command string (or response) including the framing characters <stx> and <etx>. The checksum works as an error check. The command terminator determines the presence or absence of <bcc>.</bcc></etx></stx>						
	If a command is terminated by <etx> then the next two characters are the checksum, if the command is terminated with <cr> no checksum is attached</cr></etx>						
	The block checksum is represented by two characters, which represent a 2 digit hex number (1byte). (e.g. 1 byte 0xAB hex checksum will be represented by the two characters 'A' & 'B')						
	The checksum is referred to as <bcc> throughout this document.</bcc>						
Geysitech Commands	The following commands are supported by the Geysitech protocol:						
	Instrument Control Command (ST)						
	• Data Sampling/Data Query Command (DA)						
Instrument Control Command (ST)	There are three control commands supported by the Geysitech protocol.						
	This <control command=""> is a single letter, which triggers an action in the instrument. These commands are active only when service mode is inactive and the zero/span option is present.</control>						
	Command 'N' switches the instrument gas mode to Zero mode.						
	Command 'K' switches the instrument gas mode to Span mode.						
	Command 'M' switches the instrument gas mode to Sample mode.						
	The following are the different acceptable formats of the ST command:						
	<stx>ST<address><control command=""><etx><bcc></bcc></etx></control></address></stx>						
	OR						
	<stx>ST<address><control command=""><cr></cr></control></address></stx>						
	OR						
	<stx>ST<address><sp><control command=""><cr></cr></control></sp></address></stx>						
	OR						
	<stx>ST<address><sp><control command=""><etx><bcc></bcc></etx></control></sp></address></stx>						

The <address> is optional, which means it can be left out completely. The <address> if present must match the Instrument Address. Additional space can be present after the <address>.

If the received command does not satisfy the above formats or if the <address> does not match the Instrument Address the command is ignored.

This is a sample command to switch the instrument to zero mode, instrument id 5:

<STX>ST005<SP>N<CR>

Data Sampling/Data Query Command (DA)

This command DA initiates a data transfer from the instrument. The instrument responds with measurement data, which depends on the range mode and is listed in "Measurements reported in response to DA command" below.

The command structure for a data query command is as follows:

<STX>DA<address><ETX><BCC>

The <address> is optional, which means it can be left out completely. The <address> if present must match the Instrument Address. Additional space can be present after the <address>.

If the <address> is left out then no space is allowed in the query string.

A command with no address is also a valid command.

The following are the different acceptable formats of the DA command with Instrument Address 5:

<STX>DA<CR>

<STX>DA005<CR>

<STX>DA<SP><SP>5<ETX><BCC>

<STX>DA<ETX><BCC>

The data query string is valid and will be answered with data transmission only if the command starts with <STX> which is followed by the characters DA, and the <address> (if present) matches the Instrument Address, and the command is terminated with either <CR> with no checksum or <ETX> followed by the correct checksum <BCC>.

Sample Data Reply String in response to Data Query Command (DA):

In response to a valid data query command (DA) the instrument responds in the following format:

<STX>MD02<SP><address><SP><measured value1><SP><status><SP><SFKT><SP><address+1><SP><measured value2><SP ><status><SP><SFKT><ETX><BCC>

The response uses the same command terminators as used by the received command i.e. if the received command was terminated with a <CR> the response is terminated with <CR> and if the command was terminated with a <ETX><BCC> the response is terminated with<ETX> and the computed checksum <BCC>.

The 02 after the MD indicates, that two measurements are present in the reply string, (a 03 for three measurements and so on, this will also determine the length of the reply string).

<address> is the Instrument Address. Each subsequent measurement attached to the response will have the <address + X> where X keeps incrementing by 1 for each measurement included.

<measured value> is the concentration value in currently selected gas units represented as exponential representation with 4 characters mantissa and 2 characters exponent, each with sign.

Mantissa: sign and 4 digits. The decimal point is assumed to be after the first digit and is not transmitted.

Exponent: sign and 2 digits.

Example:

-5384000.0	is represented as -5384+06
+0.04567	is represented as +4567-02

<status>: is formed by < operating status > and < error status > and separated by a space i.e.

<operating status><SP><error status>

Each of the two (<operating status> and <error status>) are formed by two characters each representing a 2 digit hex number which is one byte (8 Bits) operation status and one byte (8 Bits) error status.

These two bytes contain the information about the main operating conditions of the instrument at that instant. For details on how to interpret the status bytes refer to Table D-1 and Table D-2 below.

<SFKT>: is the space provided for future use for special function, it currently contains a string of ten 0's i.e. <0000000000>.

	Example:							
	Geysitech Protocol with transmission of three concentrations (Instrument ID is 1, Operation Status is 03, Error Status is 04):							
	Data Query String: <stx>DA<cr></cr></stx>							
	Reply String: <stx>MD03<sp>001<sp>+2578+01<sp>03 <hr/></sp></sp></sp></stx>							
	+5681+00 <sp>03<sp>04<sp>000000000<sp>003<sp>+1175+01<sp>03<sp>04<sp th="" ↑="" ↑<=""></sp></sp></sp></sp></sp></sp></sp></sp>							
	Second Concentration = 5.681 Address+2 Third Concentration=11.75							
	00000000 <sp><cr></cr></sp>							
	The attached concentrations are in the selected gas units. The measurements that are attached to the response if not valid in a particular mode then a value of 0.0 will be reported.							
Measurements reported in response to DA command	The following measurements reported in response to DA command are for the Model 43 <i>i</i> Trace Level-Enhanced.							
Single Range Mode	The 1 measurement reported in single range mode includes:SO₂							
Dual/Auto Range Mode	 The 2 measurements reported in dual or auto range modes include: low SO₂ high SO₂ 							

Operating and Error Status

See Table D–1 for operating status and Table D–2 for error status for the Model 43i Trace Level-Enhanced.

Table D–1. Operating Status for Model 43*i* Trace Level-Enhanced

	D7	D6	D5	D4	D3	D2	D1	DO
→ Bit	8	7	6	5	4	3	2	1
\rightarrow Hex-value	80	40	20	10	08	04	02	01
	MSB				LSB			
Operating status:								
Service Mode (On)	0	0	0	0	0	0	0	1
Maintenance (Local)	0	0	0	0	0	0	1	0
Zero gas (On)	0	0	0	0	0	1	0	0
Span gas (On)	0	0	0	0	1	0	0	0
Gas Unit Indication (ppb OR ppm)	0	0	0	1	0	0	0	0
Test LED (On)	0	0	1	0	0	0	0	0
Flash Lamp (Off)	0	1	0	0	0	0	0	0
Not used	1	0	0	0	0	0	0	0

 Table D–2.
 Error Status for Model 43i Trace Level-Enhanced

	D7	D6	D5	D4	D3	D2	D1	DO	
→ Bit	8	7	6	5	4	3	2	1	
\rightarrow Hex-value	80	40	20	10	08	04	02	01	
	MSB				LSB				
Error status:									
Internal Temperature Alarm	0	0	0	0	0	0	0	1	
Reaction Chamber Temperature Alarm	0	0	0	0	0	0	1	0	
Lamp Intensity Alarm	0	0	0	0	0	1	0	0	
Lamp Voltage Alarm	0	0	0	0	1	0	0	0	
Pressure Alarm	0	0	0	1	0	0	0	0	
Sample Flow Alarm	0	0	1	0	0	0	0	0	
Permeation Gas Temperature Alarm	0	1	0	0	0	0	0	0	
Not used	1	0	0	0	0	0	0	0	

Geysitech (Bayern-Hessen) Protocol Geysitech Commands

Appendix E Standards for Trace Level Analyzers

The development of ultra-sensitive analytical analyzers for the measurement of trace quantities of pollutants such as NO, NO₂, or SO₂ has raised a number of questions concerning proper calibration procedures and equipment. Analyzers that in theory have detection limits below 1 ppb, may not in practice be useful due to inadequate and/or inaccurate calibration practices.

Thermo Fisher Scientific has in its development of Trace Level instrumentation used the same basic principles for calibration as for standard analyzers. However, enhanced emphasis on the zero air supply used for dilution of standard gases and for establishing a zero background signal is made.

Chemiluminescence NO/No_x and fluorescence SO₂ analyzers (when properly designed) have bee shown in numerous research studies and compliance monitoring situations to be inherently linear over a wide dynamic range. Calibration is normally done using firs a zero gas then a span gas generated by dilution of a calibration gas cylinder. Dilution is done by dynamic mixing of accurately known flows of span gas and zero gas. For Trace Level analyzers, mass flow controllers that are NIST traceable are required. Nitric oxide and sulfur dioxide calibration standards between 1 and 10 ppm are readily available in specially treated cylinders, and have been shown to have excellent stability and accuracy. NIST traceable mass flow controllers with dull scale ranges from 20 sccm to 20,000 sccm are also readily available. It is therefore relatively straight forward to generate span gas concentration from below 1 ppb to 10 ppb assuming a suitable zero gas source is used. For example:

$$[NO]_{GENERATED} = [NO]_{SPAN} x \frac{NO Flow}{Total Flow}$$

Assuming a calibration cylinder of 1 ppm, NO flow of 10 sccm, and a total flow of 10,000 sccm, allows generation of span concentration of 1 ppb. Using the specifications of the mass flow controllers and calibration cylinder, this concentration should be accurate to within $\pm 5\%$. Multi-point concentrations from 0.5 ppb to 10 ppb may be similarly generated, establishing the linearity of the particular analyzer being calibrated.

Thermo Fisher Scientific believes it is not necessary to generate concentrations below these levels since the fundamental linearity of the instrumentation has been demonstrated.

If however, the zero air used for dilution and for establishing baseline conditions has impurity levels greater than several tenths of a ppb, the accuracy of the analyzer being calibrated may be severely jeopardized. A 0.5 ppb impurity level is equivalent to a 10% relative error for a 5 ppb concentration.

Ultra-zero ambient monitoring gases are available from gas suppliers, however, the typical analyses for No_x and SO_2 impurities only guarantee levels below 5 ppb. In practice, Thermo Fisher Scientific's personnel as well as other users of Trace Level equipment have found these gases to be at least an order of magnitude better than what is guaranteed, and therefore are adequate for most purposes. Non-reactive and diffusion resistant regulators are required, and as the cylinder pressure falls below 500 psig, the integrity of the zero gas becomes more in question.

Rather than relying on cylinder sources for zero air, Thermo Fisher Scientific routinely uses zero air generate by "brute force", that is, by compression, chemical scrubbing and reaction. Ambient air that has been compressed and pressurized to give an output of about 25 psig is dried by passing the air through a heatless air dryer (for example) and then sent through a series of chemical reactors and/or scrubbers. Normally, these include indicating silica gel, Purafil, activated charcoal, and a fine (5 micron) particulate filter. When first used, this "brute force" approach actually can generate enhanced impurity levels for No_x and SO₂, as these gases desorb from the chemical reactors. However, after 24 to 48 hours of continuous operation, impurity levels will generally fall and stabilize below detection limits for the Trace Level analyzers. It is critical when using this type of zero air source to always maintain flow through the system. If flow is interrupted, even for a short period, a reconditioning time of up to 24 hours may be required.

The Model 42i Trace Level analyzer has zero air diagnostic capability built within the instrument. The monitor has three channels, a NO, No_x, and prereactor channel. The prereactor channel mixes the sample with a high concentration of ozone prior to the detection chamber. This effectively creates a dynamic zero by removing any NO from the gas stream. If the zero air source being used is truly a good zero air, the background signals in the NO, No_x, and prereactor modes are virtually identical (within 0.1 to 0.2 ppb due to pneumatic differences). If the background in the no and/or No_x channels are enhanced relative to the prereactor channel, the zero air source being used is inadequate. When calibrating the zero in the Model 42i Trace Level, the background levels are calculated and available in the Calibration Factors menu. Normal background levels are in the 0.5 to 1.5 ppb range, primarily due to the dark current of the photomultiplier tube, note due to impurities in the zero gas source.

In conclusion, tests by the United States Environmental Agency, Tennessee Valley Authority, Battelle National Labs, and the Thermo Fisher Scientific Engineering Department have demonstrated that Trace Level analyzers are readily calibrated at the low concentration levels require for sub-ambient monitoring. Although extra care is required, primarily in zero air generation, users familiar with normal compliance requirements should be able with minimal additional effort to obtain valid concentration data.