




OWNER'S MANUAL

MP175 MIG COMBINATION UNIT

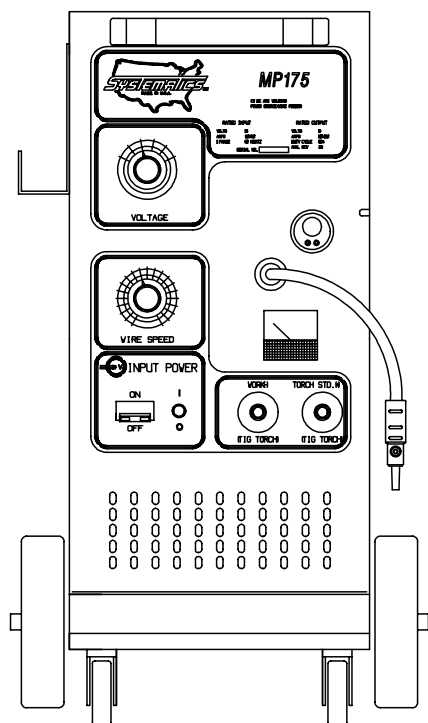

THE **MP175**

REPRESENTS THE LATEST TECHNOLOGY IN MIG COMBINATION UNITS. THE MP175 OPERATES ON **208/230 VOLT AC** SINGLE PHASE CURRENT, AND FEATURES "SMOOTH ARC" TRANSFORMER DESIGN CONCEPT.



FOR TECH. SERVICE, CALL 1-610-696-9040

INSTALLATION
OPERATION
MAINTENANCE

MANUFACTURER'S LIMITED WARRANTY

This equipment is warranted against defects in materials and workmanship for a period of two years from the date of purchase.

EXCEPTION: THE MIG TORCH IS WARRANTED FOR A PERIOD OF 30 DAYS FROM THE DATE OF PURCHASE.

Should the equipment become defective for such reason, the Manufacturer will repair it without charge, if it is returned to the Manufacturer's factory, freight prepaid. This warranty does not cover: (1) failure due to normal wear and tear; (2) consumable parts, such as, but not limited to, torch contact tips, gas cups and insulating bushings; (3) damage by accident, force majeure, improper use, neglect, unauthorized repair or alteration; (4) anyone other than the original purchaser.

THIS LIMITED WARRANTY IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED. THE MANUFACTURER SHALL NOT BE LIABLE FOR ANY INJURY TO PERSONS, INCLUDING DEATH; OR LOSS OR DAMAGE TO ANY PROPERTY, DIRECT OR CONSEQUENTIAL, INCLUDING, BUT NOT LIMITED TO, LOSS OF USE, ARISING OUT OF THE USE, OR THE INABILITY TO USE, THE PRODUCT. THE USER ASSUMES ALL RISK AND LIABILITY WHATSOEVER IN CONNECTION WITH THE USE OF THE PRODUCT, AND BEFORE DOING SO, SHALL DETERMINE ITS SUITABILITY FOR HIS INTENDED USE, AND SHALL ASCERTAIN THE PROPER METHOD OF USING IT.

SOME STATES DO NOT ALLOW LIMITATIONS ON HOW LONG AN IMPLIED WARRANTY LASTS, OR THE EXCLUSIONS OR LIMITATIONS OF INCIDENTAL OR CONSEQUENTIAL DAMAGES. SO THE ABOVE LIMITATIONS OR EXCLUSIONS MAY NOT APPLY TO YOU. THIS WARRANTY GIVES YOU SPECIFIC LEGAL RIGHTS, AND YOU MAY HAVE OTHER RIGHTS WHICH MAY VARY FROM STATE TO STATE.



WARNING

ARC WELDING CAN BE INJURIOUS TO OPERATOR AND PERSONS IN THE WORK AREA — CONSULT INSTRUCTION MANUAL BEFORE OPERATING.

ELECTRIC SHOCK can kill.

- Do not touch electrodes or other electrically live parts.
- Insulate yourself from work and ground.
- Install and ground machine in accordance with the National Electrical Code and local code(s). Read Operating Manual before installing or operating.
- Do not operate with protective covers, panels, or guard removed.
- Disconnect input power before servicing.
- Only qualified personnel should install, use, or service this equipment.

ARC RAYS can injure your eyes and burn skin.

- Wear correct eye, ear, and body protection while welding.

FUMES AND GASES can be dangerous to your health.

- Use enough ventilation and/or exhaust at the arc.
- Keep your head out of fumes.
- Do not breathe fumes.

READ AND UNDERSTAND THE MANUFACTURER'S INSTRUCTIONS AND YOUR EMPLOYER'S SAFETY PRACTICES.

See American National Standard Z49.1, "Safety in Welding and Cutting", published by the American Welding Society, 2501 N.W. 7th St., Miami, Florida 33125; OSHA Safety and Health Standards, 29 CFR 1910 available from U.S. Dept. of Labor, Wash., D.C. 20210.

TABLE OF CONTENTS

INTRODUCTION	1
SPECIFICATIONS	2
CHECK LIST (CONTENTS)	3
INSTALLATION	3
OPERATION	7
MAINTENANCE	13
TROUBLE SHOOTING CHART	15
CONNECTING TIGIT2 OR MHG7 SPOOL GUN	20
CONSUMABLE PARTS BREAKDOWN	22
PARTS BREAKDOWN - MIG TORCH	23
OPTIONS - TIGIT2, MHG7 SPOOL GUN	24

INTRODUCTION


The Systematics **MP175** is a combination welding power source, wire feed unit, MIG torch and accessory package. It operates on **208/230 volts AC input current** and is designed to meet the requirements of auto body repair shops and fabrication. The **MP175** produces fusion welds by the Gas Metal Arc Welding process (GMAW or MIG), on steel up to 1/4" thick (aluminum 3/16"), using .023" through .045" steel wire and 3/64" aluminum wire (**Optional liners and contact tips must be purchased to cover given wire sizes**). Heavier sections can be easily welded using slightly different techniques. Consumable MIG Spot/Stitch Welding on steel can be performed with the **Optional SSTP-2 module** installed.

The number of controls on the unit have been reduced to assist inexperienced operators learn MIG welding. This facilitates rapid set up for welding different thicknesses of material requiring various heat inputs. The **voltage** control adjusts the welding voltage and the **WIRE SPEED** control adjusts the speed of the wire drive motor.

THE MIG PROCESS AS APPLIED TO THE MP175


The MIG process uses a bare, consumable electrode in the form of spooled wire, which is fed by a controllable speed feed unit through the cable and torch to the weld. The emerging wire and the weld are shielded by a stream of CO₂, Argon, or a mixture of the two, which prevents oxidation of the molten weld puddle. The gas shield enables high quality welds to be made without the use of flux, eliminating the need for slag or flux removal after the weld is completed.

The consumable electrode wire is melted and transferred to the weld puddle by the "short arc", "globular" or "spray" transfer mode.

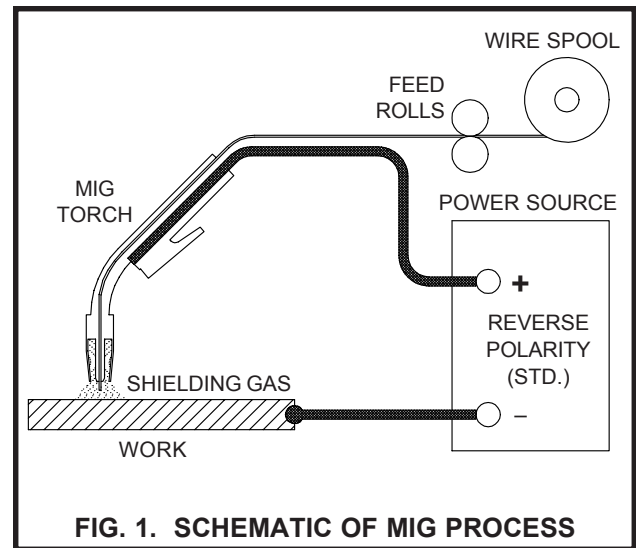

SHORT ARC OR DIP TRANSFER


Short arc transfer occurs at 12 to 22 arc volts (voltage while welding), depending on wire size. Welding commences as the arc is struck and a weld pool is formed. The tip of the electrode wire dips into the pool and causes a short circuit. The short circuit current flow causes a rapid temperature rise in the electrode wire and the end of the wire is melted off. An arc is immediately formed between the tip of the wire and the weld pool, maintaining the electrical circuit and producing sufficient heat to keep the weld pool fluid. The electrode continues to feed and again dips into the pool.

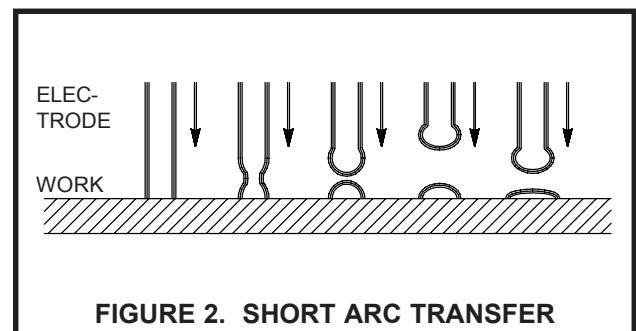

This sequence of events is repeated up to 200 times per second. Short arc transfer is suitable for positional welding. The heat input to the workpiece is kept to a minimum which limits distortion and makes possible the welding of thin sheet material.


GLOBALAR TRANSFER

Globular transfer occurs at the intermediate range of 22 to 24 arc volts, depending on wire size. As the name implies, the transfer takes place in the form of irregularly shaped globules. Globular transfer is useful in cases where a lower heat input than that of true spray is required.

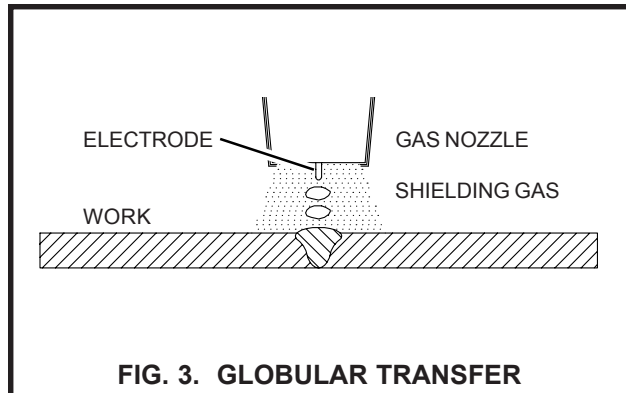

SPRAY TRANSFER

Spray transfer occurs at 22 to 32 arc volts, depending on wire size. The length of the arc is held constant by the voltage available. The higher voltage and current causes the electrode wire to melt off before touching the workpiece. The molten metal crosses the gap to the workpiece in a spray form. Spray transfer is used in the down-hand position and provides higher deposition rates than short arc transfer or globular transfer.

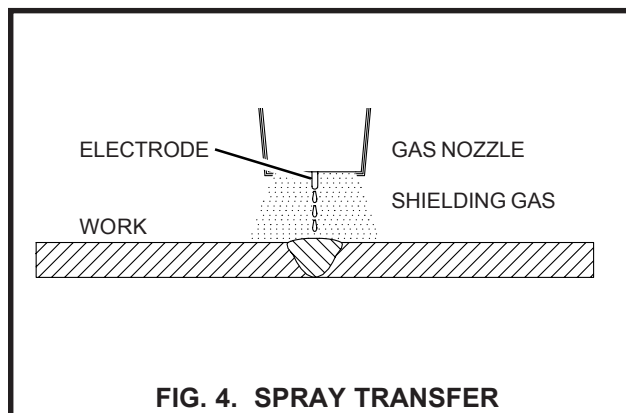

DESCRIPTION

The **MP175** consists of a combination MIG welding power source and wire feed unit, a MIG torch with 10 foot cable, a ten foot work (ground) cable with ground clamp, a fifteen foot power input cable, a gas regulator/flowmeter, a torch accessory kit, and a built-in cylinder rack and industrial wheel kit.

Welder controls are simple and clearly marked. The output voltage is controlled by a six position tap switch, providing six voltage selections. Voltages can be monitored by the voltmeter on the control panel. Wire feed speed is controlled by the wire speed potentiometer.

An **OPTIONAL SPOT/STITCH WELD (SSTP-2)** control module with adjustable timer circuit provides Consumable MIG Spot Welding or Stitch Welding capabilities of light gauge steel.

SPECIFICATIONS

PART NUMBER: MP175

INPUT POWER REQUIREMENTS:

Voltage	208/230 volts AC
Phase	single phase
Frequency	50/60 hertz
Current	22/20 amps

OUTPUT POWER:

Welding Current	- 40% Duty Cycle 175A
Welding Current	- 60% Duty Cycle 160A

DUTY CYCLE TIME PERIOD:

10 minutes

OPEN CIRCUIT VOLTAGE:

18 - 33 volts DC

ARC VOLTAGE:

14 - 26 volts DC

SPECIFICATIONS (Cont.)

WELD CURRENT RANGE:

30 - 175 amps

WIRE TYPES:

mild steel,
stainless steel, aluminum,
bronze, flux cored, flux cored
-
gasless

WIRE SIZES:

.023" - .045" steel,
3/64" aluminum,
(.023" - 3/64" alum. w/ Spool Gun)
.030" - .035" bronze,
.030" - .045" flux cored
(gas shielded or gasless)

WIRE FEED SPEED RANGE:

50 - 500 inches per minute

SHIELDING GASES:

For Steel Argon/CO2 mix or CO2
For Aluminum, Bronze Argon
For Stainless Steel
Argon + 2% Oxygen
For Flux cored Argon/CO2 mix or
CO2

DIMENSIONS:

Height 31 in.
Width 14-1/2 in.
Depth 35-1/2 in.
Weight 175 lbs.

TORCH SPECIFICATIONS

NECK ANGLE:

60 degrees

LEAD LENGTH:

10 feet

OVERALL LENGTH:

10 feet

COOLING METHOD:

gas (air)

RATING - 60% DUTY CYCLE:

With Argon/CO2 gas 200 amps
With CO2 gas 225 amps

CHECK LIST

THE SYSTEMATICS MP175 INCLUDES THE FOLLOWING:

- 1- Combination Power Source/Wire Feeder
- 1- Cylinder Rack/Industrial Wheel Kit
- 1- 15TG10 MIG Torch with adjustable nozzle
- 1- 15 foot Power Input Cable
- 1- 10 foot Work(Ground)Cable and Clamp
- 1- MP250PK Parts Kit
- 1- GR-FM Gas Regulator/Flowmeter
- 1- Nozzle, 1/2 in. orifice (installed on MIG torch)
- 1- Contact Tip, for .030 in. wire (installed on MIG torch)
- 1- ER70S-6-30-3, Sample Spool of .030" Steel Wire

ITEMS REQUIRED FOR MIG WELDING WHICH ARE NOT PROVIDED WITH THE MP175

- 1. Full cover welding helmet with proper colored lens (shade 9 to 11 depending on operator's preference).
- 2. Proper shielding gas and cylinder.
- 3. Leather welding gloves.
- 4. 208 or 230 volt 40 amp single phase AC power.

INSTALLATION

POSITIONING THE UNIT

Locate the unit near the welding area and position it so there is adequate clearance all around for ventilation and maintenance.

(continued on following page)

ELECTRICAL SUPPLY


Ensure that there is a **208 or 230 volt, single phase, 40 amp** electrical supply within easy reach of the unit. The input cable supplied is 15 feet long. (optional lengths are available factory installed). Attach a suitable plug **making sure the green wire is attached to the ground terminal of the wall plug**. All wiring should be performed by a qualified electrician.

230V INPUT SELECTION

1. Factory selected no change is needed.

208V INPUT SELECTION

1. Remove the top cover.
2. Locate the contactor switch, which is mounted on top of the main power transformer (See Figure 5).

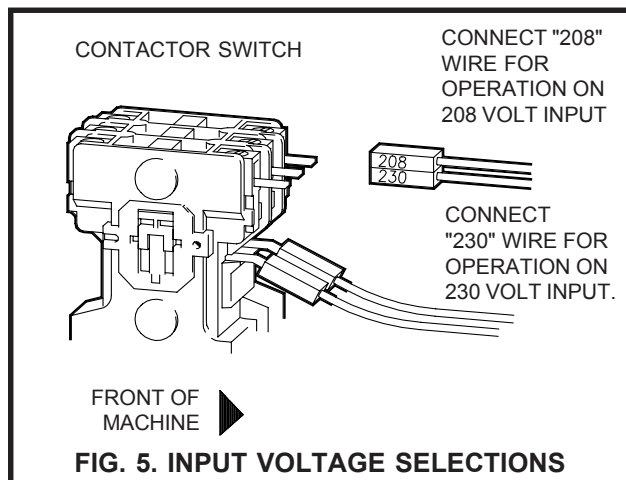

CAUTION

MAKE SURE POWER SOURCE IS UNPLUGGED BEFORE MAKING INPUT SELECTION CHANGE-OVER.

ELECTRICAL SUPPLY (Cont.)

3. Attached to the power source's contactor is one (2) two position plug which allows easy selection of input voltages of either 208 or 230 volts.
4. Remove the one (1) plug labeled 230V and connect the one (1) plug labeled 208V.
5. Reattach the top cover of the machine. Voltage input selection is now complete.

SHIELDING GAS CONNECTIONS

1. Place a cylinder of the appropriate shielding gas in the rack at the rear of the machine and secure it with the chain provided.
2. Rapidly open and close the cylinder valve. This will purge dust and foreign matter from the valve.


CAUTION

Take care to point the valve outlet away from yourself or other people, as escaping high pressure gas may be dangerous.

3. Attach the gas regulator/flow-meter supplied with this unit, to the cylinder valve using a suitable wrench.

NOTE

If this unit is to be used with 100% CO₂ shielding gas, an optional gas regulator coupler is required.

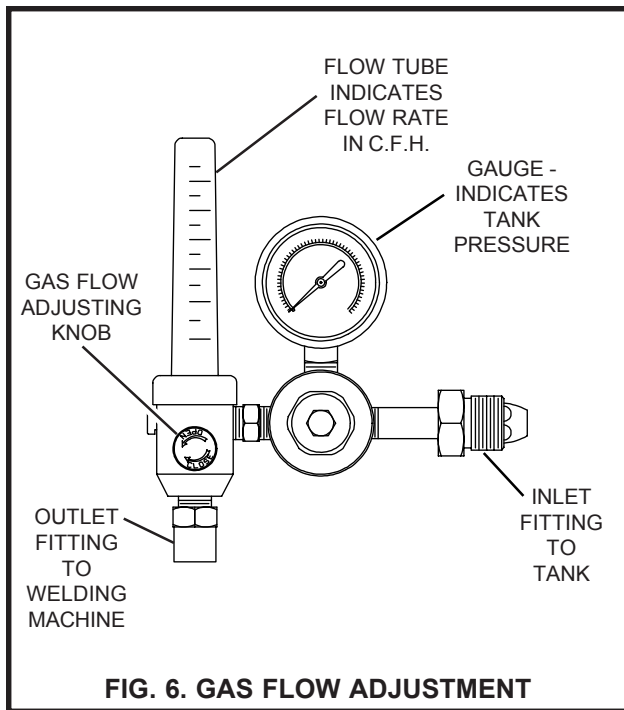


4. Fit the gas hose from the welding machine to the regulator outlet fitting and tighten it with a suitable wrench. Open the cylinder valve.
5. Check that the gas regulator is properly adjusted. When welding steel, the gas flow rate is 30 CFH. When welding aluminum, the gas flow rate is 40 CFH.

NOTE

The **MP175** must be turned "ON" and the MIG torch trigger depressed, before the gas flow rate can be adjusted.

TORCH CONNECTION

1. Open the access door of the machine to its fullest extent.
2. Back out the thumb screw located on the drive assembly mounting bracket inside the machine. Insert the MIG torch into the torch panel mount on the front panel and **TIGHTEN THE THUMB SCREW.**

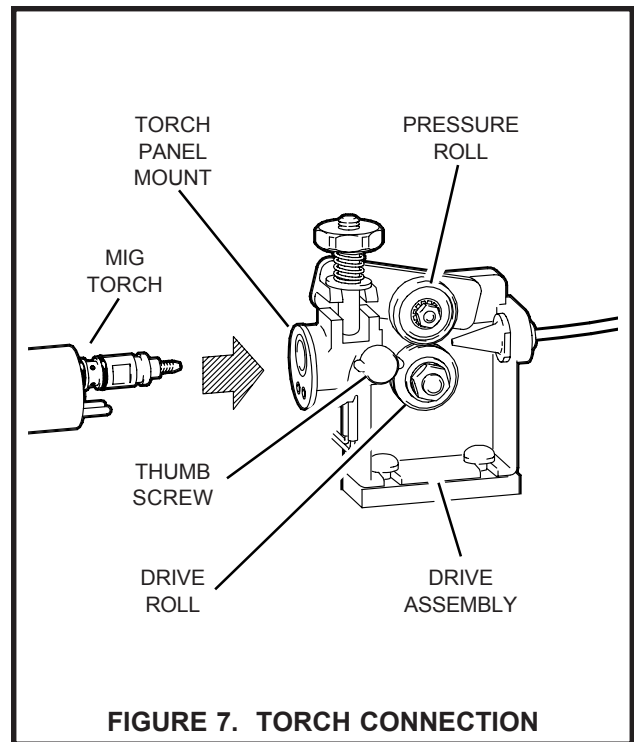

FITTING AND THREADING THE ELECTRODE WIRE - ALWAYS USE ER70S-6 WELDING WIRE

1. Remove the wire spool clip from the spool hub.
2. Unpack the spool of welding wire from its protective packaging.
3. Place the spool of ER70S-6 welding wire onto the hub. The wire is fed off the bottom of the spool.

CAUTION


Look for and remove any wire protruding from the center of the spool. The protruding wire is electrically **HOT** during welding and must not touch the machine.

4. Replace the spool clip on the hub.
5. Unlatch the pressure roll arm and swing it open.

(continued on following page)

FITTING AND THREADING THE ELECTRODE WIRE (Continued)

6. Make sure the double v-groove drive roll is installed to match the wire size. To change the wire size setting, remove the drive roll, turn it over and reinstall it on the shaft.

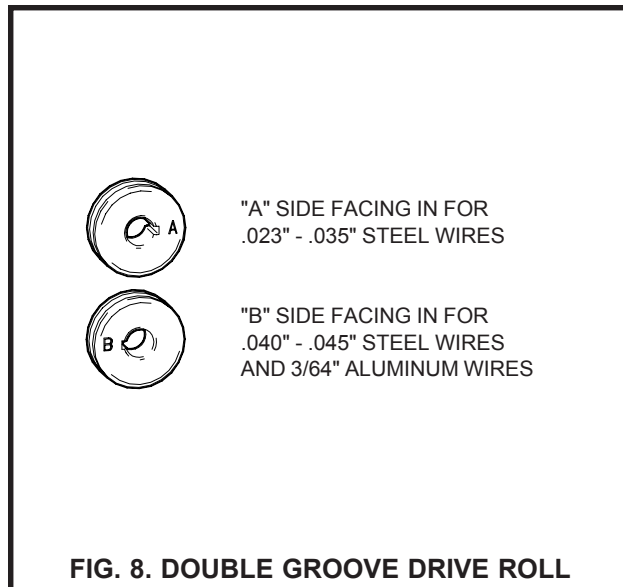


7. Release the wire from the spool and trim off the kinked end with wire cutters. The wire must be straight when it enters the inlet guide.
8. Thread the electrode wire through the inlet guide, over the feed roll and into the torch liner. Ensure that the wire locates in the feed roll groove. Do not allow the wire on the spool to loosen.
9. Close and relatch the pressure roll arm.
10. Stretch the torch cable straight out in front of the machine making sure there are no kinks. Remove the nozzle and contact tip from the torch.

11. Turn "ON" the circuit breaker on the front of the machine. The cooling fan will start and the "ON" indicator light will illuminate. Set the **VOLTAGE** control switch to "4", the function switch to "CONTINUOUS WELD" (**if the unit has the optional SSTP-2 installed**) and the **WIRE SPEED** control to "7". Pull the trigger on the MIG torch. The wire feed system will start and wire will be fed through the cable liner and torch. If the wire does not feed, or appears to slip, tighten the pressure roll arm adjusting nut. Feed the wire until it protrudes from the front of the torch approximately six inches.

CAUTION

Keep hands and face away from the front of the torch and do not allow the wire to contact ground. The wire is electrically HOT when the torch trigger is actuated.


12. Install the contact tip over the protruding wire and tighten it firmly using a proper size wrench. Make sure the tip is the correct size for the wire being used.
13. Install the nozzle on the torch. For steel, the contact tip should be flush or stick out up to 1/16 inch beyond the end of the nozzle. For aluminum, the contact tip should be recessed 1/8 to 1/4 inch inside the nozzle. Using wire cutters, trim off the wire so the stickout is approximately 1/4 inch for steel or 1 inch for aluminum. For aluminum, the end of the wire should be bent over so it does not JAM into the work. This is called a "scratch start".

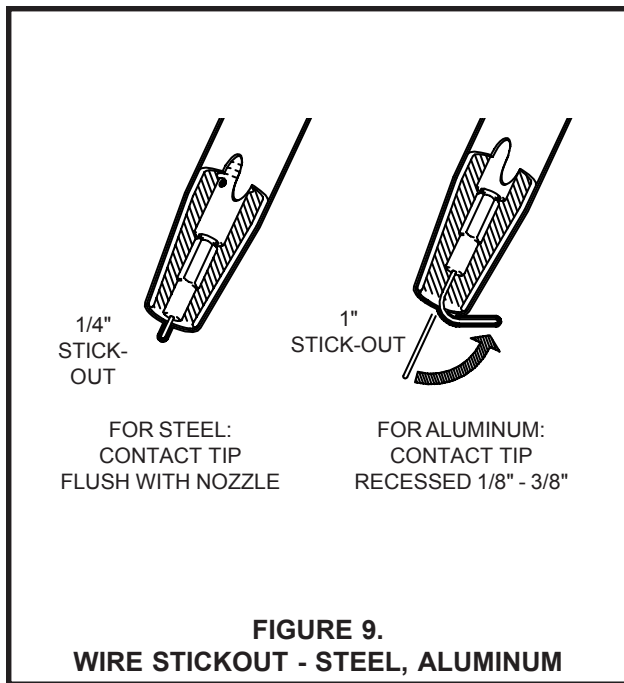

14. For steel welding only, spray anti-spatter compound inside the nozzle and on the outside of the contact tip. For aluminum or stainless steel welding, NO anti-spatter compound can be used as it will contaminate the weld.

WIRE FEED PRESSURE ROLL ADJUSTMENT

The wire feed pressure roll is adjusted to the proper setting at the factory, prior to delivery. It may be necessary to readjust the setting as components "seat in" or when changing to a different diameter wire. To check for proper roll pressure, hold the torch in one hand and the wire between two fingers of the other hand. Pull the torch trigger. If the wire continues to feed when firm pressure is applied to the wire, the pressure roll adjusting nut should be backed off until the feed rolls start to slip. If the wire will not feed with very little pressure applied, the pressure roll adjusting nut

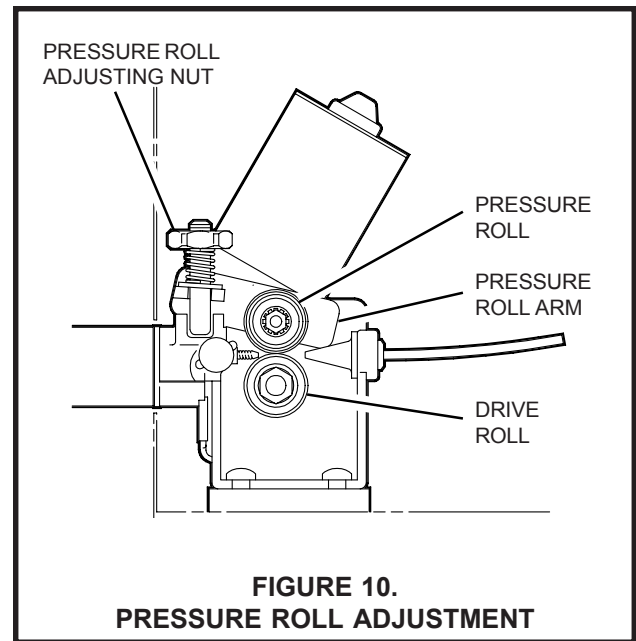

should be tightened.

TORCH SELECTOR CABLE

Plug the torch selector cable into the Positive (+) terminal on the machine (see "**Process Selection**" on page 8 for further details).

WORK (GROUND) CABLE

Uncoil the work cable and plug it into the negative (-) terminal on the machine.

OPERATION

The following operating instructions and detailed setup procedures enable an operator without previous experience to produce quality fusion welds. It is recommended that an operator without prior experience with this equipment, first practice on scrap metal of the same type and thickness as the material to be welded.

(continued on following page)

OPERATION (Cont.)

OPERATING SEQUENCE

1. Make sure that the pieces of metal to be welded are free of grease, dirt, paint and scale. Use a wire brush to remove paint and scale. Paint must be completely removed to bare metal. Grease and oil could burn and cause a fire or safety hazard. Failure to clean the metal properly will result in erratic and porous welds.
2. Install the unit as directed in the installation instructions and make sure the work clamp is firmly attached to a cleaned area on the workpiece to be welded.
3. Open the shielding gas cylinder valve. Press the torch trigger and listen for gas flow. Adjust the gas flow rate to 30 CFH for steel and 40 CFH for aluminum.

CAUTION

The welding wire will feed when the trigger is actuated. Take care that the wire is not directed to hit yourself or anything that is grounded to the ground wire on the welder.

PROCESS SELECTION

The following controls are located on the front of the machine.

A. VOLTAGE CONTROL

Six position switch adjusts welder output voltage.

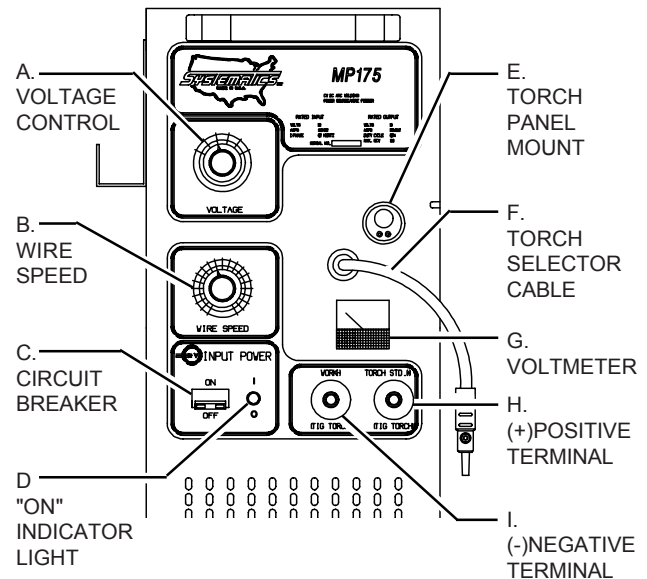


FIGURE 11. FRONT PANEL

B. WIRE SPEED

Potentiometer controls speed of wire drive motor to give wire speed of 50 to 500 inches per minute.

C. CIRCUIT BREAKER

Primary power switch and overload protection device.

D. "ON" INDICATOR LIGHT

Illuminates when the circuit breaker on the machine is "ON".

E. TORCH PANEL MOUNT

Combination power output, contactor switch connection, gas supply connection, and wire feed output in a single unit.

F. TORCH SELECTOR CABLE

Plugs into (+) positive terminal for standard welding operation or (-) negative terminal for straight polarity welding on very light sheet metal or for using flux cored gasless wire.

G. VOLTMETER

Indicates open circuit voltage when torch switch is actuated or arc voltage when welding.

H. +(POSITIVE) TERMINAL

Positive output terminal from the welder DC power source. The torch selector cable is plugged into this terminal for standard welding operation. The work cable can be plugged into this terminal for straight polarity welding on very light sheet metal or for using flux cored gasless wire.

I. -(NEGATIVE) TERMINAL

Negative output terminal. The work cable is plugged into this terminal during standard welding operation. The torch selector cable can be plugged into this terminal for straight polarity welding on very light sheet metal or for using flux cored gasless wire.

The following controls are located on the inside of the machine, in the wire feed compartment.

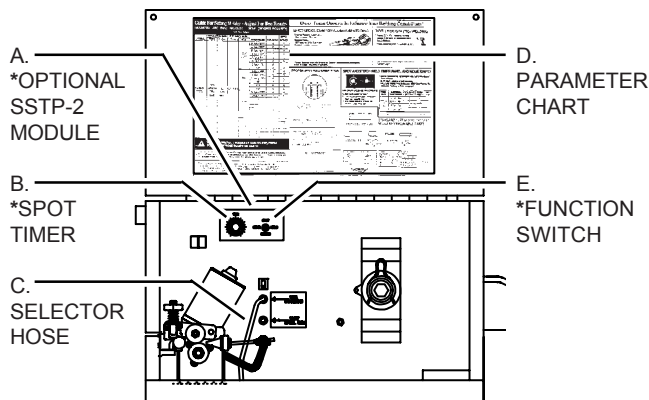


FIGURE 12. WIRE FEED COMPARTMENT

A. *OPTIONAL SSTP-2 MODULE

With the optional Spot/Stitch Module installed MIG Spot welding and Stitch welding can be performed.

B. *SPOT/STITCH TIMER

After the torch trigger is actuated, the timer allows the wire to feed and the gas and power to flow for the time selected. The Function Switch must be set in the "SPOT" position (or the "STITCH" position for stitch welding).

C. SELECTOR HOSE

Attaches to MIG position for Standard welding through the MIG torch assembly or to MHG7 position for Aluminum welding with the spool gun option.

D. PARAMETER CHART

This chart is a guide for basic setup parameters.

E. *FUNCTION SWITCH


Controls mode of operation of welding machine. "CONT. WELD" position is for normal, continuous welding operation. "SPOT" position puts the spot timer in the circuit for automatic MIG Consumable Spot Welding. "STITCH" position is used for stitch welding on very light material. When in "STITCH" position, the length of time the welder is "ON" and feeding wire is controlled by the Spot Timer. The lower the Spot Timer setting, the faster the welder cycles on and off.

WELDING

Optimum control settings will vary according to the thickness of the metal, the type of joint, operator preference, etc. Best results can be obtained through experience with the welding machine or by making trial welds. Select some sample material of the same type and thickness as the material to be welded. **Refer to the Parameter Chart located on the access door to the wire feed compartment.** Set the welding controls for optimum results using the sample material **thickness** and wire **size** being used as a starting point, weld until experience is gained using the unit.

CONTINUOUS WELDING ON STEEL


1. Trim the electrode wire to leave approximately 1/4 inch stickout beyond the end of the contact tip and install the welding nozzle. The contact tip should be flush or stick out up to 1/16 inch beyond the end of the nozzle.

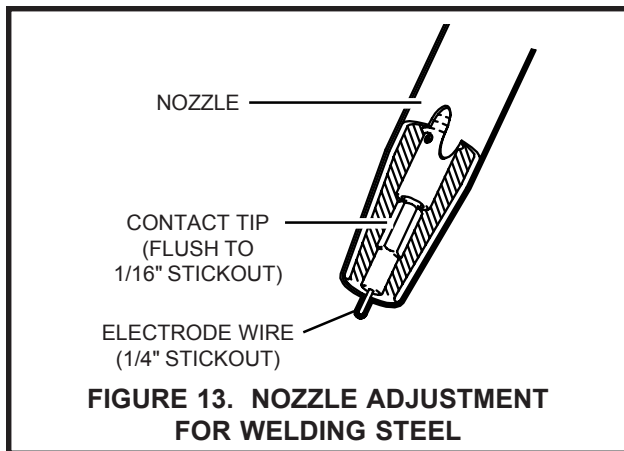

2. Spray the inside of the nozzle and the outside of the contact tip with anti-spatter spray.
3. Locate the torch over the joint to be welded with the contact tip approximately 3/8 inch from the work surface.

NOTE

When welding steel, the ideal position for holding the torch is inclined approximately 30 degrees towards the direction of travel. This allows the arc to be seen easily, resulting in greater control of the weld pool. Most right-handed weldors move from left to right. This method, known as fore-hand welding, provides a gas shield for the cooling weld puddle and helps in obtaining an oxidation free weld deposit.

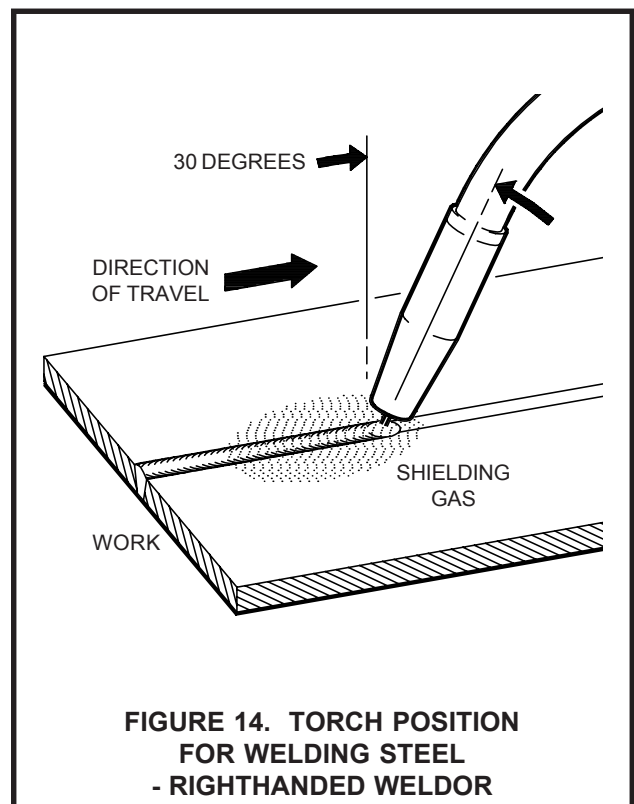


4. Use a welding helmet with a shade 9 to 11 filter lens, depending on operator preference.
5. Squeeze the torch trigger. The wire will feed and an arc will be established. As the weld is deposited, move the torch slowly along the weld seam at a constant speed, maintaining a constant arc length and a constant tip-to-work distance.


CONTINUOUS WELDING ON ALUMINUM

(Optional Nylon liner and 100% Argon
shielding gas are required)

1. Trim the electrode wire, leaving approximately 1 inch stick-out beyond the end of the nozzle. Bend the wire over as shown, to allow for a scratch start. The contact tip should be recessed inside the nozzle approximately $\frac{3}{8}$ inch. This helps prevent the welding wire from burning back to the contact tip.

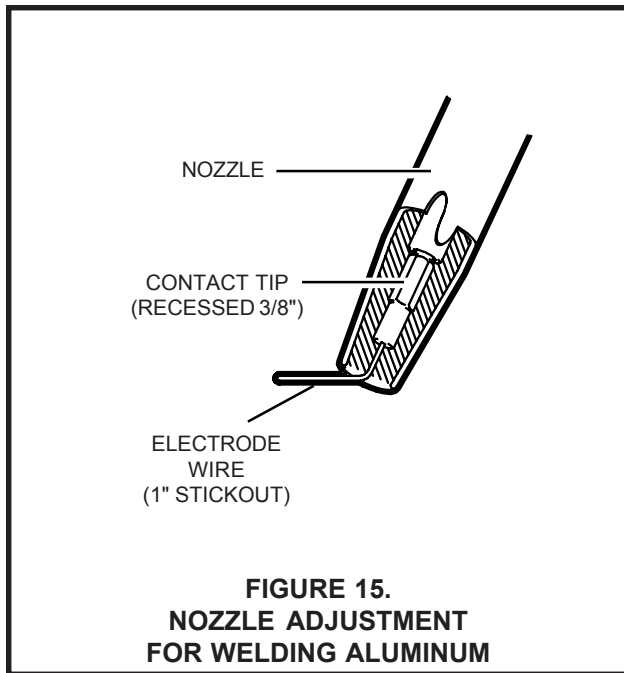

2. **DO NOT** spray any anti-spatter material on the torch or base metal and **DO NOT** attempt to lubricate the aluminum wire in any way. Weld contamination will occur unless the wire, base metal, torch and work area are kept clean.
3. Bring the torch nozzle to $\frac{1}{2}$ to $\frac{5}{8}$ inch from the workpiece. The recommended position of the torch and direction of travel for welding aluminum are shown in figure 16.

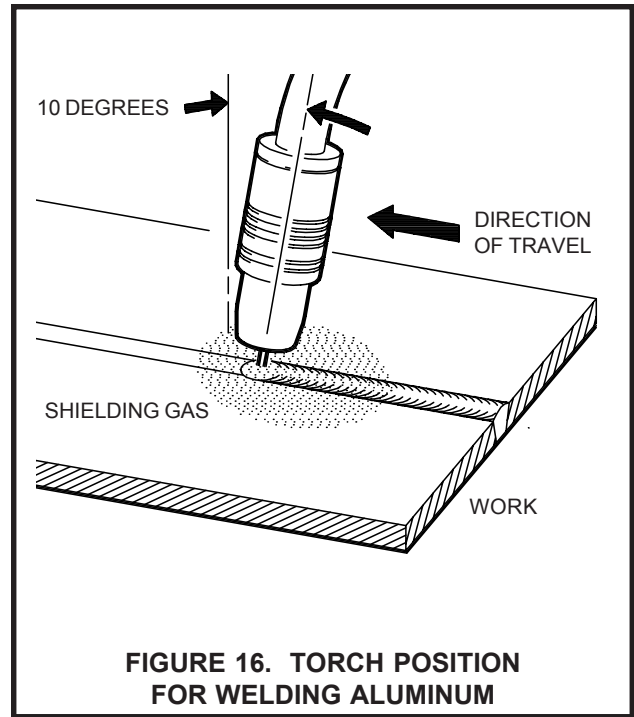

4. Follow steps 4 and 5 as in "Continuous Welding on Steel".

MIG SPOT WELDING ON STEEL (OPTIONAL)

NOTE


MIG Spot Welding is NOT recommended for aluminum.

1. Trim the electrode wire so the stickout from the contact tip will be flush with the nozzle face, and fit the spot nozzle in place.
2. Set the VOLTAGE control to "6", the WIRE SPEED control to "9", the Function Switch to "SPOT", and the TIME control to "2", then adjust the various controls to obtain a perfect weld. Refer to the Parameter Chart, located on the access door to the wire feed compartment, for basic setup recommendations.

(continued on following page)

MIG SPOT WELDING ON STEEL (Continued)

3. Locate the torch on the area to be welded and press the nozzle firmly against the work to hold the metals in place.
4. Guard the eyes against stray arc flash. A welder's helmet is not necessary when spot welding. However, **extreme caution** must be taken to avoid looking at the arc.
5. Actuate the torch trigger to start the weld sequence. When the timer switches off the weld current, release the trigger but maintain firm contact between the torch and work. Wait one second for the weld puddle to solidify, then move to the next spot position. If the wire freezes in the puddle, a quick squeeze of the torch trigger will melt it off.

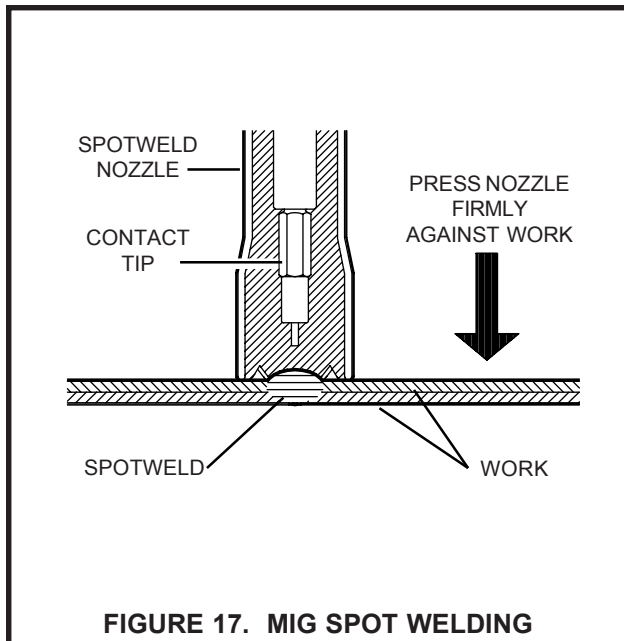


6. To ascertain a good spot weld, look at the back side of the welded material. A small melt-through of approximately 1/16 inch diameter is ideal.

STITCH WELDING ON STEEL (OPTIONAL)

NOTE

Stitch Welding is used for very light material.

1. Set Function Switch to "STITCH".
2. Adjust the TIME control to set the time the welder is "on" and feeding wire. The lower the setting, the shorter the "on" time and the faster the unit cycles on and off.
3. Weld using "**Continuous Welding**" torch position and direction of travel.

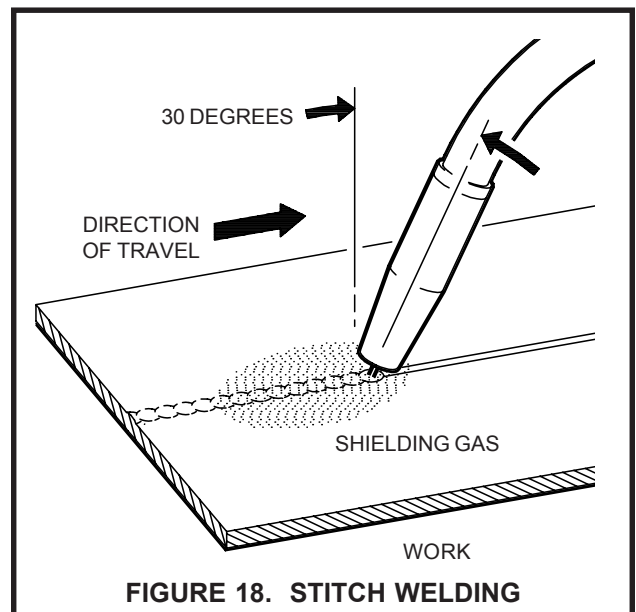

OPERATING HINTS

BURN BACK

In the event the welding wire burns back into the contact tip:

1. Remove the nozzle from the torch.
2. Unscrew the contact tip from the gas diffuser using a pair of pliers as the tip will be very hot.
3. Free the wire from the contact tip and clean the end of the tip so the new wire will slide smoothly through the hole. DO NOT use a drill or reamer to clean the hole as that will enlarge it and cause an erratic arc. Replace the contact tip if it is badly damaged.
4. Install the contact tip in the torch and tighten it firmly with an appropriate wrench.
5. Reinstall the torch nozzle.
6. If the wire continues to burn back, check for erratic wire feed, or speed up the wire by increasing the WIRE SPEED control setting or reducing the VOLTAGE control setting.

SPATTER

Before beginning to weld and periodically during welding, the torch nozzle must be removed and the spatter (small globules of melted metal) cleared from the inside of the nozzle and the outside of the contact tip and the gas diffuser. Spatter buildup between the contact tip and the nozzle can cause a short circuit and consequently, failure of the torch or welding machine. The frequent use of anti-spatter spray will help prevent the adherence of spatter to the torch components.

NOTE

DO NOT use any anti-spatter spray when welding aluminum or stainless steel.

Restricted gas flow, holding the torch too far from the work piece, and the use of CO2 gas rather than 75% Argon - 25% CO2 will increase the spatter levels.

MAINTENANCE

To ensure that this equipment maintains its operating efficiency, the following maintenance schedule and procedures are recommended. These routines should be performed regularly by the operator.

REGULARLY - Usage and shop conditions determine frequency.

1. Remove and clean the torch nozzle and contact tip. The use of anti-spatter spray will reduce the adherence of spatter and makes its removal easier.
2. Blow out the torch liner prior to the installation of each new spool of wire. The contact tip and gas diffuser must be removed, but it is not necessary to remove the liner.
3. If the torch cable assembly is bent severely, a kink may develop in the steel liner. This can cause wire feeding problems so a new liner should be installed.

(continued on following page)

MAINTENANCE (Cont.)

WEEKLY

1. Remove dirt and dust from the wire feed compartment. Use low pressure dry compressed air.
2. Remove dirt and metal deposits from the grooves in the feed roll. If the grooves are badly worn, the feed roll should be replaced. If the pressure roll does not turn freely, it should be replaced.
3. Check all gas fittings for leaks. Tighten or repair as required.

EVERY SIX MONTHS

1. Disconnect the welder from its main power supply.
2. Remove the machine's side panels.
3. Using low pressure dry compressed air, remove dust and dirt from all components.
4. Check for loose or frayed wiring. Particularly check welding current wire connections.
5. Replace the torch liner if necessary.

RECOMMENDED CUSTOMER SPARE PARTS

The Systematics **MP175** is a machine of proven design and reliability. Following is a list of consumable items recommended as spare parts for this unit.

contact tips..... M3-T30, etc.
gas nozzles..... M3T-N50
nozzle insulatorsM3T-B
gas diffusersM3T-D
steel liner(.020-.030) M103L-B
steel liner(.035-.045) M104L-N

In the event of the failure of any part of this equipment, contact your Systematics representative for replacement parts and service.

WARNING

DO NOT lift the unit when a gas cylinder is installed or attached.

DO NOT weld on any item that has a common electrical ground.

DO NOT operate the unit with the side panels removed. Overheating will occur.

DO NOT weld upon the case of the welding machine.

ONLY a qualified electrician should perform work inside the welding machine.

ALWAYS wear protective clothing, leather gloves and a full cover welding hood while welding.

DO NOT weld in a closed in area. Proper ventilation is a necessity, or a fresh air supplied hood should be worn.

WHEN welding near combustibles, a helper or "watcher" should stand by with a fire extinguisher or other fire protective device.

NEVER weld on a closed vessel or one that has contained combustibles.

IF IN DOUBT - DON'T DO IT!

BE SAFE - DON'T BE SORRY!

TROUBLE SHOOTING (SYMBOL*)
FOR TECH. SERVICE, CALL 1-610-696-9040

The Trouble Shooting Chart is a guide in identifying and correcting possible troubles which may occur when operating this equipment.

FAULT	POSSIBLE CAUSE	REMEDY
EQUIPMENT MALFUNCTION		
No main power, fan does not operate, "on" indicator light is off.	MP175 switch is "OFF". (CB1) Wall breaker is "tripped". "Open" circuit breaker on MP175. (CB1) Loose or broken connection in power input circuit.	Turn switch "on". Reset wall breaker. Reset or replace breaker. Tighten or repair connection.
Main power on, torch trigger activated, no response.	MIG torch unplugged. Faulty trigger switch. (S1) Fault in torch cable. Loose or broken connection on wiring harness. Wire feed motor unplugged. (RC1) Faulty control transformer. (T2) Loose spot timer (MP175S) circuit board. (PC2) Defective spot timer (MP175S) circuit board. (CR2)(PC2)	Plug in MIG torch. Replace micro switch. Check torch cable for continuity. Check or repair connections. Plug in motor. Check for 28VAC output. Install properly. Replace board.
Main power on, torch trigger activated, no wire feed but contactor operates & gas flows.	Pressure roll arm unlatched. "Slippage" at drive rolls. Wire path restricted. 5 amp mini breaker is tripped. (CB2) Wire feed circuit board needs calibrated. Defective wire feed circuit board. (PC1) Faulty wire feed motor or connection. (M) Faulty motor relay. (CR1) Loose or broken connection.	Latch arm & add tension. Increase drive roll tension. See page 7. Clean path or replace torch liner. Reset or replace breaker. Calibrate wire feed circuit board. See page 19. Replace circuit board. Repair or replace faulty item. Check motor on a 12VDC battery. Sand points or replace relay. Tighten or repair connection.

(SYMBOL*) - USE THIS IDENTIFIER, ALONG WITH THE SCHEMATIC DIAGRAM FOUND IN THE SERVICE MANUAL, FOR TROUBLE-SHOOTING PURPOSES.

TROUBLE SHOOTING (Cont.) (SYMBOL*)
FOR TECH. SERVICE, CALL 1-610-696-9040

FAULT	POSSIBLE CAUSE	REMEDY
EQUIPMENT MALFUNCTION (Cont.)		
Main power on, torch trigger activated, no welding current, but gas flows & wire feeds.	Loose torch thumb screw. Broken or loose connection. Unplugged or faulty power contactor switch. (W) 208/230 selector wire off. (W) "Opened" thermal switch. (TP1) Faulty diodes. (D1-D4)	Tighten thumb screw. Check cables for continuity. Repair or tighten connections. Plug in or replace switch. Reattach wire. Allow unit to cool, then retry. Check diodes. See page 18.
Torch trigger activated, no gas flow, but contactor operates & wire feeds.	No shielding gas - tank empty. Loose or broken connections. Faulty Gas solenoid valve. (GS) Clogged gas flow path. Loose spot timer (MP175S) circuit board. (PC2) Defective spot timer (MP175S) circuit board. (CR2)(PC2)	Replace tank. Tighten or repair connections. Repair or replace valve. Locate & clean clog. Install properly. Replace board.
FAULTY WELDS		
"Jerky" or "slipping" wire feed. just	Worn , kinked or dirty torch liner. Wire spool turns too hard. Worn double v-groove drive roll. Weak pressure roll spring. Worn or dirty contact tip. Worn inlet guide(s). Sticking pressure roll. Feed roll tension incorrect.	Clean or replace liner. Lub spool shaft. Read- spool drag. Replace drive roll. Replace spring. Replace contact tip. Clean or replace guides. Replace pressure roll. Adjust feed roll ten-

See page 7.

(continued on following page)

TROUBLE SHOOTING (Cont.) (SYMBOL*)
FOR TECH. SERVICE, CALL 1-610-696-9040

FAULT	POSSIBLE CAUSE	REMEDY
FAULTY WELDS (Cont.)		
"Birdnesting" (Wire wrapping around drive rolls)	Excessive feed roll tension. Poor alignment. Oversize contact tip.	Reduce tension. See page 7. Make sure wire is properly aligned across roller. Replace contact tip with correct size.
"Cold" weld puddle.	Incorrect machine settings. Incorrect shielding gas. Excessive wire stick-out. Poor connections. Faulty diode. (D1-D4)	Increase heat & wire speed. Replace with proper gas. Hold torch closer to work. Check and tighten all connections. Test diodes, replace faulty diode(s). See page 18.
Heavy spatter.	Incorrect machine settings. Incorrect shielding gas. Excessive wire stick-out.	Increase heat, decrease wire feed speed. Replace with proper gas. Hold torch closer to work.
Porous welds.	No shielding gas. Not enough gas flow. Contaminated wire. Faulty gas solenoid. (GS) Incorrect electrode wire. Contaminated base material.	Turn on gas. Check hoses for leaks, make sure cylinder is not empty. Increase flow rate. Change wire. Replace solenoid. Use correct wire. Clean or etch base material.

(SYMBOL*) - USE THIS IDENTIFIER, ALONG WITH THE SCHEMATIC DIAGRAM FOUND IN THE SERVICE MANUAL, FOR TROUBLE-SHOOTING PURPOSES.

TESTING AND REPLACING DIODES

Silicon diodes have proven to be highly reliable. However, weld spatter build-up in the torch can short out and cause diode overload and consequent failure. The following information is provided as a guide should a failure be suspected.

Silicon diodes exhibit two main fault conditions:

1. "Open Circuit" - causes a reduction in welder output.
2. "Short Circuit" - causes the circuit breaker to trip.


If a fault is suspected, the diode may be tested as follows:

1. Remove the top connection of each diode to be tested.
2. Using a Volt-Ohm Meter set on RX1K, check for continuity through the diode in both directions. If there is no continuity in either direction, the diode is in "open circuit" condition and must be replaced. If there is continuity in both directions, the diode is in "short circuit" condition and must be replaced. If there is continuity in one direction only, the diode is functioning properly.

3. If all the diodes check out satisfactorily with the Volt-Ohm Meter, a load check must be made. This is easily accomplished using a twelve volt battery and a twelve volt light bulb connected as shown. Again test for electrical current flow in both directions. The bulb should light in one (1) direction only - not both.

CAUTION

NEVER use a "megger" or a high voltage device to test a diode.

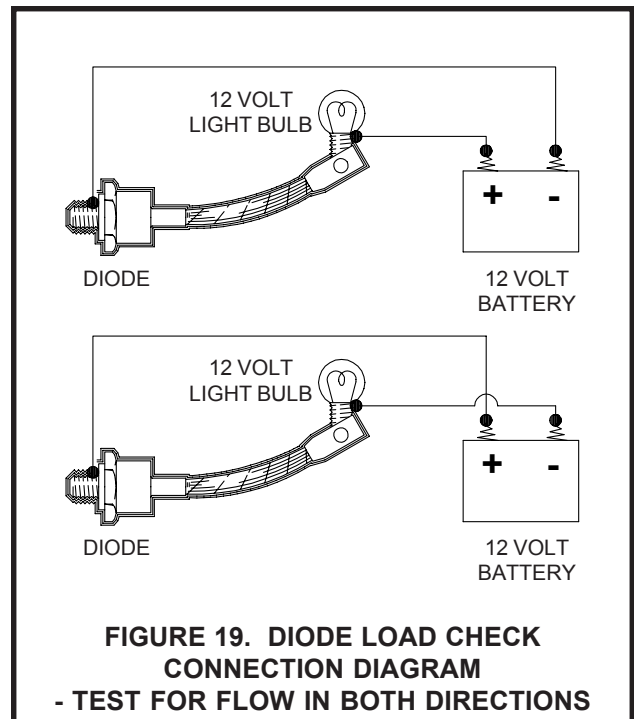

4. When replacing diodes, it is very important that a heat conductive compound (Radio Shack #276-1372) be used where the diode makes contact with the aluminum heat sink. Do not grease the threads on the diode.

WIRE FEED CALIBRATION


Due to **INPUT LINE VOLTAGE** variations supplied to the welding machine. The **WIRE FEED SPEED** should be checked for proper operation.

TO CHECK

- 1) Remove any tension on the drive roll.
- 2) Turn the wire speed dial (on the front of the machine) to "0".
- 3) Activate the torch trigger.
- 4) The bottom drive roll should rotate very slowly(non-jerky).
- 5) If this proves to be true, no adjustment is required.

IF ADJUSTMENT IS REQUIRED

- 1) Remove the top cover assembly from the unit.
- 2) Locate the printed circuit board(s).
- 3) Referring to Figure 20, locate the trim resistor, this is located in the upper right hand corner of the wire feed PC board.
- 4) Turn the wire speed dial (on the front of the machine) to "0".
- 5) Remove any tension on the drive roll.
- 6) Activate the torch trigger.

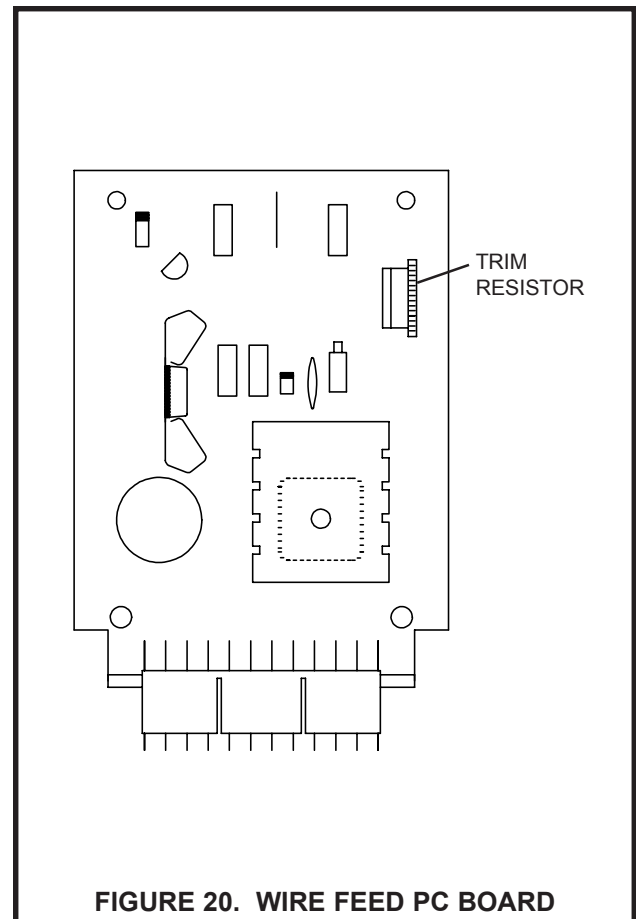

- 7) Rotate the trim resistor, back and forth, until the bottom drive roll moves.
- 8) Calibrate so the bottom drive roll rotates very slowly (non-jerky).
- 9) If calibrated correctly the wire speed dial (on the front of the machine) should affect the speed of the drive roll from "0" thru "10".
- 10) Adjustment is now complete!

CONNECTING TIGIT2 OR MHG7 SPOOL GUN

CHANGING FROM STANDARD MIG OPERATION TO TIGIT2 OPERATION

1. Unplug the wire feed motor plug from the function receptacle.
2. Unplug the torch selector cable and the work (ground) cable from the welder front panel.
3. Plug the TIGIT2 torch power cable into the negative (-) weld connector and plug the work (ground) cable into the positive (+) weld connector. This provides straight polarity current as required for TIG welding.
4. Plug the TIGIT2 torch switch cord into the welder function receptacle.
5. Attach the TIGIT2 torch gas hose directly to the gas regulator.

NOTE

Pure argon is the shielding gas to be used for TIG welding.

6. Follow the operating instructions in the TIGIT2 manual (Form WC5227).
7. To change back to MIG operation, reverse the procedure.

CHANGING FROM STANDARD MIG OPERATION TO MHG7 SPOOL GUN OPERATION

All current model MIG machines are equipped with bulkhead gas fittings for quick and easy changeover from standard MIG operation to spool gun operation.


1. Remove the thread cap from the "MHG7 SPOOL GUN" fitting.
2. Unscrew the selector hose from the "MIG STANDARD" fitting.

3. Move the selector hose to the "MHG7 SPOOL GUN" fitting and tighten.
4. Install the thread cap (removed in step 1) on the "MIG STANDARD" fitting to prevent dirt and contaminants from entering the unused gas line.
5. Unplug the wire feed motor plug from the function receptacle.
6. Plug the MHG7 spool gun control cable plug into the welder function receptacle.
7. Remove the torch selector cable from the welder positive (+) weld connector.
8. Plug the MHG7 gun cable fitting into the welder positive (+) weld connector.

NOTE

Make sure the gas regulator and welder gas hose are connected to a cylinder of the proper shielding gas - 100% argon for aluminum welding; 75% argon + 25% CO₂ for steel welding. 98% argon + 2% O₂ is recommended for stainless steel welding.

9. Follow the operating instructions in the MHG7 manual (Form WC5120).
10. To change back to standard MIG operation, reverse the procedure.

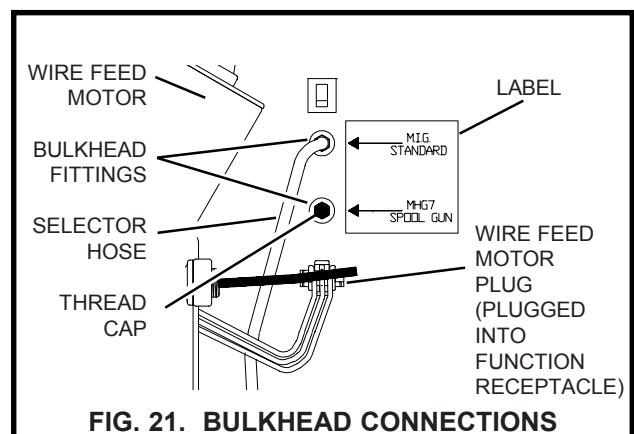

M.I.G. TORCH LINER INSTALLATION (steel only)

The MIG torch liner provided with the **MP175** is designed for wire diameters from .035 thru .045. If smaller wire diameters are to be fed and or there is a problem (i.e. clog, kink, etc.), a liner change is required.

Following is a step by step guide to aid in liner removal and installation.

NOTE

When removing the welding wire from the MIG torch, care should be taken to avoid the wire from uncoiling from the wire spool.

REMOVING OLD LINER

1. Remove torch assembly from the welding machine.
2. Place torch assembly on a flat surface, making sure torch is laying straight as possible.
3. Remove nozzle, bushing insulator, contact tip and gas diffuser from the front end of the torch assembly.
4. Loosen set screw located on the connector end of the torch assembly (see fig. 23).
5. Grip the liner and gas seal firmly, then pull. The liner should easily slide from the torch assembly.

INSTALLING NEW LINER

1. Remove the new liner from the package.
2. Uncoil liner and lay the liner parallel next to the MIG torch assembly.
3. Adjust the liner stickout length to 3/4" as shown in fig. 22.

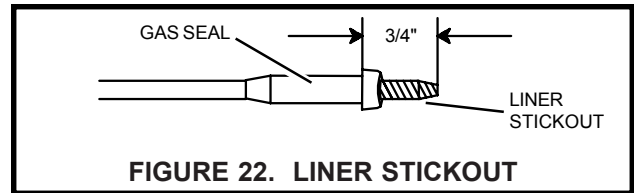


FIGURE 22. LINER STICKOUT

4. Install the new liner into the MIG torch assembly, until gas seal seats flush with the connector plug.
5. Tighten set screw. (Do not overtighten), refer to fig. 23.

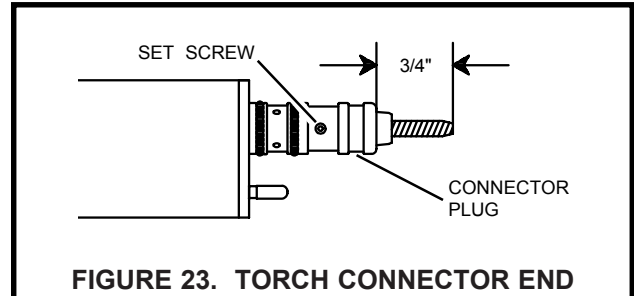


FIGURE 23. TORCH CONNECTOR END

6. Following the diagram in fig. 24, measure out 1 1/4"+ from the neck assembly and cut off the protruding liner.
7. Deburr the cutoff end of the liner to insure unobstructed wire feed.





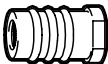
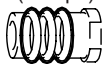


FIGURE 24. TORCH FRONT END

8. Install the gas diffuser and contact tip of proper wire size, tighten with a wrench.
9. Install the bushing insulator onto the gas diffuser. Spray the "O" rings with anti-spatter compound for lubrication.
10. Install the TWIST-ON adjustable nozzle and twist the nozzle during the installation. Turn to Page 6 for correct nozzle adjustment.

PARTS BREAKDOWN - 15 SERIES MIG TORCH

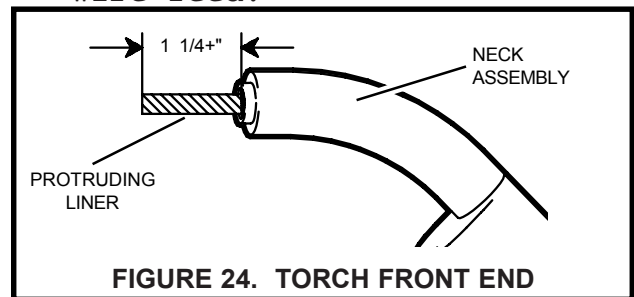





TG STYLE FRONT END - STANDARD

WIRE SIZE	CONTACT TIP	GAS DIFFUSER	NOZZLE	INSULATOR	INSULATOR O-RING
.020 - .025 inch .030 inch .035 inch .040 - .047 inch	M3-T25 M3-T30 M3-T35 M3-T45  (1-7/16" length)	M3T-D 	M3T-N50 (1/2" I.D.) 	M3T-B (includes o-rings) 	M3T-BR (3 reqd.) 

SPECIAL APPLICATION PARTS FOR TG STYLE FRONT END

SHORT CONTACT TIP (1-1/4" length) - For Spray Arc Welding		LARGER ORIFICE NOZZLE	SPOT WELDING NOZZLES	
WIRE SIZE	PART NUMBER		Standard Nozzle	Low Amp Nozzle
.020 - .025 inch	M3-ST25	Straight Nozzle (3/4" I.D.) M3T-N75	M3T-NS1	M3T-NLAS1
.030 inch	M3-ST30		M3T-NS2	M3T-NLAS2
.035 inch	M3-ST35		M3T-NS3	M3T-NLAS3
.040 - .047 inch	M3-ST45		M3T-NS4	M3T-NLAS4
			Irregular (grind to shape)	


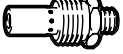
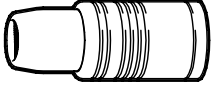

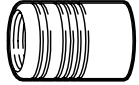

SG STYLE FRONT END - OPTIONAL

WIRE SIZE	CONTACT TIP	GAS DIFFUSER	NOZZLE ASSEMBLY	CUP	NOZZLE BODY	INS. BUSHING
.020 - .025 inch .030 inch .035 inch .040 - .047 inch	M3-T25 M3-T30 M3-T35 M3-T45  (1-7/16" length)	M3-D 	M3-NA50 	M3-C50 (1/2" I.D.) 	M3-NB 	M3-B 

SPECIAL APPLICATION PARTS FOR SG STYLE FRONT END

SHORT CONTACT TIP (1-1/4" length) - For Spray Arc Welding		LARGER ORIFICE CUP	EXTRA LENGTH FRONT END			SPOT WELDING FRONT END	
WIRE SIZE	PART NUMBER		1/2" Longer	1" Longer			
			PART NUMBER	PART NUMBER			PART NUMBER
.020 - .025 inch	M3-ST25	Flared Cup (5/8" I.D.) M3-C62	CUP (1/2" I.D.)	M3-C50L	M3-C50XL	INS. BUSHING	M3H-B
.030 inch	M3-ST30		CONTACT TIP			NOZZLE NUT	M3H-NN
.035 inch	M3-ST35		.020 - .025 inch	M5-T25	M5-LT25	SPOT NOZZLE	
.040 - .047 inch	M3-ST45		.030 inch	M5-T30	M5-LT30	Flat Spot	M3H-NS1
			.035 inch	M5-T35	M5-LT35	Inside Corner	M3H-NS2
			.040 - .047 inch	M5-T45	M5-LT45	Outside Corner	M3H-NS3
						Irregular	M3H-NS4

XG STYLE FRONT END - OPTIONAL - RECOMMENDED FOR ALUMINUM WELDING

WIRE SIZE	CONTACT TIP	GAS DIFFUSER	NOZZLE ASSEMBLY	CUP	NOZZLE BODY	INS. BUSHING
.035 inch .040 - .047 inch	M5-T35 M5-T45  (1-15/16" length)	M35-D 	M35-NA62 	M5-C62 (5/8" I.D.) 	M5-NB 	M5-B 

SPECIAL APPLICATION PARTS FOR XG STYLE FRONT END

LARGER ORIFICE CUP: Straight Cup (3/4" I.D.) M5-C75

SPECIAL FRONT END FOR GASLESS WIRES - OPTIONAL

INSULATED CONTACT TIP (Tip screw directly into torch neck - no gas diffuser is required) (1-15/16" length)

WIRE SIZE	PART NUMBER
.040 - .047 inch	M5HGL-045

LINERS & SEALS - FOR STEEL WELDING

WIRE SIZE	TORCH LENGTH	ORDER NUMBER	
		LINER W/SEAL	SEAL ONLY
.020-.030 inch	10 feet	M103L-B	M3LS-B (Blue)
.035-.045 inch	10 feet	M104L-N	M4LS-N (Natural)
	12 feet	M124L-N	

LINERS & SEALS - FOR ALUMINUM WELDING

WIRE SIZE	TORCH LENGTH	ORDER NUMBER		
		LINER W/SEAL	SEAL ONLY	HEATSHIELD ONLY
.035 inch	10 feet	M103AL	M3-6ALS	M3-THS
3/64 inch	10 feet	M104AL	M3-6ALS	M3-THS

PARTS BREAKDOWN - 15 SERIES MIG TORCH (Cont.)

PART NO. DESCRIPTION (SYMBOL)

TORCH NECK GROUP

M3-101B..... TORCH NECK *
M3-112 NECK INSULATOR
M3-119 LOCK SCREW - SWITCH HOUSING
M3-120 FERRULE *

M3-200B..... SWITCH ASSEMBLY
CONSISTING OF:


M3-201B..... SWITCH HOUSING
M3-202 SWITCH (S1)
M3-203 SWITCH SCREW (2 REQUIRED)
M3-211 TRIGGER - WITH ADJUSTING SCREW
M3-212 TRIGGER ADJUSTING SCREW (ONLY)
M3-213 TRIGGER PIN
M3-214 TRIGGER SPRING

QUICK CONNECTOR GROUP

M3-120 FERRULE *
M3-301A CONNECTOR HOUSING
M3-305A CONNECTOR STEM *
M3-306 CONNECTOR PLUG
- WITH SETSCREW & O-RINGS
M3-307 SETSCREW (ONLY)
M3-308 O-RING (ONLY) (2 REQUIRED)
M3-309 TERMINAL - CONNECTOR CONTACT
(2 REQUIRED)
M3-310A BOOT / CABLE SUPPORT

M1-401 HANDLE
M3-402 HANDLE SCREW (2 REQUIRED)
M3-405 TERMINAL - TORCH END
(2 REQUIRED)
M3-406 TERMINAL - CONNECTOR END
(2 REQUIRED)
M3-407 HANGING BRACKET (OPTIONAL)

M1510CBL... 10 FOOT CABLE *
M1512CBL... 12 FOOT CABLE *

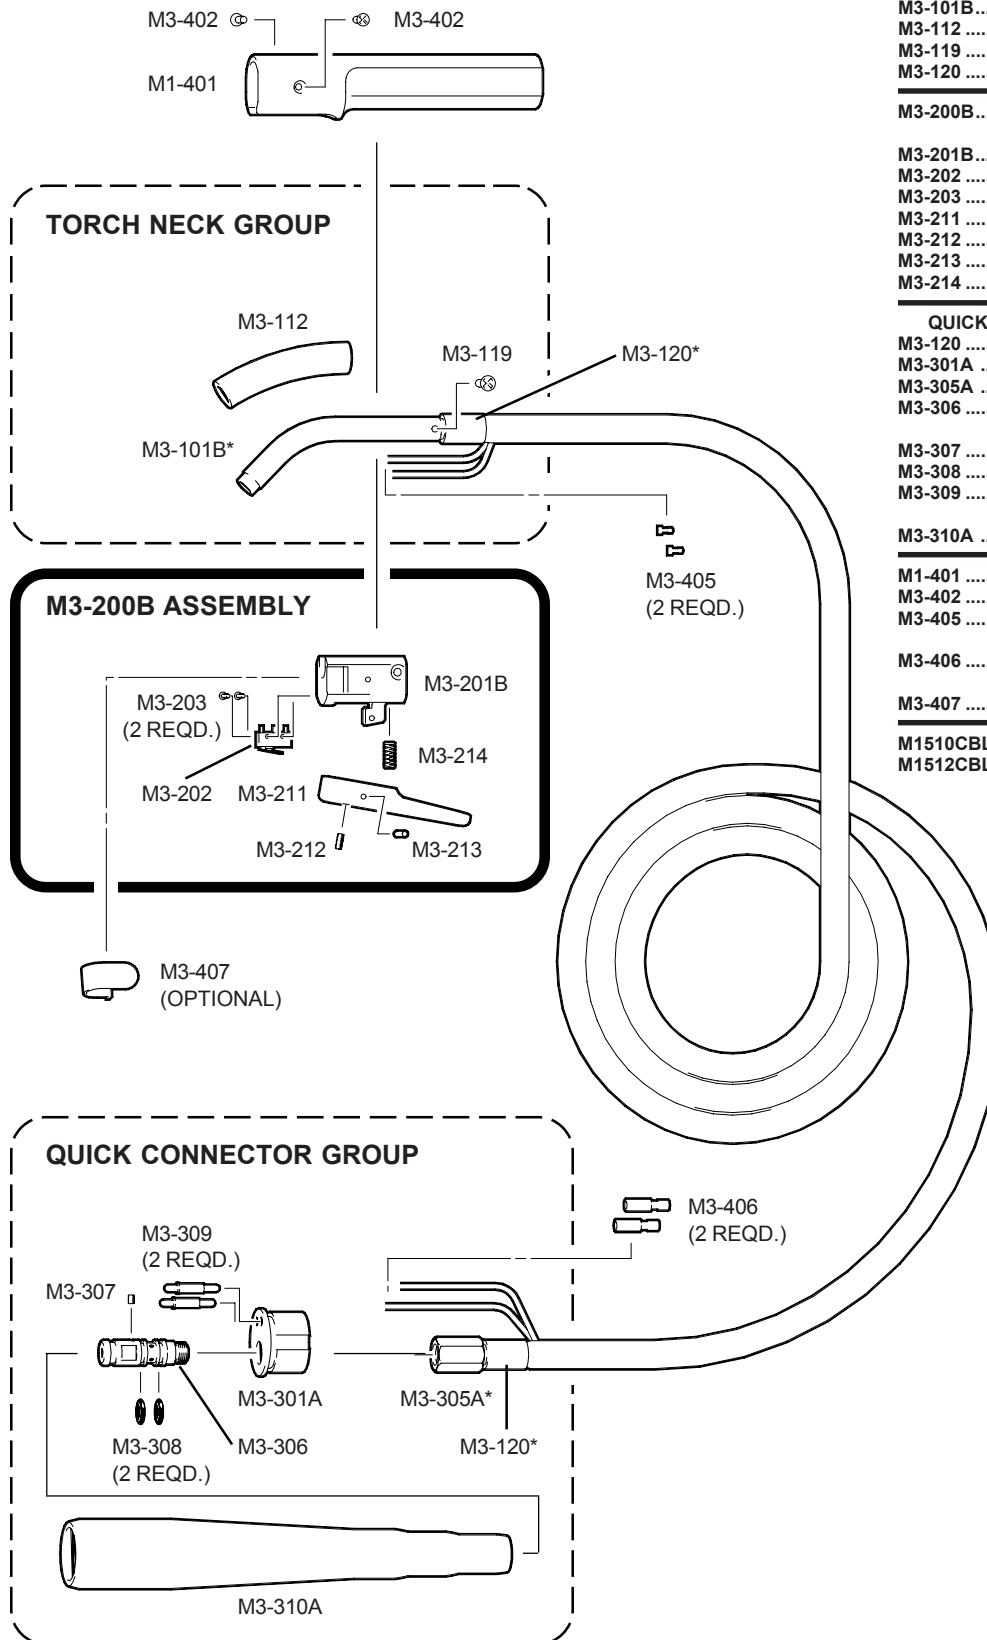

NOTES:

* BECAUSE SPECIAL TOOLS AND PROCEDURES ARE REQUIRED TO PROPERLY INSTALL THE CABLE ON THE TORCH NECK AND THE CONNECTOR STEM, ITEMS WITH THE ASTERICK ARE AVAILABLE FACTORY INSTALLED ONLY.

TORCH REBUILD PROGRAM

15 SERIES TORCHES CAN BE REBUILT BY THE FACTORY FOR A NOMINAL LABOR + PARTS CHARGE.

OPTIONS

NOW! TIG WELD WITH YOUR SYSTEMATICS MIG WELDING MACHINE (MP140, MP175 & MP250)


The TIG Welding Process is used to produce the highest quality, porosity-free welds. The TIGIT2 adds TIG Welding capabilities to your Systematics MIG Welder.

The TIGIT2 is designed for Tungsten-Inert Gas (TIG) welding with Direct Current, Straight Polarity (DCSP) on steel, stainless steel, chrome-moly, copper or cast iron (12 Gauge (.105") minimum plate thickness).

THE TIGIT2 WILL NOT WELD ALUMINUM.

The TIGIT2 consists of a 200 amp, gas cooled TIG torch with built-in gas control valve and remote on-off switch, 12-1/2 or 25 foot cable assembly and accessories required for putting the unit into service.

TIGIT2

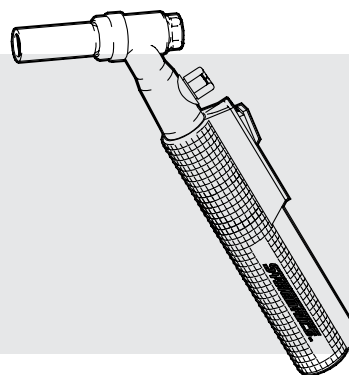

SPECIFICATIONS

Part Number.....	TIGIT2-12 (12-1/2' cable) TIGIT2-25 (25' cable)
Torch Rating	200 Amps, DCSP
Duty Cycle	100% (reduce duty cycle when operating over 200 amps.)
Cooling Method	Gas
Shielding Gas Control Method.....	Gas Valve on Torch
Welding Current On-Off Control	Locking Switch on Torch

CONTENTS OF TIGIT2

1 each	TIG Torch with built-in valve
1 each	Locking Electric Switch with 14 foot cord (installed on torch)
1 each	12-1/2 foot Power Cable with Connector (installed on torch)
1 each	15 foot Gas Hose with fitting (installed on torch)
3 each	3C332 Collet - for 3/32" tungsten
3 each	3C418 Collet - for 1/8" tungsten
2 each	3CB332 Collet Body - for 3/32" tungsten
2 each	3CB418 Collet Body - for 1/8" tungsten
2 each	3A6 Gas Cup - 3/8" orifice
6 each	3A7 Gas Cup - 7/16" orifice
2 each	3A8 Gas Cup - 1/2" orifice
1 each	300L Long Backcap
3 each	3/32" X 3" Tungsten Electrode
3 each	1/8" X 3" Tungsten Electrode

MHG7

ONE POUND SPOOL GUN FOR ALUMINUM MIG WELDING WITH SYSTEMATICS MIG COMBINATION UNITS (MP140, MP175 & MP250)


The MHG7 (Motorized Hand Gun System) is a compact, light-in-weight, easy to operate MIG welding system designed for aluminum welding. It will feed .030", .035" or 3/64" diameter wire from 4 inch spools. The standard cable is 25 feet in length. 35 foot and 50 foot cables are optional. The wire speed control knob is in the gun handle.

With the following options, the MHG7 can be used to weld steel or stainless steel (.030" - .035" diameter wire sizes).

HG-160K	Knurled Drive Roll - for .030" - .035" steel wire
M5-T30	Contact Tip - for .030" steel wire
or M5-T35	Contact Tip - for .035" steel wire

SPECIFICATIONS

Part Number	MHG7
Gun Rating	200 Amps @ 100% duty cycle 250 Amps @ 60% duty cycle
Wire Feed Speed Range.....	50 to 650 inches per minute
Cooling Method	Air (gas)

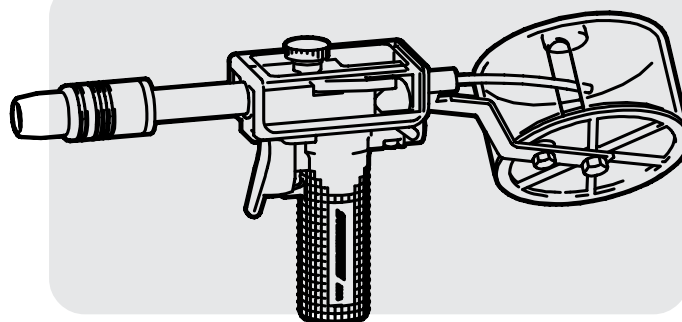

MHG7 SYSTEM COMPONENTS

1 each	MHG-7 Spool Gun
1 each	HGC5-25 Hand Gun Cable Assembly with fittings - 25 foot length
7 (total)	MG-T series Contact Tip (1 installed in gun) 2 - .030 (MG-T30) 3 - .035 (MG-T35) 2 - 3/64 (MG-T364)
1 each	M35-NA62 Nozzle Assembly (installed on gun)
1 each	M35-D Gas Diffuser (installed on gun)

NOTES

