CDI CRYSTAL TOUCH 18.0

USER MANUAL



USER MANUAL



18.06.2018

© Copyright 2018

Esko-Graphics Imaging GmbH, 25524 Itzehoe, Germany

All rights reserved. This document and all information and instructions contained within are the property of Esko-Graphics. These documents contain the product descriptions according to their current state at the time of publication, but no responsibility whatsoever is taken for the correctness of this information. No guarantees are granted or expanded upon by this document. Furthermore, Esko-Graphics does not guarantee the illustrations relating to the usage of the products, or for the results from using the software or the use of the information contained herein. Esko-Graphics is not responsible for direct or indirect damages caused by the logical consequences or latent damages which may result from the use of the software, or from the impossibility of software use or of the information contained herein.

The technical data contained herein and the content of this manual are subject to change without prior notification. Revisions which point out such changes and/or supplements may be issued from time to time.

Without express written consent, no part of this document may be reproduced, transferred, electronically stored or published, irrespective of the reasons and irrespective of the method or means used, i.e. electronic, mechanical, by printing, microfilm, etc.

These documents replace all previous versions.

Grapholas® is a registered trademark of Esko-Graphics Imaging GmbH.

Cyrel®, Cyrel® Digital Imaging System and Cyrel® Digital Imager (CDI) are registered trademarks of DuPont.

Microsoft and the Microsoft Logo are registered trademarks of Microsoft Corporation in the USA and other countries.

Esko-Graphics software may include the "RSA Data Security, Inc. MD5 Message-Digest Algorithm".

JDF and the JDF Logo are trademarks of the CIP4-Organisation. Copyright 2001 The International Cooperation for the Integration of Processes in Prepress, Press and Postpress (CIP4). All rights reserved.

Java and all Java-based trademarks and logos are trademarks or registered trademarks of Sun Microsystems in the U.S. and/or other countries.

Some parts of this software use technologies of JGoodies, Barbecue (Copyright 2003, International Barcode Consortium), and Jakarta (licensed by Apache: www.apache.org/licenses/LICENSE-2.0.txt).

All other product names are trademarks or registered trademarks of their respective owners.

TABLE OF CONTENTS

Introduction	
The user interface	
Machine status display	6
Options	6
CHANGING BASIC SETTINGS	
Adjusting the date and time	8
Focus Search	9
Advanced settings	
Evaluation of the regular focus search	
Evaluating the Pixel-Boost focus search	
Adjusting the Pixel-Boost parameters	12

Introduction


"CDI Crystal Touch" is a new user interface for touch-sensitive screens. The user interface is intentionally kept simple.

This software is used to start jobs. Furthermore, simple tasks such as focus search and the "Step-Test" for Pixel+ exposure can be performed.

The queuing of new jobs and the changing of plate parameters are performed from a PlatePrep or a Digital Flexo Suite or the Device Manager.

The user interface

The software starts in the "Expose" view. Here, one can find the exposure jobs and the operating elements used to start a job and to position the laser:

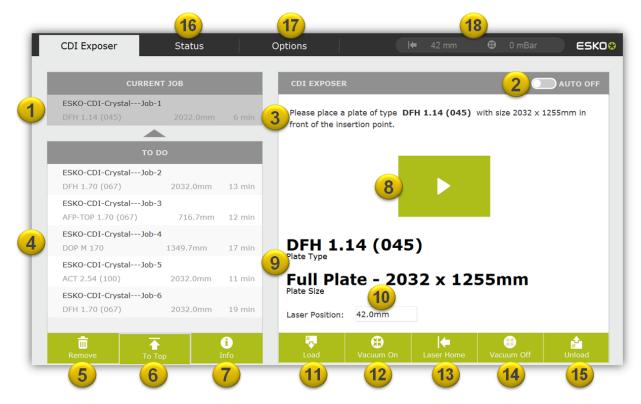

"Current Job" (1) is the current job. Instructions on which plate to install are shown in the "CDI Exposer" (3). The subsequent jobs are listed under "To Do" (4).

Switching from "AUTO OFF" to "AUTO ON" (2) automatically draws in the Flexo plate, exposes it and moves it back onto the loading table. The manual controls are hidden. The "Laser Start" position (36) must be set in the properties "Preferences" (28).

Once a job is selected by tapping it, it can be deleted (5) or moved up (6). A summary of the job can be opened by using the I-button (7).

Jobs are started by using the Start button (8). All information about the Flexo plate is displayed under 9. If required, the start position (10) can be modified.

The Home button (13) drives the laser to a previously specified position. This can be changed in Options (17). The vacuum is switched on and off with the "Vacuum ON" (12) and "Vacuum Off" (14) buttons.


A plate is automatically loaded and unloaded with "Load" (11) and "Unload" (15).

The position and current vacuum (18) are displayed in the top status bar.

"Status" (16) will open a new window which shows the machine status.

In Options (17), the basic settings of the machine can be changed and focus search and the Step-Test for Pixel+ settings can be started. Furthermore, the Esko-Teamviewer can be started here, if required.


The "CDI Exposer" display will switch to a progress indicator after start-up (8):

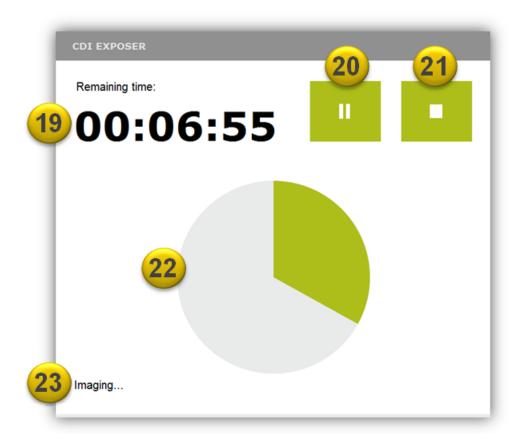


The remaining time (19) is displayed, along with a graphical representation of the progress (22). The exposure can be paused with 20 or stopped with 21. The executed action (23) is displayed at the bottom left, e.g. load - expose or unload.

Machine status display

The machine status is shown under "Status". In the event of an error, this display will blink in red. Once the error (24) has been corrected, it must be reset by using "Refresh" (25).

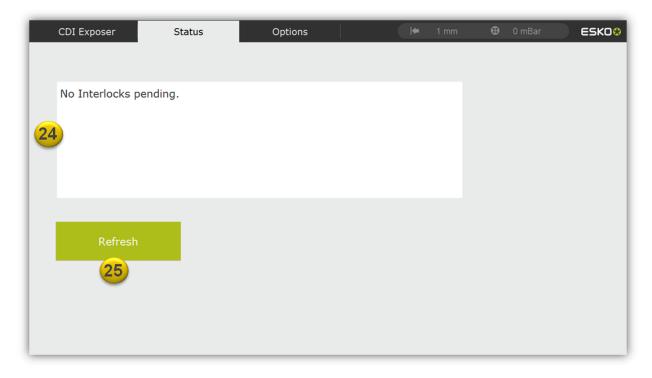

Options

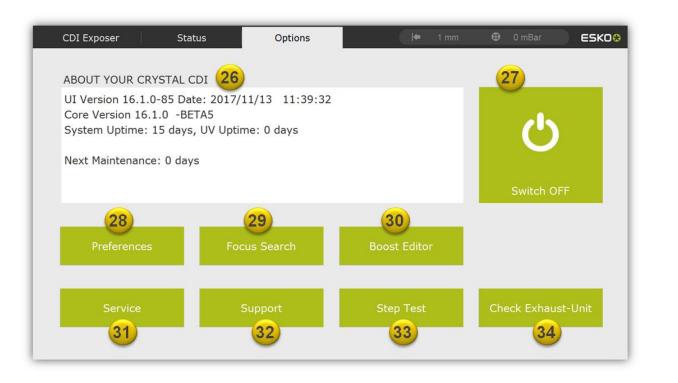

In Options, "About your ..." (26) shows information such as software version and upcoming maintenance times.

Before shutting down the CDI, the software should be closed and the operating system shut down (27).

"Preferences" (28) opens a new window in which the language, the "Home" position and the units can be set.

"Focus Search" (29) starts the function of the same name. Using the "Boost Editor" (30), Pixel+ parameters can be set for various plate types and plate families. The "Service" window (31) is password-protected as its use is reserved for Esko Service personnel.

In the event of issues, the Esko service will request the Teamviewer credentials. These can be found by using the "Support" button (26). The CDI must have Internet access to do so.

The "Step Test" (33) will generate a test job from the topmost job in order to be able to determine the Pixel+ parameters. The topmost job must have been sent with Pixel+. The plate is measured using a densitometer and the desired Pixel Boost value is entered with the "Boost Editor" (30).

The exhaust system can be tested with the "Check Exhaust-Unit" button (34).

Changing basic settings

The basic settings of the UV exposer are adjusted in the "Preferences" window (28).

CDI Expe	oser	Status	Options		I#	0 mm 🧲	0 mBar	ESK0 8
3	Preferences	5						
	General				Laser Position I	Manual Exposur	e	
	Language:	35)	English	~	Park Position:	38	1.0mm	
	Units:		mm	~		Par	k automatically	
	Date and Time:	06/05/18 16:0	Set 36 time in info bar					
	Pixel Boost Ste	p Test			Laser Position /	Automatic Expo	sure	
	Start Value:		100.0		Start Position:	39	1.0mm	
	Step Value:	37	10.0					
	Tracks:		10					

You can select the display language using "Language" (35). This is only available after the machine has been restarted.

You can switch between "mm" and "inch" using the "Unit" point (35).

Under "Date and Time", you can adjust the date and time of the operating system using "Set" (36). If you want the time to be constantly displayed, you should activate the "Show time in info bar" option (36).

"Step Test" (37) is used to adjust the values for the Pixel Boost Step-Test.

The automatic return to the *"Park"* position at the end of an exposure is activated by using the "Park automatically" function (38). The position can be adjusted in the "Park Position" field (38).

A start position is required for automatic start-up. This is adjusted in the "Start Position" field (39). It should be adjusted so that the imaging starts approx. 5mm after the plate edge.

Adjusting the date and time

In the "Preferences" window (28) you can adjust the date and time of the operating system using "Set" (36).

CDI Expo	ser Status	Options)# 0.mm 🤁 0.mBar ESKO	•
0	Set Clock			
	Day 5 40	Month 6	Vear 2018 40	
	Hour 16 (40)	Minute 27	(41) ✓ 24 Hours	
			42 Save	

The values can be changed using the arrow keys (40). The "24 Hours" option (41) is activated for 24-hour format. The settings are saved using "Save" (42).

Focus Search

The "Focus Search" button (29) opens a new window, in which the parameters and plate type of the focus search are selected:

CDI Exposer Sta	atus Options	l∳• 1 mm 🤁	0 mBar ESKO 🛠
Focus Search			
Plate:		Thickness: 1.7mm	
Test Strip Type:			
Position:	1.0mm 46 20.0mm 47 - Advanced Settings		ок

The plate type is shown behind "*Plate*:" (43). Pushing "*Plate*" (43) will show the available plate types, from which one is then selected.

For partial plates, the "Partial Plate" option (44) must be activated, as these require that the RPMs be limited and the vacuum of the drum won't be monitored.

The type of focus search is selected with "*Test Stripe Type*" (45). The left selection uses the regular focus search, in which lines are exposed. The thinnest line represents the focus. The right-hand selection will expose seven test strips with Pixel Boost. The field with the lowest density has the best focus.

"Position:" is where the start position of the laser (46) and the circumferential position of the plate (47) are shown. The values can be changed by tapping these fields.

"Advanced Settings" (48) will open another window, offering even more parameters for the focus search which can be adjusted.

"OK" (49) creates a new "Focus search" job at the top of the job list.

Advanced settings

If "Advanced Settings" (48) has been tapped, a new window with various focus search parameters will be shown:

CDI Expos	er St	atus	Options		l 4 1 mm	🔁 0 mBar	ESK00
0	Check Laser	[.] Focus - Adv	anced Optior	ıs			
	Plate:	DFH 1.70 (067)	50 Drui	m:	V5080EC3		
	Thickness:	1.7mm		umference:	1289.94mm		
	Test Strip Options	i.	Exp	oser Options	52		
	Dimensions: 🎓	40.0mm	51) Foc	us Offset:	0.0mm		
	+	0.05mm		us Advance:	0.1mm		
			Spe	ed:	500.0 RPM		
			Las	er Power:	5.0 W	ОК	

The currently selected plate and drum are shown at the top (50).

With regular focus search, the lines found under "*Dimensions*" (51) can be used to adjust the height and the distance between the lines.

The start value of the focus search can be adjusted in the *"Exposer Options"* (52) under *"Focus Offset:"*. For each exposed line the focus will be changed. The focus distance between each line can be modified under *"Focus Advance:"*.

"Speed" changes the speed of the exposure. It must be noted that for partial plates, this speed value must not exceed the permissible partial plate speed. Excessive RPMs will cause errors.

The output power of the laser is adjusted under "Laser Power". Normally, these values won't have to be adjusted.

Evaluation of the regular focus search

In the regular focus search, lines with different foci are being exposed. Once exposure has concluded, a new window will open showing the best focus:

CDI Expos	er	Status	Options	H.	1 mm	🤁 0 mBar	€ЅКО⊗
3	Check L	aser Focus - 1	Inspect the Test S	Strip			
	strong sma	ll flashlight and a go table. Use the arro	ou can inspect the imaged od microscope or you can w buttons to select the be	inspect the test strip			
	1 2	3 4 5 6 7 8	9 10 11 12 13 14 15	16 17 18 19 20			
I	54	⊕ 55	€ 5 6	•	57	Finish	

The thinnest line on the plate is not always the one being selected (53).

ATTENTION: Some microscopes show a mirrored image!

The plate can be taken off the drum for evaluation (51). The vacuum is switched on and off by using the Vacuum buttons (55).

The black line below the numbers (53) indicates the current selection. It can be changed by using the left-right buttons (56), in order to select the thinnest line.

Line number 10 is the current focus!

"Finish" (57) ends the selection process and the focus is saved.

Evaluating the Pixel-Boost focus search

The Pixel-Boost focus search exposes seven test fields:

CDI Exposer	Status	Options		1 mm (🔁 0 mBar	ESK0 😵
Che	ck Laser Focus -]	Inspect the Test S	Strip			
The tr light t buttor	est strip is imaged now. Y cable. Select the patch wh n.	ou can remove and inspe- ich has the lowest dens i	ct the test strip on the i ty and tap the Finish			
	1 2 3	4 5	6 7			
					Finish	
59		61		62		

To identify the focus, the plate is taken off the drum (59). The vacuum is switched on and off by using the buttons (60). The fields are measures using a densitometer.

The field with the lowest density is selected on the display (61) using the left-right buttons (58) and the new focus is saved using "*Finish*" (62).

Field number 4 is the current focus!


Adjusting the Pixel-Boost parameters

The "Pixel-Boost" parameters must be set and tested for each plate.

First, the desired test job is lined up in the CDI Exposer. This job must be sent with the "*Pixel+*" option activated.

The job is converted into a "Step-Test" with the "Step-Test" (33) function found under "Options". The same image is repeatedly produced but with different "Pixel-Boost" values.

Later on, it will be determined which "*Pixel Boost*" value delivers the desired results. This value can now be entered in the "*Pixel Boost Editor*" (30).

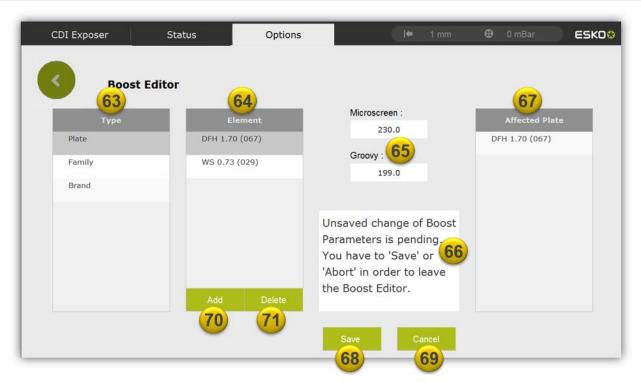

The Pixel Boost values can be assigned to a certain plate type "*Plate*", a plate family "*Family*" or to the plate manufacturer "*Brand*". This must be selected in the "*Type*" field (63) before changing or adding values.

The desired plate, family or manufacturer is selected under "*Element*" (64) in order to change the "*Microscreen*" or "*Groovy*" Pixel Boost values (65).

A corresponding help text (66) is displayed for every action. The plates affected by this change are displayed under "Affected Plate" (67).

All changes are saved with "Save" (68), all changes are rejected with "Cancel" (69). The Boost Editor is closed in both cases.

Plates, families or manufacturers are added with the "Add" button (70). The default values are entered, which can then be changed. A previously selected entry can be deleted with the *"Delete"* button (71).

Only active plates with Pixel+ are displayed on adding!

The back button is only available when nothing has been changed.

All changes in "Boost Editor" are applied on the next exposure job.