Instruction Manual

HI 93737 Silver ISM





This Instrument is in

http://www.hannainst.com Compliance with the CE Directives

WARRANTY

 $\,$ HI 93737 is warranted for two years against defects in workmanship and materials when used for its intended purpose and maintained according to instructions.

This warranty is limited to repair or replacement free of charge.

Damages due to accident, misuse, tampering or lack of prescribed maintenance are not covered.

If service is required, contact the dealer from whom you purchased the instrument. If under warranty, report the model number, date of purchase, serial number and the nature of the failure. If the repair is not covered by the warranty, you will be notified of the charges incurred. If the instrument is to be returned to Hanna Instruments, first obtain a Returned Goods Authorization Number from the Customer Service department and then send it with shipment costs prepaid. When shipping any instrument, make sure it is properly packaged for complete protection.

To validate your warranty, fill out and return the enclosed warranty card within 14 days from the date of purchase.

All rights are reserved. Reproduction in whole or in part is prohibited without the written consent of the copyright owner, Hanna Instruments Inc., Woonsocket, Rhode Island, 02895, USA.

Hanna Instruments reserves the right to modify the design, construction and appearance of its products without advance notice.

Dear Customer

Thank you for choosing a Hanna product. This manual will provide you with the necessary information for the correct operation of the meter. Please read it carefully before using the meter. If you need additional technical information, do not hesitate to e-mail us at tech@hannainst.com.

This instrument is in compliance with C€ directives EN 50081-1 and EN 50082-1.

PRELIMINARY EXAMINATION

Remove the instrument from the packing material and examine it carefully to make sure that no damage has occurred during shipment. If there is any damage, notify your Dealer.

Each Ion Specific Meter is supplied complete with

- 9V Battery
- Two Sample Cuvets and Caps
- One Transport Cap

Note: Conserve all packing material until the instrument has been observed to function correctly. Any defective item must be returned in its original packing.

GENERAL DESCRIPTION

The HI 93737 meter measures the silver content in water and wastewater in the 0.000 to 1.000 mg/L (ppm) range.


The meter uses an exclusive positive-locking system to ensure that the cuvet is in the same place every time it is placed into the measurement cell.

The reagents are in liquid form and are supplied in bottles. The amount of reagent is precisely dosed to ensure maximum repeatability.

Display codes aid the user in routine operations.

The meters have an auto-shut off feature that will turn the instrument off after 10 minutes of non-use.

SPECIFICATIONS

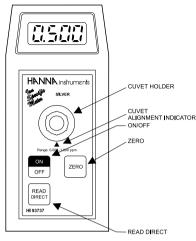

SPECIFICATIONS

Range 0.000 to 1.000 mg/L (ppm)

Resolution 0.001 mg/L

Accuracy ± 0.005 mg/L $\pm 10\%$ of reading

Typical EMC \pm 0.001 mg/L

Deviation

Light Source Light Emitting Diode @ 555 nm

Method Adaptation of the 1-(2-pyridylazo)-2-

naphtol PAN method. The reaction between silver and reagents causes an orange tint

in the sample

Light Detector Silicon Photocell

Environment 0 to 50°C (32 to 122°F);

max 95% RH non-condensing

Battery Type/Life 1 x 9 volt/40 hours Auto-Shut off After 10' of non-use

Dimensions 180 x 83 x 46 mm (7.1 x 3.3 x 1.8")

Weight 290 g (10 oz.).

REQUIRED REAGENTS

Code	Description	Quantity
HI 93737A-0	Buffer Reagent A	1 mL
HI 93737B-0	Buffer Reagent B	1 mL
HI 93737C-0	Indicator Reagent C	2 mL
HI 93737D-0	Fixing Reagent D	2 mL
HI 93703-51	Dispersing Agent	4-6 drops
	(only when necessary, see note)	

REAGENT SETS

HI 93737-01 Reagents for 50 tests HI 93737-03 Reagents for 150 tests

DISPLAY CODE GUIDE

This indicates that the meter is in a ready state and zeroing can be performed.

Sampling in Progress. This prompt appears each time the meter is performing a measurement.

This indicates that the meter is in a zeroed state and measurement can be performed.

A zero reading was not taken. Insert a sample before adding reagent and press 7FRO

Under range. A blinking "0.00" indicates that the sample absorbs less light than the zero reference. Check the procedure and make sure you use the same cuvet for reference (zero) and measurement.

Over range. A flashing value higher than the maximum concentration readable (see specifications) indicates that the sample absorbs too much light, meaning that the concentration is too high. Dilute the sample.

Light over range. The cuvet is not inserted correctly and an excess ambient light is reaching the detector. If the cover is properly installed, then contact your dealer or the nearest Hanna Customer Service Center.

Light under range. The zero sample is too dark for proper zeroing. If this is not the case, contact your dealer or the nearest Hanna Customer Service Center.

The "V" indicates that the battery voltage is getting low and the battery needs to be replaced.

EAP

This indicates that the battery is dead and must be replaced.

Note: once this indication is displayed, the meter will lockup. Change the battery to restart.

OPERATIONAL GUIDE


AFF


MEASUREMENT PROCEDURE

• Turn the meter on by pressing ON/OFF. Note: for best results perform your tests




- When the LCD displays "- -", it is ready.
- Fill two graduated beakers with 25 mL of sample.





- Add 1.0 mL of HI 93737C reagent to each beaker, swirl and wait for 2 minutes.
- Add 1.0 mL of HI 93737D reagent to each beaker, swirl and wait for 2 minutes.
- Fill one cuvet up to 1.5 cm (¾") below the rim with 10 mL of the blank.





-1.5 cm


• Press ZERO and SIP will appear on the LCD.



 Wait for a few seconds and the display will show "-0.0-". Now the meter is zeroed and ready for measurement



• Fill a second cuvet up to 1.5 cm (¾") below the rim with 10 mL of the reacted sample.



Press READ and "SIP" will appear during measurement



 The instrument directly displays concentration in mg/L of silver on the LCD.

Note: a temperature above 30°C may cause turbidity. In this case, before zeroing and taking readings, add 2-3 drops of Dispersing agent (HI93703-51) to each cuvet and swirl until complete dissolution of turbidity.

INTERFERENCES

Interference may be caused by:

Al ³⁺ above 30 mg/L		
above 30 mg/L		
above 1000 mg/L as CaCo ₃		
above 20 mg/L		
above 8000 mg/L		
above 1.5 mg/L		
above 20 mg/L		
above 40 mg/L		
above 15 mg/L		
above 20 mg/L		
above 1.5 mg/L		
above 10 mg/L		
above 500 mg/L		
above 25 mg/L		
above 1000 mg/L as CaCo ₃		
above 5000 mg/L		
above 1.5 mg/L		
above 20 mg/L		

above 30 mg/L

TIPS FOR AN ACCURATE MEASUREMENT

The instruction listed below should be carefully followed during testing to ensure best accuracy.

- Do not touch the cuvet walls with hands.
- In order to maintain the same conditions during the zeroing and the measuring phases, it is necessary to close the cuvet to prevent any contamination.
- Do not let the test sample stand too long after reagent is added or accuracy will be lost.
- Whenever the cuvet is placed into the measurement cell, it must be completely free of fingerprints, oil or dirt.
 Wipe it thoroughly with HI 731318 or a lint-free cloth prior to insertion.
- It is important that the sample does not contain any debris. This would corrupt the readings.
- It is possible to take multiple readings in a row, but it is recommended that a zero reading be taken for each sample and that the same cuvet is used for zeroing and measurement.
- It is important to discard the sample immediately after the reading is taken because the glass might become permanently stained.
- Shaking the cuvet can generate bubbles in the sample, causing higher readings. To obtain accurate measurements, remove such bubbles by swirling or by gently tapping the vial.
- All the reaction times reported in this manual are referred to 20°C (68°F). As a general rule of thumb, they should be doubled at 10°C (50°F) and halved at 30°C (86°F).

BATTERY REPLACEMENT

Battery replacement must only take place in a non-hazardous area using a 9V alkaline battery.

Simply slide off the battery cover on the back of the meter. Detach the battery from the terminals and attach a fresh 9V battery while paying attention to the correct polarity. Replace the battery and the cover.



ACCESSORIES

REAGENT SETS

HI 93737-01 Reagents for 50 tests HI 93737-02 Reagents for 150 tests

OTHER ACCESSORIES

HI 710009 Blue rubber boot

HI 710010 Orange rubber boot HI 721310 9V battery (10 pcs)

HI 731318 Tissue for wiping cuvets (4 pcs)

HI 731321 Glass cuvets (4 pcs)

HI 731325 Caps for cuvets (4 pcs)

HI 93703-50 Cuvets cleaning solution (230 mL).

CE DECLARATION OF CONFORMITY



Recommendations for Users

Before using these products, make sure that they are entirely suitable for the environment in which they are used

Operation of these instruments in residential area could cause unacceptable interferences to radio and TV equipments, requiring the operator to take all necessary steps to correct interferences

Any variation introduced by the user to the supplied equipment may degrade the instruments' EMC performance.

To avoid damages or burns, do not perform any measurement in microwave ovens.

PRINTED IN PORTUGAL

IST93737R1