


# Leica TPS1200


## Quick Guide

### Survey Setup – Set Azimuth Method

General steps to start the Survey application and utilize Set Azimuth for the orientation

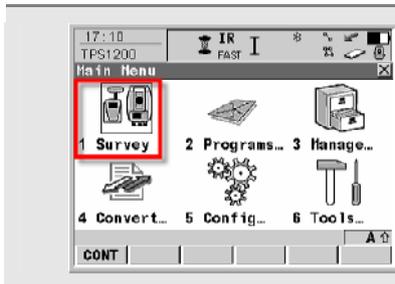


1. From the TPS 1200 Main Menu, select **1 Survey**.

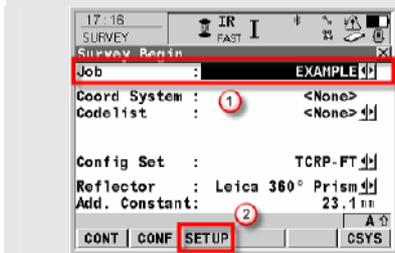


2. Initially, an existing Job must be selected, or a new one created. Select the Job field (1) to complete this task. Also, be sure to select the proper Coordinate System, Codelist, Config Set, etc.

Press **F3 SETUP** (2) to determine the setup and orientation method.

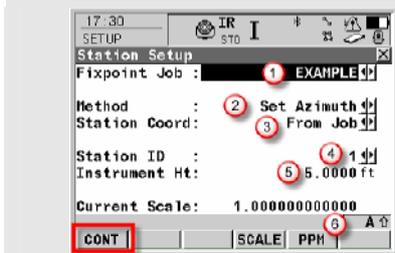

3. (1) Select the Fixpoint [Control] Job.  
(2) Select the Setup Method (2). Set Azimuth, in this case.  
(3) Set where to find the Station Coordinate.  
(4) Set the Station ID.  
(5) Set the Instrument Height.  
(6) Set the PPM for current conditions.


Finally, press **F1 CONT** to set the BS point.

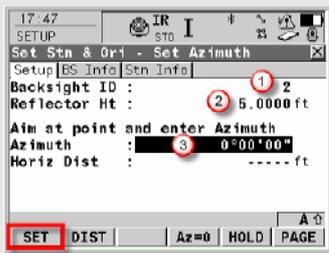

4. (1) Set the BS point ID.
- (2) Set the Reflector Height.
- (3) Point at the BS point, set the Azimuth.

Finally, press **F1 SET** to complete the setup. Accept the setup confirmation to follow by pressing **OK**.

**NOTE:** Other Setup methods are outlined in other Quick Guides.

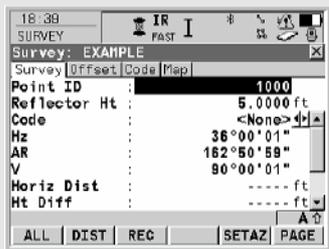

5. You are now set up and ready to Survey!