2-Color Display Digital Pressure Switch

Series ISE70/75/75H

New ONPN/PNP open collector 2 outputs added. Cut-to-zero display function added.



ZSP

PS

ISA

PSE

IS

ISG

ZSM

Metal Body Type (Die-cast aluminum)

Rated Pressure

For General Fluids

10 MPa · 15 MPa (ISE75H)

For Air

MPa (ISE70)

2-color digital

IP67

2-Color Display (Green/Red)

• Selectable from four patterns

	ON	OFF
1	Red	Green
2	Green	Red
3	Red	Red
4	Green	Green

Easily identifiable abnormal readings






M12 Connector

- Lead wire with M12 connector (5 m)
- Straight and right-angled connectors

With Bracket

• User-selectable mounting orientation

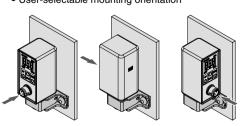

- Withstand pressure: Rated pressure x 3
- . Model with initial display settings of PSI is also available as standard.
- Port size Rc1/4, NPT1/4, G1/4 (ISO1179)





- Anti-chattering
- Display calibration
- Zero-out
- Key lock
- Unit display switching (Fixed SI unit in Japan)

For Air	For Gene	ral Fluids
ISE70 (1 MPa)	ISE75 (10 MPa)	ISE75H (15 MPa)
UP O DOWN PRESSURE SWITCH	UP O DOWN USET OF SET OF	SMC UZT UZT UP O COMM SET O COMM




1

SMC



2-Color Display Digital Pressure Switch For Air

Series ISE70

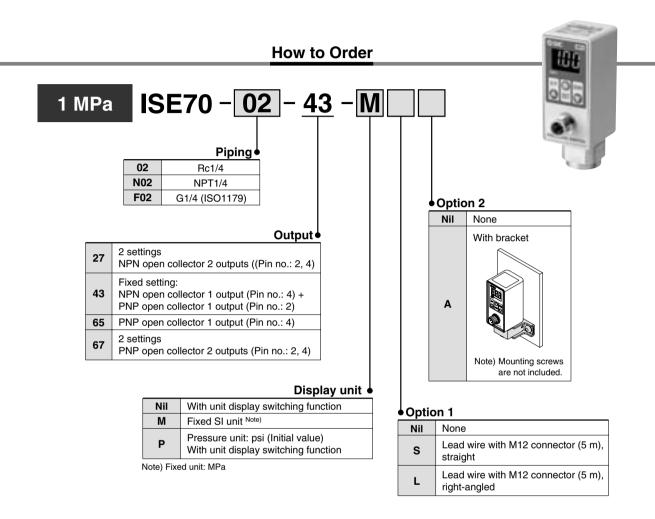

Optional Part No.

When optional parts are required separately, use the following part numbers to place an order.

Option	Part no.	Note
Bracket	ZS-31-A	Bracket B and the bracket assembly make up one set. Note) Mounting screws are not included. Bracket assembly
Lead wire with M12 connector, straight	ZS-31-B	Lead wire length: 5 m
Lead wire with M12 connector, right-angled	ZS-31-C	Lead wire length: 5 m



Specifications

	Model	ISE70	
Rated pressure range		0 to 1 MPa	
Set pressure range		-0.1 to 1 MPa	
Withstand p		1.5 MPa	
•	e resolution	0.01 MPa	
Applicable f	fluid	Air, Non-corrosive gas, Non-flammable gas	
Power supp	oly voltage	12 to 24 VDC±10%, Ripple (p-p) 10% or less (with power supply polarity protection)	
Current con	-	55 mA or less (at no load)	
Switch output		Output -27: 2 settings; NPN open collector 2 outputs (Pin no.: 2, 4) Output -43: Fixed setting; NPN open collector 1 output (Pin no.: 4) + PNP open collector 1 output (Pin no.: 2) Note 1) Output -65: PNP open collector 1 output (Pin no.: 4) Output -67: 2 settings; PNP open collector 2 outputs (Pin no.: 2, 4)	
	Max. load current	80 mA	
	Max. applied voltage	30 V (at NPN output)	
	Residual voltage	1 V or less (with load current of 80 mA)	
	Response time	2.5 ms (with anti-chattering function: 20 ms, 160 ms, 640 ms, 1000 ms, 2000 ms)	
	Short circuit protection	With short circuit protection	
Repeatabilit	ty	±0.5%F.S. or less	
Hysteresis mode Window comparator mode		Variable (0 or above)	
Display	•	3-digit, 7-segment indicator, 2-color display (Red/Green) can be interlocked with the switch output, Sampling cycle: 5 times/1 s	
Display accuracy		2%F.S.±1 digit or less (at 25°C±3°C)	
		OUT1: Light up when output is turned ON. (Green)	
Indication li	ght	OUT2: Light up when output is turned ON. (Red: for output -27, -67)	
Functions		Anti-chattering function, Unit display switching function, Zero-out function, Key lock function	
Enclosure		IP67 Note 2)	
	Fluid temperature range	0 to 50°C (with no freezing or condensation)	
	Operating temperature range	Operating: 0 to 50°C, Stored: -10 to 60°C (with no freezing or condensation)	
Environ- mental	Operating humidity range	Operating and stored: 35 to 85%RH (with no condensation)	
resistance	Withstand voltage	1000 VAC for 1 min. between live parts and case	
	Insulation resistance	50 $M\Omega$ or more between live parts and case (at 500 VDC Mega)	
	Vibration resistance	10 to 500 Hz, 1.5 mm or 98 m/s ² amplitude in X, Y, Z directions for 2 hours each (De-energized)	
Impact resistance		980 m/s² in X, Y, Z directions 3 times each (De-energized)	
Temperature characteristics (Based on 25°C: within operating temperature range)		±2%F.S. or less	
Standards		CE Marking, UL/CSA (UL508) compliance	
Wetted parts material		Fitting: C3604 (electroless nickel plated), Sensor port: PBT, Sensor pressure receiving area: Silicon, O-ring: NBR	
Port size		02: Rc1/4, N02: NPT1/4, F02: G1/4 (ISO1179) Note 3)	
Lead wire		Oilproof cable with M12 4-pin pre-wired connector, 4 cores, ø4, 5 m, Conductor O.D.: 0.72 mm, Insulator O.D.: 1.14 mm	
Mass (Weig	ht)	190 g (excluding the lead wire with M12 4-pin pre-wired connector)	
• •			

Note 1) The NPN and PNP outputs function for a single set point.

Note 2) An FKM gasket is used for the product case seal. Refer to the back of page 727 for details.

Note 3) G1/4: Applicable to ISO1179-1

See the operating manual for information on how to set and on handling precautions. (Refer to SMC website.)

ZSP

PS

ISA


PSE

IS

ISG

ZSM

2-Color Display Digital Pressure Switch For General Fluids Series ISE75/75H & Suis

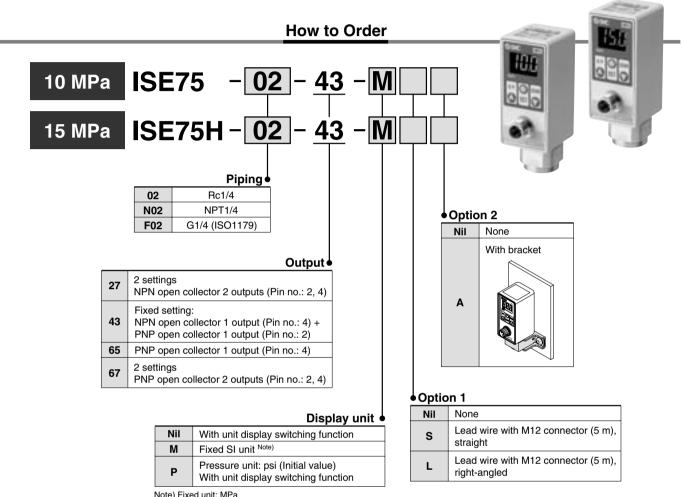

rvoto) r ixod driit. Wir t

Optional Part No.

When optional parts are required separately, use the following part numbers to place an order.

Option	Part no.	Note
Bracket	ZS-31-A	Bracket B and the bracket assembly make up one set. Bracket B Bracket assembly
Lead wire with M12 connector, straight ZS-31-B		Lead wire length: 5 m
Lead wire with M12 connector, right-angled	ZS-31-C	Lead wire length: 5 m



2-Color Display Digital Pressure Switch For General Fluids Series ISE75/75H

Specifications

	Model	ISE75	ISE75H	
Rated pressure range		0 to 10 MPa	0 to 15 MPa	
Set pressure range		0.4 to 10 MPa	0.5 to 15 MPa	
Withstand p	ressure	30 MPa	45 MPa	
Set pressur	e resolution	0.11	MPa	
Applicable t	fluid	Fluid or gas that will not corrode	stainless steel 304, 430 and 630	
Power supp	ly voltage	12 to 24 VDC±10%, Ripple (p-p) 10% or le	ess (with power supply polarity protection)	
Current con	sumption	55 mA or less	s (at no load)	
Switch output		Output -27: 2 settings; NPN open collector 2 outputs (Pin no.: 2, 4) Output -43: Fixed setting; NPN open collector 1 output (Pin no.: 4) + PNP open collector 1 output (Pin no.: 2) Note 1) Output -65: PNP open collector 1 output (Pin no.: 4) Output -67: 2 settings; PNP open collector 2 outputs (Pin no.: 2, 4)		
	Max. load current	80	mA	
	Max. applied voltage	30 V (at N	PN output)	
	Residual voltage	1 V or less (with loa	d current of 80 mA)	
	Response time	2.5 ms (with anti-chattering function: 20 r	ms, 160 ms, 640 ms, 1000 ms, 2000 ms)	
	Short circuit protection	With short circ	cuit protection	
Repeatabilit	ty	±0.5%F.\$	S. or less	
Hysteresis mode Window comparator mode		Variable (0 or above)		
Display		3-digit, 7-segment indicator, 2-color display (Red/Green) can be	e interlocked with the switch output, Sampling cycle: 5 times/1 s	
Display accuracy		2%F.S.±1 digit or I		
		OUT1: Light up when out	put is turned ON. (Green)	
Indication li	ght	OUT2: Light up when output is turned ON. (Red: for output -27, -67)		
Functions		Anti-chattering function, Unit display switching	g function, Zero-out function, Key lock function	
Enclosure		IP67	Note 2)	
	Fluid temperature range	−5 to 80°C (with no free	ezing or condensation)	
	Operating temperature range	Operating: -5 to 50°C, Stored: -10 to 60°C (with no freezing or condensation)		
Environ- mental	Operating humidity range	Operating and stored: 35 to 85%RH (with no condensation)		
resistance	Withstand voltage	250 VAC for 1 min. betw	veen live parts and case	
	Insulation resistance	50 M Ω or more between live pa	arts and case (at 50 VDC Mega)	
	Vibration resistance	10 to 500 Hz, 1.5 mm or 98 m/s² amplitude in X, Y, Z directions for 2 hours each (De-energized)		
Impact resistance		980 m/s² in X, Y, Z directions	3 times each (De-energized)	
Temperature characteristics (Based on 25°C: within operating temperature range)		±3%F.S. or less		
Standards		CE Marking, UL/CSA	(UL508) compliance	
Wetted parts material		Pressure receiving area: Stainless steel 630, Fitting Pressure receiving area: Stainless steel 630, Fitting	, , ,	
Port size		02: Rc1/4, N02: NPT1/4, F02: G1/4 (ISO1179) Note 3)		
Lead wire		Oilproof cable with M12 4-pin pre-wired connector, 4 cores, ø4, 5 m, Conductor O.D.: 0.72 mm, Insulator O.D.: 1.14 mn		
Mass (Weight)		, ·	g (port size NPT1/4, G1/4) /12 4-pin pre-wired connector)	

Note 1) The NPN and PNP outputs function for a single set point.

Note 2) An FKM gasket is used for the product case seal. Refer to the back of page 727 for details.

Note 3) G1/4: Applicable to ISO1179-1

See the operating manual for information on how to set and on handling precautions. (Refer to SMC website.)

PS

ISA

PSE

IS

ISG

ZSM

Series ISE70/75/75H

Descriptions




Displays the switch operation status. Lights up when OUT1 is turned ON.

SET button

Use this button to switch the mode and set the set value.

UP button

Use this button to change the mode or increase the ON/OFF set value. It also allows you to switch to the peak value display mode.

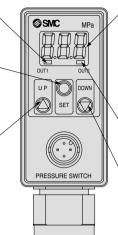

LCD

Displays the current pressure condition, set mode and error code. The display mode can be selected from four options: fixed green single-color reading, fixed red single-color reading, green reading interlocked with output for switching to red reading, or red reading interlocked with output for switching to green reading.

Indication light (Red)

Note)

Displays the switch operation status. Lights up when OUT2 is turned ON.

DOWN button

Use this button to change the mode or decrease the ON/OFF set value. It also allows you to switch to the bottom value display mode.

Note) Output -27 and -67 only


Internal Circuits and Wiring Examples

Output -27

2 settings

NPN open collector 2 outputs

Max. 30 V, 80 mA, Residual voltage 1 V or less

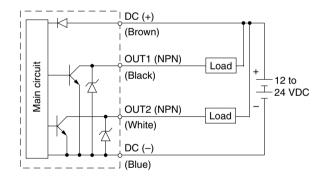


Output -43

Fixed setting

NPN open collector 1 output + PNP open collector 1 output (The pressure set point for switching the output signal is common to NPN and PNP.)


Max. 30 V (NPN only), 80 mA, Residual voltage 1 V or less

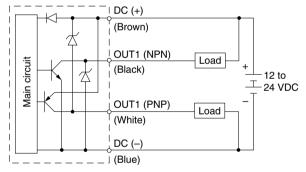

Output -65

PNP open collector 1 output

Max. 80 mA

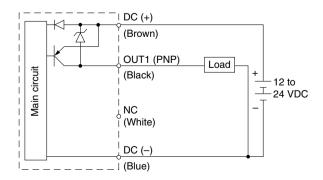


Output -67

2 settings

PNP open collector 2 outputs


Max. 80 mA

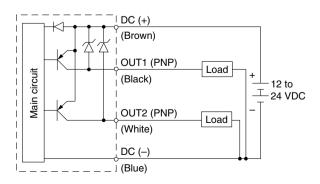

Functions

Display calibration function

This function eliminates slight differences in the output values and allows uniformity in the numbers displayed. Displayed values of the pressure sensor can be calibrated to within $\pm 5\%$ of their readings.

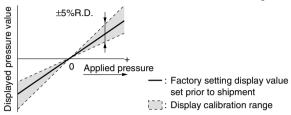

Note) When the display calibration function is used, the set pressure value may change ± 1 digit.

Peak/Bottom hold function

This function constantly detects and updates the maximum and minimum pressure values and allows the unit to hold the display value.

Key lock function

This function prevents incorrect operations such as changing the set value accidentally.

Zero-out function

The measured pressure reading can be adjusted to zero. More specifically, the factory-set reading can be corrected to within $\pm 7\% F.S.$

Unit display switching function

The reading unit can be selected.

Unit/Reading resolution	ISE70	ISE75/75H
MPa	0.01	0.1
kgf/cm ²	0.1	1
bar	0.1	1
psi	1	1 (X10)

Anti-chattering function

A large bore cylinder or ejector consumes a large amount of air in operation and may experience a temporary drop in the primary pressure. This function prevents detection of such temporary drops in primary pressure as abnormal pressure.

Response time selections: 20 ms, 160 ms, 640 ms, 1000 ms, 2000 ms

Error function

Take the following corrective solutions when error occurs

Error description		LCD display	Description	Solution
Over-	OUT1	Er 1	Load current of switch	Shut off the power supply. After eliminating the output factor that caused the
error	Note 1) OUT2	Er2	output exceeds 80 mA.	excess current, turn the power supply back on.
Residual pressure error		Er3	A pressure level greater than ±7%F.S. has been applied when it is cleared to zero. The switch will automatically return to measuring mode in three seconds, however. Due to individual product differences, the setting range varies by ±1 digit.	Bring the pressure back to atmospheric pressure and try us- ing the zero-out function.
Applied pressure error		HHH	Supply pressure exceeds the maximum set pressure.	Bring the pressure
		LLL	Supply pressure is below the minimum set pressure.	set pressure range.
System error		Er4	Internal data error	
		Егь	Internal data error	Shut off the power supply. Turn the
		Ern	Internal data error	power supply back on.
		Er8	Internal data error	

^{*} If the switch will not recover to normal even after all of the abovementioned solutions have been applied, consult SMC for investigation

Note 1) Output -27 and -67 only.

Cut-to-zero display function

With the ISE75 series, users can enable or disable a function (cut-to-zero display function) that displays pressure values of 0.3 MPa or less as zero (0.4 MPa or less in the ISE75H series).

Example pressure displays (shading indicates changed displays)

ISE75-□ (for 10 MPa)

Cut-to-zero display function "ON": $0 \rightarrow \text{Displayed as } 0 \rightarrow 0.4 \rightarrow 0.5 \rightarrow 0.6 \rightarrow \cdots \rightarrow 9.9 \rightarrow 10.0$ Cut-to-zero display function "OFF": $0 \rightarrow 0.1 \rightarrow 0.2 \rightarrow 0.3 \rightarrow 0.4 \rightarrow 0.5 \rightarrow 0.6 \rightarrow \cdots \rightarrow 9.9 \rightarrow 10.0$

ISE75H-□ (for 15 MPa)

Cut-to-zero display function "ON": $0 \rightarrow$ Displayed as $0 \rightarrow 0.5 \rightarrow 0.6 \rightarrow \cdots \rightarrow 14.9 \rightarrow 15.0$ Cut-to-zero display function "OFF": $0 \rightarrow 0.1 \rightarrow 0.2 \rightarrow 0.3 \rightarrow 0.4 \rightarrow 0.5 \rightarrow 0.6 \rightarrow \cdots \rightarrow 14.9 \rightarrow 15.0$

Pressure Display Range

Series Cut-to-zero display function "		Cut-to-zero display function "OFF"
ISE75	0, 0.4 to 10.0 MPa	0 to 10.0 MPa
ISE75H	0, 0.5 to 15.0 MPa	0 to 15.0 MPa

^{*} The set pressure range does not change when the cut-to-zero display function is disabled.



PS

ISA

PSE

IS


ISG

ZSM

Series **ISE70/75/75H**

Dimensions


ISE70/75/75H

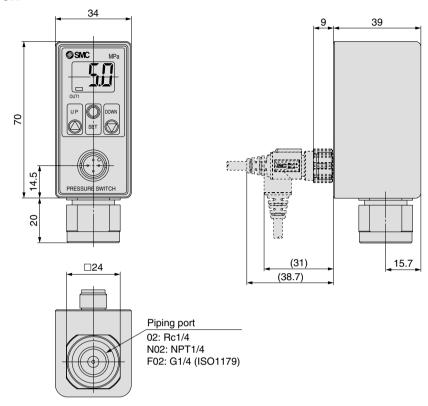

Note) The connector faces down (toward the piping). Do not attempt to rotate the connector, as it is not rotatable.



Bracket mount

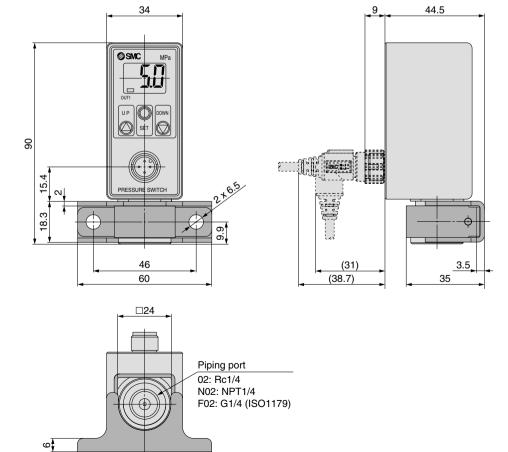

Connector pin assignments

Output -43 (Color: Gray)

1	Brown	DC (+)
2	White	OUT1 (PNP)
3	Blue	DC (-)
4	Black	OUT1 (NPN)

Output -65 (Color: Black)

1	Brown	DC (+)
2	White	NC
3	Blue	DC (-)
4	Black	OUT1 (PNP)

Output -27 and -67 (Color: Gray)

1	Brown	DC (+)
2	White	OUT2 (NPN or PNP)
3	Blue	DC (-)
4	Black	OUT1 (NPN or PNP)





Series ISE70/75/75H Specific Product Precautions 1

Be sure to read before handling. Refer to front matters 58 and 59 for Safety Instructions and pages 687 to 691 for Pressure Switch Precautions.

Handling

⚠ Warning

1. Do not drop, bump, or apply excessive impacts (980 m/s²) while handling.

Although the body of the sensor may not be damaged, the internal parts of the sensor could be damaged and lead to a malfunction.

2. The tensile strength of the cord is 50 N.

Applying a greater pulling force on it can cause a malfunction. When handling, hold the body of the sensor—do not dangle it from the cord.

3. Do not exceed the screw-in torque of 40 N·m for the ISE70 and 80 N·m for the ISE75(H) when connecting the pipe to the switch.

Exceeding these values may cause the switch to malfunction.

- 4. Do not use pressure sensors with poisonous, corrosive and/or flammable gases or liquids.
- 5. When connecting the pipe to the switch, engage the wrench horizontally to the chamfered barrel of the fitting.

Be careful not to apply excessive force to the switch's main unit.

Connection

Marning

- 1. Incorrect wiring can damage the switch and cause a malfunction or erroneous switch output.
- 2. Connections should be done while the power is turned off.
- 3. Wire separately from power lines and high voltage lines, avoiding wiring in the same conduit with these lines.

Malfunctions may occur due to noise from these other lines.

4. If a commercial switching regulator is used, make sure that the F.G. terminal is grounded.

Operating Environment

⚠ Warning

 Our pressure switches are CE marked; however, they are not equipped with surge protection against lightning.

Lightning surge countermeasures should be applied directly to system components as necessary.


2. Our pressure switches do not have an explosion proof rating.

Never use in the presence of an explosive gas as this may cause a serious explosion.

⚠ Caution

1. Do not use in an environment with spattering liquid of oil or solvent.

This may cause the switch to malfunction due to corrosion and/or swelling in the seals (FKM).

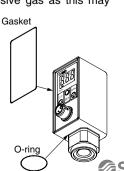

Pressure Source

⚠ Warning

1. Use of poisonous and deleterious substances, corrosive or combustible fluids

Do not use fluids such as poisonous and deleterious substances or corrosive gases. Also, note that the switch is not explosion-proof.

2. Applicable fluids

Do not use the switch for any corrosive or flammable gas or fluid (ISE70 series).

Do not use the switch for any fluid capable of corroding stainless steel 304, 430 and 630; or for any flammable gas or liquid (ISE75/75H series).

(For corrosiveness of fluids, consult with the manufacturer of the fluid.)

3. Withstand pressure

When liquid fluid is used, rapid pressure change can be generated such as water hammer and surge pressure when a valve is turned ON/OFF.

Install a dumper or an absorber or an accumulator as a countermeasure according to necessity. It may damage the pressure sensor or the switch if pressure over the proof pressure is applied even for a second.

Mounting


⚠ Caution

1. Connecting the pipe to the switch

When connecting the pipe to the switch, apply a torque of 13.6 N·m or greater for the ISE70 series and a torque of 25 N·m or greater for the ISE75/75H series.

2. Bracket-mounting the switch

Interlock the neck of the switch's piping port between the bracket assembly and bracket B. Using two M6 screws, mount the switch onto a wall. If the panel thickness is less than 5 mm, use nuts or other alternative means to increase the mounting strength.

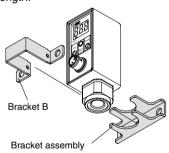

Bracket B and the bracket assembly make up one set.

ISE

ZSP

PS

ISA PSE

IS

ISG ZSM



Series ISE70/75/75H Specific Product Precautions 2

Be sure to read before handling. Refer to front matters 58 and 59 for Safety Instructions and pages 687 to 691 for Pressure Switch Precautions.

Set Pressure Range and Rated Pressure Range


⚠ Caution

1. Set the pressure to within the rated pressure range.

The set pressure range is the range of pressure that is possible in setting.

The rated pressure range is the range of pressure that satisfies the specifications (accuracy, linearity, etc.) on the switch.

Although it is possible to set a value outside the rated pressure range, the specifications will not be guaranteed even if the value stays within the set pressure range.

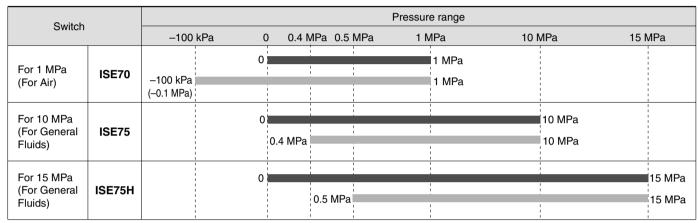

^{*} The ISE75(H) switch shows zero (0) when the pressure being applied goes below the lower limit of the set pressure range, when the cut-too-zero display function is selected.

Rated pressure range of switch
Set pressure range of switch

