ROTRONIC MANUAL

HygroClip2 ADVANCED Humidity Temperature Probes





HygroClip2 ADVANCED



E-M-HC2A-V1_0.docx

Manual

Table of contents

1	Overview	3
1.1	Hardware and software compatibility	3
2	Models	4
3	General description	18
3.1	Power supply	18
3.2	Measured parameters	18
3.3	Calculated parameters	18
3.4	Analog output signals	18
3.5	Digital interface	19
3.6	Communication protocol	19
3.7	Connector	20
3.8	Sensor protection (dust filter)	21
4	User configurable settings and functions	23
4.1	Function overview	24
4.2	Factory default settings	26
5	Mechanical installation	27
6	Electrical installation	28
6.1	General connection information	28
6.2	Signal cable information	28
6.3	Analog signal wiring	29
6.4	Digital signal wiring	29
6.5	Grounding	29
7	Operation	30
7.1	Minimum load requirements for the probe voltage outputs	30
7.2	Connectivity examples for stand-alone probes	31
7.3	Hand-held probes used with an indicator	32
8	Maintenance	33
8.1	Cleaning or replacing the dust filter	33
8.2	Periodic calibration check	33
8.3	Validation of the output signals transmission	33
9	Firmware updates	34
10	Technical data	35
11	Accessories and parts	38
12	Supporting documents	39
13	Document releases	40

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

Applicability:

This manual applies to all HC2A probes with firmware version 1.x. Changes to the last digit of the version number reflect minor firmware changes that do not affect the manner in which the probe should be operated.

1 Overview

The HC2A series are digital humidity-temperature probes based on the AirChip3000 technology. These probes feature a UART serial interface and two 0...1 V linear analog output signals.

The HC2A probes are designed for use with the HygroClip2 generation of ROTRONIC humidity-temperature instruments: transmitters, data loggers, hand-helds, etc.

The HC2A probes can also be used as a stand-alone device using either the analog output signals or the probe digital interface. Connectors, cables and digital interface adapters are available to this purpose. Digital integration with OEM applications is facilitated by the probe communication protocol options.

The HC2A probes offer the following user functions:

- o User configurable settings
- o Calculation of the dew or frost point
- o Humidity temperature calibration and adjustment
- o Simulator mode
- Data recording

The ability for the user to easily update the AirChip3000 firmware means that the HC2A probes can be kept up-to-date regarding any future functionality improvement.

Available in different configurations, the HC2A probe series is designed to meet the requirements of a large number of applications and environments.

1.1 Hardware and software compatibility

The HC2A probes are compatible only with the AirChip3000 generation of ROTRONIC humidity-temperature instruments.

Configuration of the HC2A probes and access to the probe functions requires a PC with the ROTRONIC HW4 software version 3.7 or higher or connection to a compatible instrument from ROTRONIC.

HygroClip2 ADVANCED	ro tronic	
E-M-HC2A-V1_0.docx	Manual	

2 Models

In the following tables, we have indicated the type of instrument primarily used with each probe model. The following should also be noted:

- The HC2A probes can be directly connected to a PC or to an Ethernet network using one of the available digital interface adapters (see separate document E-M-HC2-accessories).
- The HC2A Probes can also be used as a standalone device with two analog output signals. Different connectors are available to this purpose (see separate document E-M-HC2-accessories).

Regardless of the probe model, the analog outputs signals are always scaled in the same way by the factory $(0...1 \text{ V} = 0...100 \text{ }\%\text{RH} \text{ and } 0...1 \text{ V} = -40...60 \text{ }^{\circ}\text{C})$. The user is responsible for reconfiguring the probe analog outputs (requires the ROTRONIC HW4 software) and for providing power to the probe.

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1 0.docx	Manual

Climate measurement				
For use with indicators, data loggers and transmitters, with or without an extension cable				
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C		
	Humidity measuring range:	0100 %RH		
	Temperature limits:	-50100 °C (-58212 °F)		
	Diameter:	15 mm (0.6")		
HC2A-S	Length:	108 mm (3.3")		
	Housing material:	Polycarbonate, black		
	Standard dust filter:	Polyethylene, 40 µm		
	Sensor:	HYGROMER® HT-1		
	Weight:	10 g (0.35 oz)		
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C		
HC2A-S3 HC2A-S-HH	Humidity measuring range:	0100 %RH		
	Temperature limits:	-50100 °C (-58212 °F)		
	Diameter:	15 mm (0.6")		
HC2A-S3	Length:	108 mm (3.3")		
	Housing material:	Polycarbonate, white		
	Standard dust filter:	Polyethylene, 40 µm		
	Sensor:	HYGROMER® HT-1		
	Weight:	10 g (0.35 oz)		
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C		
	Humidity measuring range:	0100 %RH		
	Temperature limits:	-50100 °C (-58212 °F)		
	Diameter:	15 mm (0.6")		
HC2A-S-HH	Length:	108 mm (3.3")		
	Housing material:	Polycarbonate, black		
	Standard dust filter:	None		
	Sensor:	HYGROMER® HH-1		
	Weight:	10 g (0.35 oz)		
	108 mm	Ø 15 mm		

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

Climate measurement		
For use with indicato	rs, data loggers and transmitt	ers, with or without an extension cable
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C
	Humidity measuring range:	0100 %RH
	Temperature limits:	-50100 °C (-58212 °F)
	Diameter:	15 mm (0.6")
HC2A-SM	Length:	108 mm (3.3")
	Housing material:	Stainless steel, DIN 1.4301
	Standard dust filter:	Wiremesh filter, 10 μm, DIN 1.4401
	Sensor:	HYGROMER® HT-1
	Weight:	50 g (1.76 oz)
108 mm Ø 15 r		

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

Process measurement			
For use with transmitters and data loggers			
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C	
	Humidity measuring range:	0100 %RH	
	Temperature limits at sensor:	-100190 °C / 200 °C¹ (-148374 / 392 °F)	
	Diameter barrel:	15 mm (0.6")	
	Length (probe head):	144 mm (5.7")	
HC2A-IC102	Cable length:	2 m (6.5 ft)	
HC2A-IC105		5 m (16.4 ft)	
	Housing material:	PEEK	
	Standard filter:	None, must be ordered separately	
	Sensor:	HYGROMER® HT-1	
	Weight:	230 g / 8.1 oz, 2 m cable	
		470 g / 16.6 oz, 5 m cable	
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C	
	Humidity measuring range:	0100 %RH	
	Temperature limits at sensor:	-100190 °C / 200 °C¹ (-148374 / 392 °F)	
	Diameter barrel:	15 mm (0.6")	
	Length (probe head):	294 mm (11.6")	
HC2A-IC302	Cable length:	2 m (6.5 ft)	
HC2A-IC305		5 m (16.4 ft)	
	Housing material:	PEEK	
	Standard filter:	None, must be ordered separately	
	Sensor:	HYGROMER® HT-1	
	Weight:	260 g / 9.2 oz, 2 m cable	
		500 g / 17.6 oz, 5 m cable	
111 mm 3 144 / 294 / 444 / 594 / 744 mm			

-

¹ The peak load at 200 °C is 100 h. See the sensor data sheet for detailed information on the pollution loads for the sensor.


HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C	
	Humidity measuring range:	0100 %RH	
	Temperature limits at sensor:	-100190 °C / 200 °C² (-148374 / 392 °F)	
	Diameter barrel:	15 mm (0.6")	
	Length (probe head):	444 mm (17.5")	
HC2A-IC402	Cable length:	2 m (6.5 ft)	
HC2A-IC405		5 m (16.4 ft)	
	Housing material:	PEEK	
	Standard filter:	None, must be ordered separately	
	Sensor:	HYGROMER® HT-1	
	Weight:	290 g / 10.2 oz, 2 m cable	
		530 g / 18.7 oz, 5 m cable	
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C	
	Humidity measuring range:	0100 %RH	
	Temperature limits at sensor:	-100190 °C / 200 °C ² (-148374 / 392 °F)	
	Diameter barrel:	15 mm (0.6")	
	Length (probe head):	594 mm (23.4")	
HC2A-IC502	Cable length:	2 m (6.5 ft)	
HC2A-IC505		5 m (16.4 ft)	
	Housing material:	PEEK	
	Standard filter:	None, must be ordered separately	
	Sensor:	HYGROMER® HT-1	
	Weight:	320 g / 11.3 oz, 2 m cable	
		560 g / 19.8 oz, 5 m cable	
111 mm 55 144 / 294 / 444 / 594 / 744 mm			

_

² The peak load at 200 °C is 100 h. See the sensor data sheet for detailed information on the pollution loads for the sensor.

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

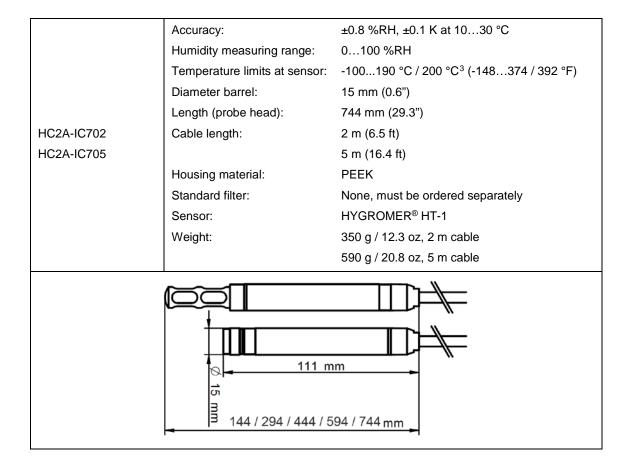

³ The peak load at 200 °C is 100 h. See the sensor data sheet for detailed information on the pollution loads for the sensor.

HygroClip2 A	DVANCED
--------------	---------



E-M-HC2A-V1_0.docx

Manual

Process measurement for hydrogen peroxide H2O2 applications			
For use with transmitters and data loggers			
HC2A-IC102-HH HC2A-IC105-HH	Accuracy: Humidity measuring range: Temperature limits at sensor: Diameter barrel: Length (probe head): Cable length: Housing material: Standard filter: Sensor:	15 mm (0.6") 144 mm (5.7") 2 m (6.5 ft) 5 m (16.4 ft) PEEK None, must be ordered separately HYGROMER® HH -1	
	Weight:	230 g / 8.1 oz, 2 m cable 470 g / 16.6 oz, 5 m cable	
HC2A-IC302-HH HC2A-IC305-HH	Accuracy: Humidity measuring range: Temperature limits at sensor: Diameter barrel: Length (probe head): Cable length: Housing material: Standard filter: Sensor: Weight:	±1.2 %RH, ±0.1 K at 1030 °C 0100 %RH -50120 °C (-148392 °F) 15 mm (0.6") 294 mm (11.6") 2 m (6.5 ft) 5 m (16.4 ft) PEEK None, must be ordered separately HYGROMER® HH -1 260 g / 9.2 oz, 2 m cable 500 g / 17.6 oz, 5 m cable	
	111 m		

HygroClip2 ADVANCED



E-M-HC2A-V1_0.docx

Manual

	Accuracy:	±1.2 %RH, ±0.1 K at 1030 °C	
	Humidity measuring range:	0100 %RH	
	Temperature limits at sensor:		
	Diameter barrel:	15 mm (0.6")	
	Length (probe head):	444 mm (17.5")	
HC2A-IC402-HH			
HC2A-IC402-HH	Cable length:	2 m (6.5 ft) 5 m (16.4 ft)	
ПС2А-1С405-ПП	Hausing materials		
	Housing material:	PEEK	
	Standard filter:	None, must be ordered separately	
	Sensor:	HYGROMER® HH -1	
	Weight:	290 g / 10.2 oz, 2 m cable	
		530 g / 18.7 oz, 5 m cable	
	Accuracy:	±1.2 %RH, ±0.1 K at 1030 °C	
	Humidity measuring range:	0100 %RH	
	Temperature limits at sensor:	-50120 °C (-148392 °F)	
	Diameter barrel:	15 mm (0.6")	
	Length (probe head):	594 mm (23.4")	
HC2A-IC502-HH	Cable length:	2 m (6.5 ft)	
HC2A-IC505-HH		5 m (16.4 ft)	
	Housing material:	PEEK	
	Standard filter:	None, must be ordered separately	
	Sensor:	HYGROMER® HH -1	
	Weight:	320 g / 11.3 oz, 2 m cable	
		560 g / 19.8 oz, 5 m cable	
	111 m 5 144 / 294 / 444 / 5		

HygroClip2 ADVANCED



E-M-HC2A-V1_0.docx

Manual

Accuracy: ±1.2 %RH, ±0.1 K at 10...30 °C Humidity measuring range: 0...100 %RH Temperature limits at sensor: -50...120 °C (-148...392 °F) Diameter barrel: 15 mm (0.6") Length (probe head): 744 mm (29.3") HC2A-IC702-HH Cable length: 2 m (6.5 ft) HC2A-IC705-HH 5 m (16.4 ft) Housing material: PEEK Standard filter: None, must be ordered separately Sensor: HYGROMER® HH-1 Weight: 350 g / 12.3 oz, 2 m cable 590 g / 20.8 oz, 5 m cable 111 mm 144 / 294 / 444 / 594 / 744 mm

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

Process measurement		
For use with trans	mitters and data loggers	
HC2A-IC302-A HC2A-IC305-A	Accuracy: Humidity measuring range: Temperature limits at sensor: Diameter barrel: Length (probe head): Cable length: Housing material: Standard filter: Sensor: Weight:	±0.8 %RH, ±0.1 K at 1030 °C 0100 %RH -100190 °C / 200 °C ⁴ (-148374 / 392 °F) 25 / 15 mm (1.0 / 0.6") 278 mm (10.9") 2 m (6.5 ft) 5 m (16.4 ft) PEEK None, must be ordered separately HYGROMER® HT-1 290 g / 10.2 oz, 2 m cable
HC2A-IC402-A HC2A-IC405-A	Accuracy: Humidity measuring range: Temperature limits at sensor: Diameter barrel: Length (probe head): Cable length: Housing material: Standard filter: Sensor: Weight:	±0.8 %RH, ±0.1 K at 1030 °C 0100 %RH -100190 °C / 200 °C ⁴ (-148374 / 392 °F) 25 / 15 mm (1.0 / 0.6") 428 mm (16.9") 2 m (6.5 ft) 5 m (16.4 ft) PEEK None, must be ordered separately HYGROMER® HT-1 320 g / 11.3 oz, 2 m cable 560 g / 19.8 oz, 5 m cable
Φ 25 mm	150 mm 234 / 384 / 534 / 684 mr 27	m 8 / 428 / 578 / 728 mm

 4 The peak load at 200 °C is 100 h. See the sensor data sheet for detailed information on the pollution loads for the sensor.

© 2016 · ROTRONIC AG · Bassersdorf · Switzerland

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C	
	Humidity measuring range:	0100 %RH	
	Temperature limits at sensor:	-100190 °C / 200 °C ⁵ (-148374 / 392 °F)	
	Diameter barrel:	25 / 15 mm (1.0 / 0.6")	
	Length (probe head):	578 mm (22.8")	
HC2A-IC502-A	Cable length:	2 m (6.5 ft)	
HC2A-IC505-A		5 m (16.4 ft)	
	Housing material:	PEEK	
	Standard filter:	None, must be ordered separately	
	Sensor:	HYGROMER® HT-1	
	Weight:	350 g / 12.3 oz, 2 m cable	
		590 g / 20.8 oz, 5 m cable	
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C	
	Humidity measuring range:	0100 %RH	
	Temperature limits at sensor:	-100190 °C / 200 °C ⁵ (-148374 / 392 °F)	
	Diameter barrel:	25 / 15 mm (1.0 / 0.6")	
	Length (probe head):	728 mm (28.7")	
HC2A-IC702-A	Cable length:	2 m (6.5 ft)	
HC2A-IC705-A		5 m (16.4 ft)	
	Housing material:	PEEK	
	Standard filter:	None, must be ordered separately	
	Sensor:	HYGROMER® HT-1	
	Weight:	380 g / 13.4 oz, 2 m cable	
		770 g / 27.1 oz, 5 m cable	
		1	
V LP4			
⊖ 150 mm			
234 / 384 / 534 / 684 mm			
φ 25 mm		8 / 428 / 578 / 728 mm	
ă −−−	27.	→ [§	
		·	

⁵ The peak load at 200 °C is 100 h. See the sensor data sheet for detailed information on the pollution loads for the sensor.

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

	Accuracy:67	±0.8 %RH, ±0.1 K at 1030 °C
	Humidity measuring range:	0100 %RH
	Temperature limits at sensor:	-100190 °C / 200 °C ⁸ (-148374 / 392 °F)
	Diameter barrel:	15 mm (0.6")
	Length (probe head):	130 mm (5.2")
HC2A-IM102-M	Cable length:	2 m (6.5 ft)
HC2A-IM105-M		5 m (16.4 ft)
	Housing material:	Stainless steel, DIN 1.4301
	Standard filter:	None, must be ordered separately
	Sensor:	HYGROMER® HT-1
	Weight:	310 g / 10.9 oz, 2 m cable
		470 g / 16.6 oz, 5 m cable
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C
	Humidity measuring range:	0100 %RH
	Temperature limits at sensor:	-100190 °C / 200 °C ⁸ (-148374 / 392 °F)
	Diameter barrel:	15 mm (0.6")
	Length (probe head):	280 mm (11.0")
HC2A-IM302-M	Cable length:	2 m (6.5 ft)
HC2A-IM305-M		5 m (16.4 ft)
	Housing material:	Stainless steel, DIN 1.4301
	Standard filter:	None, must be ordered separately
	Sensor:	HYGROMER® HT-1
	Weight:	460 g / 15.9 oz, 2 m cable
		690 g / 24.3 oz, 5 m cable
97 mm 130 / 280 / 430 / 580 mm		

⁶ HC2A-IM102-M (120 mm barrel length) - to avoid measurement errors due to temperature gradients fully immerse the probe barrel in the environment to be measured.

© 2016 · ROTRONIC AG · Bassersdorf · Switzerland

⁷ To avoid measurement errors, temperature should be the same on both sides of the mounting wall.

⁸ The peak load at 200 °C is 100 h. See the sensor data sheet for detailed information on the pollution loads for the sensor.

HygroClip2 ADVANCED	rotron
E-M-HC2A-V1_0.docx	Manual

	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C
	Humidity measuring range:	0100 %RH
	Temperature limits at sensor:	-100190 °C / 200 °C ⁹ (-148374 / 392 °F)
	Diameter barrel:	15 mm (0.6")
	Length (probe head):	430 mm (16.9")
HC2A-IM402-M	Cable length:	2 m (6.5 ft)
HC2A-IM405-M		5 m (16.4 ft)
	Housing material:	Stainless steel, DIN 1.4301
	Standard filter:	None, must be ordered separately
	Sensor:	HYGROMER® HT-1
	Weight:	590 g / 20.8 oz, 2 m cable
		820 g / 28.9 oz, 5 m cable
	Accuracy:	±0.8 %RH, ±0.1 K at 1030 °C
	Humidity measuring range:	0100 %RH
	Temperature limits at sensor:	-100190 °C / 200 °C ⁹ (-148374 / 392 °F)
	Diameter barrel:	15 mm (0.6")
	Length (probe head):	580 mm (22.8")
HC2A-IM502-M	Cable length:	2 m (6.5 ft)
HC2A-IM505-M		5 m (16.4 ft)
	Housing material:	Stainless steel, DIN 1.4301
	Standard filter:	None, must be ordered separately
	Sensor:	HYGROMER® HT-1
	Weight:	730 g / 25.7 oz, 2 m cable
		970 g / 34.2oz, 5 m cable
97 mm 130 / 280 / 430 / 580 mm		

⁹ The peak load at 200 °C is 100 h. See the sensor data sheet for detailed information on the pollution loads for the sensor.

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

Measurement in compressed air conduits and vessels			
For use with transmitters and data loggers			
HC2A-IE102-M HC2A-IE105-M	Accuracy: Humidity measuring range: Temperature limits at sensor: Thread: Recommended torque: Pressure resistant: Length (probe head): Cable length: Housing material: Standard filter: Sensor:	G1/2" 70 Nm 100 bar / 1450 PSI 148 mm (5.8") 2 m (6.5 ft) / 5 m (16.4 ft) Stainless steel, DIN 1.4301 None, must be ordered separately HYGROMER® HT-1	
Accuracy: Humidity measuring range: Temperature limits at sensor: Thread: Recommended torque: Pressure resistant: Length (probe head): Cable length: Housing material: Standard filter: Sensor:		290 g / 10.2 oz, 2 m cable 660 g / 23.2 oz, 5 m cable ±0.8 %RH, ±0.1 K at 1030 °C 0100 %RH -100190 °C / 200 °C ^{10 11} (-148374 / 392 °F) NPT ½" 70 Nm 100 bar / 1450 PSI 148 mm (5.8") 2 m (6.5 ft) / 5 m (16.4 ft) Stainless steel, DIN 1.4301 None, must be ordered separately HYGROMER® HT-1 290 g / 10.2 oz, 2 m cable 660 g / 23.2 oz, 5 m cable	
SW 27 97 mm 148 mm			

¹⁰ The peak load at 200 °C is 100 h. See the sensor data sheet for detailed information on the pollution loads for the sensor.

 $^{^{11}}$ The sealing ring withstands only -40...85°C

HygroClip2 ADVANCED	ro tronic	
E-M-HC2A-V1_0.docx	Manual	

3 General description

3.1 Power supply

When a voltage source of 3.3...5 VDC is not available, the probe should be used together with a voltage adapter (see separate document **E-M-HC2-accessories**) so as to provide 3.3...5 VDC to the probe. Use of a voltage adapter allows powering the probe from a voltage source of 5 to 24 VDC or 5 to 16 VAC.

The HC2A probes are polarity protected by a keyed connector. There is no electrical polarity protection.

3.2 Measured parameters

The HC2A probe measures relative humidity with a ROTRONIC HYGROMER® HT-1 capacitive sensor and temperature with a Pt100 RTD.

3.3 Calculated parameters

Using the ROTRONIC HW4 software, the HC2A probe can be configured by the user to calculate either the dew point or the frost point.

3.4 Analog output signals

The HC2A probe features two 0...1 V linear analog output signals. The default factory settings are as follows:

```
Output 1: 0...1 V (humidity) = 0...100 %RH
Output 2: 0...1 V (temperature) = -40...60°C
```

Using the ROTRONIC HW4 software any output signal can be made to correspond one of the following:

- o Relative humidity
- o Temperature
- Dew or frost point

The scale of each analog output can be set within the numerical limits of -999.99 and 9999.99. If so desired, any output can also be disabled (no signal).

The D/A converters used to generate the analog output signals feature a 16-bit resolution. The 0...1 V analog output signals exhibit a small positive offset of 3 mV or less at 0 V.

Minimum load requirements apply to the external device or circuit connected to the probe voltage outputs. These requirements are defined in the "Operation" chapter.

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

3.5 Digital interface

The HC2A probe features a UART interface (Universal Asynchronous Receiver Transmitter) that allows two-way communication with the probe. For connecting the HC2A probe to a PC, use a digital adapter cable AC3001 (see document **E-M-HC2-accessories**). The probe can also be indirectly connected to a PC using an instrument from the ROTRONIC program.

The ROTRONIC HW4 software (version 3.7.0 or higher) allows full access to the following:

- o Measurement data (humidity and temperature) and calculated parameter (dew or frost point)
- o Probe information: name, RS-485 address, humidity sensor status, etc.
- Probe alarm functions
- Probe data logging function
- o Probe calibration and probe adjustment functions
- Probe configuration
- Firmware update of HygroClip2 probes

3.6 Communication protocol

The probe measurement data can be read without having to use the ROTRONIC HW4 software. The HC2A probe offers the following communication protocol options (ASCII) which can be selected by connecting the probe to a PC running the ROTRONIC HW4 software:

- RO-ASCII: this is the standard (default) communication protocol used by all AirChip 3000 devices and by the HW4 software. In principle, this protocol supports all of the AirChip 3000 functions but some of the functions require a certain amount of computations to be carried out by an external device such as a PC.
- o Custom: this communication protocol can be used to provide compatibility of the HC2A probe with an existing communication system. The Custom communication protocol is limited to reading measurement data from the HC2A probe. Functions such as device configuration, humidity and temperature adjustment, etc. are not supported. The Custom protocol is applicable to all AirChip 3000 devices with a digital interface and allows RS-485 networking
- I2C: The I2C protocol available with the HC2A probe does not allow the networking of devices and is limited to a one way communication where the HC2A probe automatically sends data during each refresh interval to an external device with I2C input.

When using either the RO-ASCII or the Custom protocol, the HC2A probe can be set to send data automatically after each refresh cycle without requiring a data request. When this mode is enabled, the receiving device must be listening at all times in order to get the measurement data.


For details, see document E-M-AC3000-CP

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

3.7 Connector

All standard probe models of the HC2A series use the same keyed connector (male). The connector is located either directly on the probe body or at the end of a cable. The probe connector is secured to the matching female connector with a threaded collar.

Pin-out diagram (7-pin male – looking at probe)

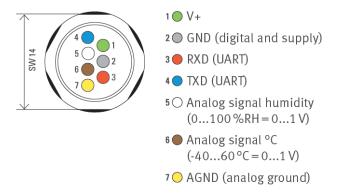

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

3.8 Sensor protection (dust filter)

Most probes of the HC2A series are supplied with a filter to protect the sensors against dust particles and high air velocity. Following filters and carriers are available:

Filter carrier				
Order code	Picture	Drawing	Material	Temperature range
SPA-PCB		Schnitt A-A 5.5 9.7 14.X 45° M12.x 15 - 7 0EEP	Polycarbonate, black	-50100 °C (-58212 °F)
SPA-PCW		Schnitt A-A 65 9 1038 14 X 45 M12 X 15 - 7 DEEP	Polycarbonate, white	-50100 °C (-58212 °F)
SPA-SS		Schnitt A-A 6.5 7 1038 7 16 X 45° M12 x 15 - 7 068P	Stainless steel, 1.4301	-100200 °C (-148392 °F)

HygroClip2 ADVANCED



E-M-HC2A-V1_0.docx

Manual

Filter					
	Carrier only	Wire mesh filter	PE filter	PTFE filter	Stainless steel
Filter				2	
Material	PC / 1.4301	1.4401	Polyethylene	PTFE	1.4404
Pore size	-	10 µm	40 μm	10 µm	25 μm
Temperature range	-	-100200 °C (-148392 °F)	-5080 °C (-58212 °F)	-80200 °C (-112392 °F)	-100200 °C (-148392 °F)
Response time %RH ¹²	12 s	12 s	15 s	18 s	15 s
Response time °C ¹³	80 s	180 s	180 s	170 s	-
Response time °C ¹⁴	120 s	190 s	210 s	210 s	200 s
Watterproof	No	No	Yes	Yes	No
Max. wind speed	5 m/s	50 m/s	50 m/s	50 m/s	70 m/s
Suitable for fine dust	No	No	>10 µm	Yes	No
General information	Fast response time	High temperature, fast response time, fast drying, mechanically robust	Standard filter	High chemical resistance, fine dust risistant, high temperature	High wind speed, abrasive environment, high mechanical protection
Application	Sterilization, H ₂ O ₂ , handheld devices	Meteo, agriculture, climatic chambers, storage rooms, cheese cellar	HVAC, office, storage rooms, laboratory, clean rooms	Cleanrooms, medical, injection chamber, meal manufacturing	HVAC with high wind speed, industrial applications

¹² T63: 100 %RH → 30 %RH

 $^{^{13}}$ PC carrier: 70 °C \rightarrow 23 °C

 $^{^{14}}$ Stainless steel carrier: 70 °C \rightarrow 23 °C

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

4 User configurable settings and functions

The HC2A probe ships configured as per the factory defaults:

- Users who intend to use the probe as a stand-alone analog device can use the probe as any conventional humidity and temperature probe. A connecting cable with active electronics may be required to power the probe. Most such users will never have to use the probe configurable settings and functions.
- Users who purchased a probe for use with another ROTRONIC instrument can also use the probe right away and do not necessarily have to use the probe configurable settings and functions
- Users that intend to use the probe as a stand-alone digital device typically need to use a connecting cable with active electronics and generally need to configure either the probe or the PC

Making use of the probe configurable settings and functions is entirely up to the user and the appropriate settings depend on the user application. We have provided below a short description of the probe functions and also indicated the factory default settings.

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

4.1 Function overview

MEASUREMENT ACCURACY AND RELIABILITY			
AirChip3000 Functions	Description		
► Humidity / temperature adjustment	 1-point or multi-point humidity calibration or adjustment 1-point or 2-point temperature calibration or adjustment Generate a time stamp for calibrations and adjustments 		
, , ,	 Retain and view last adjustment date and adjustment values Generate calibration and adjustment protocols 		
▶ Data recording	The data recording function differs from a true data logging function in the sense that the AirChip3000 does not time stamp the data. This data recording function can be used to investigate events such as a sensor malfunction as well as to retrieve data that would otherwise be lost. Start or stop data recording - up to 2000 value pairs (%RH and temperature). Starting a recording session erases all previously recorded data. The recording mode and log interval can be specified. When the probe is powered off, the recording session is paused but not ended. As long as the recording session has not been ended, the probe automatically resumes recording data when powered up again. The recorded data can be downloaded to a PC with the HW4 software, time stamped and viewed.		

MEASUREMENT LOOP VALIDATION		
AirChip3000 Functions	Description	
	Used to make the probe generate fixed values for the	
➤ Simulator mode	humidity, temperature and calculated parameter. Can be	
	configured, enabled or disabled.	

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

SAFEGUARDS		
AirChip3000 Functions Description		
► Device write protection	Used to protect the probe with a password to prevent unauthorized digital access by a digital user. Can be configured, enabled or disabled	

PROCESS PROTECTION / PROTECTION OF OTHER DEVICES		
AirChip3000 Functions Description		
► Out-of-limit value alarm	Used to specify the normal range for humidity, temperature and the calculated parameter depending on the user application. Can be configured, enabled or disabled. Out-of-limit values trigger a digital alarm	
▶ Bad sensor alarm	Built-in function. Cannot be disabled A bad humidity or temperature sensor triggers a digital alarm	
► Fail safe mode	Used to specify a "safe" fixed value for humidity and for temperature in the event of a sensor failure. Can be configured, enabled or disabled	

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

4.2 Factory default settings

Configurable Settings	Factory default
Unit system (Metric or English)	Metric
Psychrometric calculation	None
Output 1 parameter, scale and unit	Humidity: 0100%RH
Output 2 parameter, scale and unit	Temperature: -4060 °C
Communication protocol	RO-ASCII
RS-485 address	0
Device name	HC2A

Functions	Factory default
Humidity / temperature adjustment	Enabling / Disabling only by HW4 user rights possible
Device write protection	Disabled
Out-of-limit value digital alarm	Disabled
Data recording	Disabled
Fail safe mode	Disabled
Simulator mode	Disabled


For a detailed description of all AirChip3000 / probe main functions see document **E-T-AC3000-DF-V1.** Instructions regarding the configuration of the probe and access to its functions are provided in the following manuals:

- E-M-HW4v3-Main
- E-M-HW4v3-F2-001
- E-M-HW4v3-DR-001
- E-M-HW4v3-A2-001
- E-M-AC3000-CP

5 Mechanical installation

For best results, please observe the following guidelines:

- o Install the probe at a location where humidity, temperature and pressure conditions are representative of the environment or process to be measured. Avoid the following: (a) Close proximity of the probe to a heating element, a cooling coil, a cold or hot wall, direct exposure to sun rays, etc. (b) Close proximity of the probe to a steam injector, humidifier, direct exposure to precipitation, etc. (c) Unstable pressure conditions resulting from excessive air turbulence.
- When installing the probe on a wall, do not place the probe right above a heat producing device of instrument such as a transmitter or an Ethernet adapter (warm air tends to rise).
- If possible, choose a location that provides good air movement at the probe: air velocity of at least 1 meter/second (200 ft/ minute) facilitates adaptation of the probe to changing temperature.
- When installing the probe through a wall, immerse as much of the probe as possible in the environment to be measured.

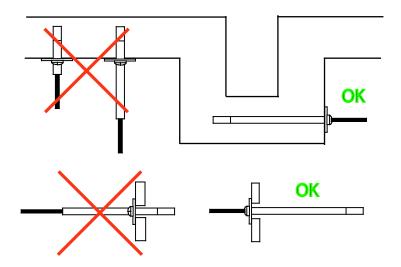

Position the probe so as to prevent the accumulation of condensation water at the level of the sensor leads. Install the probe so that the probe tip is looking downward. If this is not possible, install the probe horizontally.

Depending on the probe model, a probe holder (mounting flange with a compression fitting) can facilitate installation through a wall.

Future maintenance can be made easier by providing next to the probe a calibration access orifice. During maintenance, this permits the insertion of a reference probe (calibrator). The calibration access orifice should have the same size as the orifice used to install the probe and can be equipped with a probe holder.

HygroClip2 ADVANCED	ro tronic	
E-M-HC2A-V1_0.docx	Manual	

6 Electrical installation

This section describes the general safety precautions for electric wiring.

6.1 General connection information

Heavy machinery and instrumentation should not share the same power supply wiring. If this cannot be avoided, noise filters and surge protectors should be used. Most UPS devices have those features already integrated.

6.2 Signal cable information

The following guidelines are derived from the European standard EN 50170 for the transmission of signals by copper wires. Note on installation planning: when determining the position of machinery and equipment, the rules given in EN 50170 should be followed with due regard to local circumstances.

Whenever the level of electromagnetic interference is expected to be high, both the instruments and signal cables should be placed as far away as possible from the source of interference.

In general, signal cables should be installed in bundles or channels / conduits, separate from other cables as indicated in the table below:

0	Bus signals such as RS485	
0	Data signals for PCs, printers etc.	
0	shielded analog inputs	
0	unshielded direct current (<= 60V)	in common bundles or channels / conduits
0	shielded process signals (<= 25 V)	
0	unshielded alternate current (<= 25V)	
0	coaxial cables for CRT monitors	
0	direct current from 60 V to 400 V	
	(unshielded)	in separated bundles or channels /
0	alternate current from 25V to 400 V	conduits, without minimum distance
	(unshielded)	
0	direct and alternate current > 400 V	
	(unshielded)	in separated bundles or channels /
0	Telephone lines	conduits, without minimum distance
0	lines leading into EX-rated areas	

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

6.3 Analog signal wiring

Preferably use a shielded cable to connect the analog outputs of the HC2A to other devices. The maximum cable length is determined by the maximum error that the user will accept. This can be calculated as follows:

Error (V) = cable resistance x current through load

6.4 Digital signal wiring

Use one of the available connecting cables (see Accessories) to connect the UART digital interface of the HC2A probe to other devices. Without a signal booster, the maximum cable length should not exceed 5 m (16 ft).

6.5 Grounding

In the case of a fixed installation, ground the HC2A probe, especially if the electronics will be subjected to a low humidity environment (35 %RH or less). The power supply and digital ground (GND) and the analog ground (AGND) should be tied separately to a proper ground so as to avoid spikes in the analog signals.


HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

7 Operation

The HC2A probes are compatible with a large number of indicators, data loggers and transmitters from ROTRONIC. Operating instructions are provided in each device manual. The HC2A probes can also be used as a conventional analog probe. See Accessories, supply voltage adapters, connectors and cables. Use the HW4 software to configure the probe as desired, complete the mechanical and electrical installation and power up the probe.

7.1 Minimum load requirements for the probe voltage outputs

In the situation where the external device uses an internal pull-up resistor the value of this resistor should meet the requirements shown below. It is also necessary to add a pull-down resistor RL connected to ground in order to be able to read 100% of the range of the probe voltage output.

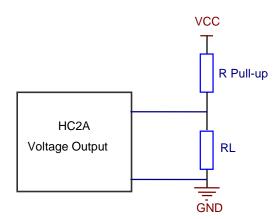

HC2A signal	VCC	R pull-up	RL
01V	3.3V	≥250 kOhm	1 kOhm
01V	5.0V	≥400 kOhm	1 kOhm
01V	10.0V	≥1 MOhm	1 kOhm


HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

7.2 Connectivity examples for stand-alone probes

Stand-alone operation as a digital probe (PC or network)

The HC2A probes can be connected to a PC or to an Ethernet network with one of the available digital interface adapters (see Accessories). Probe configuration and full access to all probe functions requires a PC with the ROTRONIC HW4 software installed. When using the standard RO-ASCII protocol, access to some of the probe functions is also possible without HW4. For details, see document **E-M-AC3000-CP**.

Digital connection example: RS-485 network

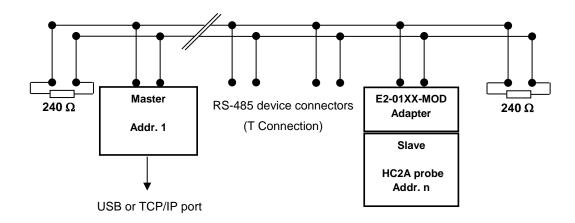


Note:

- The master device can be either a transmitter such as the HF5 (USB or TCP/IP interface) or an adapter such as the AC3010 cable (USB)
- Power to the combination E2-01XX-MOD and HC2A probe can be provided by an individual AC adapter or by a central voltage source connected to the RS-485 network (requires cables with 2 twisted pairs: one for the data, the other for power)

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

Analog connection example:

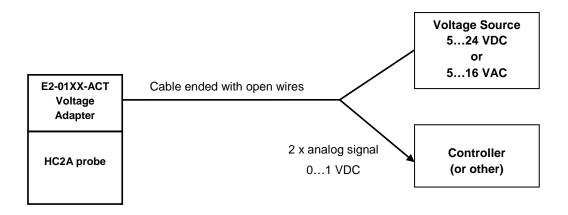

7.3 Hand-held probes used with an indicator

The most common source of error when measuring relative humidity with a hand-held probe is a difference between the temperature of the probe and the temperature of the environment. At a humidity condition of 50 %RH, a temperature difference of 1°C (1.8 °F) typically results in an error of 3 %RH on relative humidity.

When using a humidity probe with a portable indicator, it is good practice to monitor the display for temperature stability. When moving the probe from one area to another, the probe should be given sufficient time to equilibrate with the environment to be measured. This time can be shortened, and errors avoided, by using the probe configuration that fits best for your application.

In extreme situations, condensation may occur on the sensors when the probe is colder than the environment. As long as the humidity / temperature limits of the humidity sensor are not exceeded, condensation does not alter the calibration of the sensor. However, the sensor has to dry out before it can provide a valid measurement.

Non-moving air is an excellent insulator. When there is no air movement, surprising differences in temperature and humidity can noted over short distances. Air movement at the probe generally results in measurements that are both faster and more accurate.

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

8 Maintenance

8.1 Cleaning or replacing the dust filter

Depending on the conditions of measurement, the filter should be checked from time to time. Corroded, discolored or clogged filters should be replaced.

8.2 Periodic calibration check

Both the Pt 100 RTD temperature sensor and associated electronics are very stable and should not require any calibration after the initial factory adjustment.

Long term stability of the ROTRONIC HYGROMER® humidity sensor is typically better than 1 %RH per year. For maximum accuracy, calibration of the probe should be verified every 6 to 12 months. Applications where the probe is exposed to contaminants may require more frequent verifications. Calibration and adjustment of the HC2A probe can be done with either a PC with the HW4 software installed or with the HP23 hand-held calibrator. For connecting the HC2A probe to a PC, use a digital adapter cable AC3001 (see document **E-M-HC2-accessories**).

Procedure for adjusting the HC2A probe with the ROTRONIC HW4 software:

- o Connect the HC2A probe to the HW4 PC as explained in the HW4 manual E-M-HW4v3-Main
- o Start HW4 software on the PC and search for the HC2A probe.
- After finding the HC2A probe with HW4, expand the device tree to see the HC2A probe functions and select **Probe Adjustment**.
- o For further instructions see HW4 manual E-M-HW4v3-A2-001

8.3 Validation of the output signals transmission

If so desired, transmission of the HC2A probe output signals can be validated by using the probe simulator function. The HW4 software is required to enable and configure this function. When the function is enabled the probe generates digital and analog signals corresponding to values specified by the user.

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

9 Firmware updates

Firmware updates will be available on the ROTRONIC website for downloading. For connecting the HC2A probe to a PC, use a digital adapter cable AC3001 (see document **E-M-HC2-accessories**).

Procedure for updating the firmware:

- o Connect the HC2A probe to the HW4 PC as explained in the HW4 manual **E-M-HW4v3-Main**
- o Copy the firmware update file from the ROTRONIC website to the PC.
- o Start HW4 software on the PC and search for the HC2A probe.
- After finding the HC2A probe, expand the device tree to see the HC2A probe functions. Select Device
 Manager. In the Device Manager menu bar select Tools > Firmware Update. For instructions see
 document E-M-HW4v3-F2-001.

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

10 Technical data

General	
Device type	Humidity temperature probe
Mechanical configuration	See models
IP protection class	IP65

Power supply and connections	
Supply voltage (VDD)	3.35 VDC ±0%
Nominal current consumption	<4.5 mA
Maximum start-up current unlimited	<50mA during 2μs
Minimum start-up current	8 mA during 2ms and 5 mA during 2s
Maximum current spike during operation	1 mA during maximum 2μs
Polarity protection	Mechanical only (keyed connector)

Humidity measurement	
Sensor	ROTRONIC HYGROMER® HT-1
Measuring range	0100 %RH
Measurement accuracy	±0.8 %RH, at 1030 °C (HC2A-S(3), HC2A-IC, HC2A-IM, HC2A-IE) ±0.5 %RH, at 1030 °C / 1090 %RH (HC2A-S(3)H)
Repeatability	0.3 %RH
Long term stability	<1 %RH / year
Sensor time constant	Typical 10 sec, 63% of a 35 to 80 %RH step change (1m/sec air flow at sensor)

Temperature measurement		
Sensor	Pt100 RTD, IEC 751 1/3 class E	3
Measuring range	-100190 / 200 °C ¹⁵ (see also	environmental limits)
	±0.1 °C, at 1030 °C	
Measurement accuracy	±0.3 °C, at 1030 °C	(HC2A-C04, HC2A-C05; see also
	§10.3)	
Repeatability	0.05 °C	
Long term stability	<0.1 °C / year	
Sensor time constant	Typical 4 sec, 63 %RH of a step	o change (1 m/sec air flow at sensor)

 $^{^{15}}$ The peak load at 200 °C is 100 h. See the sensor data sheet for detailed information on the pollution loads for the sensor.

.

HygroClip2 ADVANCED



E-M-HC2A-V1_0.docx

Manual

Calculated parameters	
Psychrometric calculations	Dew or frost point (user configurable)

Start-up time and data refresh rate	
Start-up time	1.5 s (typical)
Data refresh rate	1.0 s (typical) – when not calculating any parameter

Configurable analog outputs	
Output 1 Can be made to correspond to any parameter	
Factory default param	eter Relative humidity
Factory default scale	0100 %RH
Output 2	Can be made to correspond to any parameter
Factory default param	eter Temperature
Factory default scale	-4060 °C
Output 1 and Output 2	
Signal type	01 V
User configurable sca	ling limits -999.99 9999.99 engineering units
Offset at 0 V	+3 mV (maximum)
Ripple	<1.2 mV/x 2µs
Short circuit tolerant	Yes
Internal resistance	<10 Ω
Minimum external load	1000 Ω
Deviation from digital	signal <±1 mV from 0.002 to 1.0 V / + 2 mV from 0.0 to 0.002 V

Digital interface		
Interface type	UART (Universal Asynchronous Receiver Transmitter)	
Organization	Dialog, duplex	
	Baud rate : 19200	
	Parity: none	
Default configuration	Data bits: 8	
	Stop bits: 1	
	Flow Control : none	
Tolerance	3 %	
Baud rate configuration:	No	
Logical levels	Logical 0: ≤ 0.3V * VDD	
	Logical 1: ≥ 0.8V * VDD	
Maximum cable length	5 m (16.4 ft) w/o signal booster	

HygroClip2 ADVANCED



E-M-HC2A-V1_0.docx Manual

General specifications	
Housing material	See Models
Collar material (connector)	Stainless steel, DIN 1.4301
Dust filter material	See Models
Protection grade	IP65
Physical dimensions	See Models
Weight	See Models

Conformity to standards	
	EMC Directive:
	20.04.2016: 2014/30/EU
CE / EMC immunity	EN 61000-6-1: 2007, EN 61000-6-2: 2005
	EN 61000-6-3: 2007+A1:2011+AC:2012, EN 61000-6-4: 2007+A1:2011
	Performance criterion: www.rotronic.com
Solder type	Lead free (RoHS directive 2011/65/EU)
FDA / GAMP directives	compatible

Environmental limits	
Storage and transit	-50+100 °C / 0100 %RH, non condensing
Operating limits at electronics	-50 +100 °C
Operating limits at electronics	0100 %RH, non condensing
Temperature limits at sensor	See Models
	The sensor withstands 93 °Cdp. This results in the following conditions:
	100 %RH up to 93 °C (203 °F)
Maximum humidity at sensor	78 %RH at 100 °C (212 °F)
	34 %RH at 125 °C (260 °F)
	17 %RH at 150 °C (302 °F)
Maximum air velocity at probe	20 m/s (3,935 ft /min)
Critical environments	Humidity sensor: as per DV04-14.0803.02 - Critical chemicals

HygroClip2 ADVANCED	rotronic
E-M-HC2A-V1_0.docx	Manual

11 Accessories and parts

For accessories and parts such as the HW4 configuration software, extension cables, adapter cables, calibration accessories and spare dust filters, please see document **E-M-HC2-accessories**

HygroClip2 ADVANCED	ro tronic
E-M-HC2A-V1_0.docx	Manual

12 Supporting documents

Document File Name	Contents
E-M-HC2-accessories	Accessories and parts for probes, indicators and transmitters
E-T-AC3000-DF-V1	AirChip3000 Description and Main Functions
E-M-HW4v3-DIR	List of the HW4 manuals
E-M-HW4v3-Main	HW4 software version 3: General instructions and functions common to all devices
E-M-HW4v3-F2-001	HW4 software version 3: HC2A probe series
L III 1111440 1 2 001	Device configuration and AirChip3000 functions
E-M-HW4v3-A2-001	HW4 software version 3: Probe Adjustment function AirChip3000 devices
E-M-HW4v3-DR-001	HW4 software version 3: Data Recording Function AirChip3000 Devices
E-M-AC3000-CP	AirChip3000 Communication Protocol
E-M-CalBasics	Temperature and humidity adjustment basics
E III Gaisaoido	Instructions for using the ROTRONIC humidity standards
E-T-HumiDefs	Humidity Definitions

HygroClip2 ADVANCED		ro tronic	
	E-M-HC2A-V1_0.docx	Manual	

13 Document releases

Doc. Release	Date	Notes
V1_0	August 2016	Original release