

HONEYWELL BW™ ICON AND BW™ ICON+ QUICK REFERENCE GUIDE



Honeywell

HONEYWELL BW™ ICON AND BW™ ICON+ PORTABLE MULTIPLE GAS DETECTORS

The Honeywell BW™ Icon & BW™ Icon+ gas detectors warn of hazardous gas at levels above user-defined alarm setpoints.

These detectors can monitor up to four gases at a time. Refer to the Honeywell BW™ Icon User Manual for the full list of gases.



USER INTERFACE



Alarm One - Shows when alarm one is breached and gas highlighted next to sensor



Alarm Two - Shows when alarm two is breached. Alarm two will overwrite any alarm one status

TWA

Time Weighted Average - Settable in Safety Suite DC for each toxic sensor

STEL

Short Term Exposure Limit - Settable in Safety Suite DC for each toxic sensor



Bump - Shows when bump is due and you can configure to have a count down



Calibration - Shows when calibration is due and you can configure to have a count down



Battery status - Shows battery status and when on charge will show charging status





Bluetooth® - All devices have Bluetooth, double click to enter menu for search mode

WHAT'S IN THE BOX

- Honeywell BW™ Icon gas detector
- Battery (factory-installed)
- USB charger
- 1 Calibration cap
- Quick Reference Guide
- Tubing
- 1 Klick Fast stud


OVERVIEW

- 1 LED Alarm
- 2 IntelliFlash
- 3 Display
- 4 Button
- 5 Beeper
- 6 Sensor
- 7 Clip
- 8 Battery
- 9 Charging Port

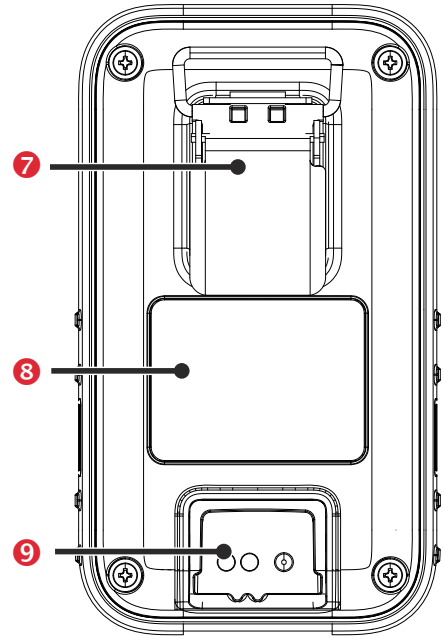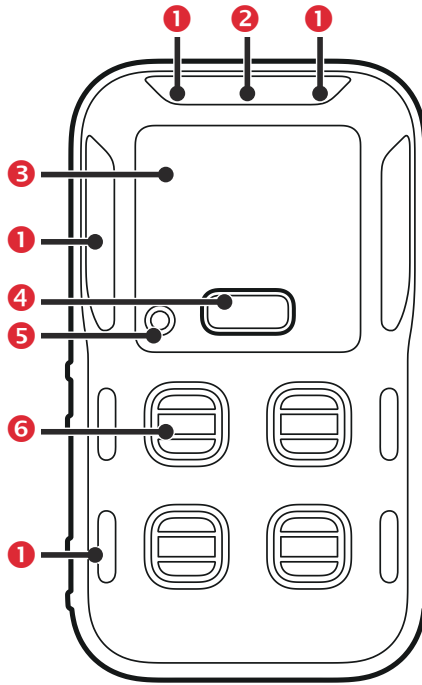

COMMON DEVICE OPERATIONS

Power On	4-second hold
Power Off	4-second hold
Enter and Exit Menus	Double-press
Select Next	Single-press
Initiate Selected	3-second hold
Acknowledge Latched Alarm	1-second hold

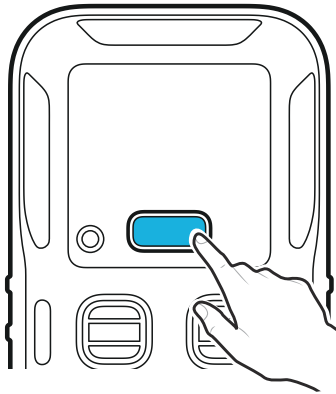

IMPORTANT

Read the User Manual for complete information on the BW™ Icon operation.


BUMP TEST AND CALIBRATION VIA A MOBILE DEVICE

1 Turn on the BW™ Icon

Place the cap over the detector, and then press down on both tabs to snap it into place




2 Attach the hose

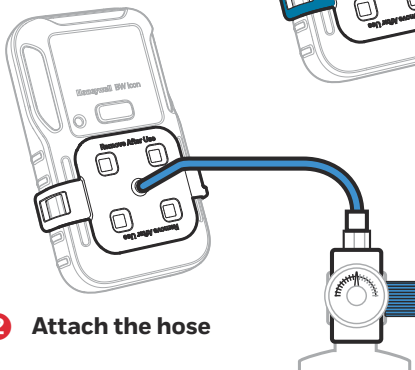


3 In your mobile device, open the **Device Configurator** app





4 In your BW™ Icon:

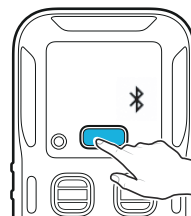- Double press to enter the menu
- Single press until the BLE icon  is displayed
- Hold press 3 secs to initiate the pairing mode



5 In the Device list screen from the **Device Configurator** app, select the BW Icon Serial Number to start pairing. The upper LED and the BLE icon will light in green after pairing success

6 In your Mobile device:

- Tap on the Menu button 
- Select Remote Calibration or Bump 
- Follow on-screen instructions

7 The process is complete when the results are displayed on your mobile device. You can now remove the cap by pulling on the tabs

SAFETY CERTIFICATIONS

IECEX: IECEX SIR 20.0020X

Ex ia op is I Ma Ex ia op is IIC T4 Ga, $-40^{\circ}\text{C} \leq \text{Tamb} \leq 60^{\circ}\text{C}$ (with IR sensor installed)
Ex ia I Ma Ex ia IIC T4 Ga, $-40^{\circ}\text{C} \leq \text{Tamb} \leq 60^{\circ}\text{C}$

North America: CSA 20CA80028223X CSA C22.2 No.60079-29-1 UL60079-29-1


Class I, Division 1, Group A,B,C,D, T4;
Class I, Zone O, AEx ia op is IIC T4 Ga; Ex ia op is IIC T4 Ga (With IR sensor installed)
Class I, Division 1, Group A,B,C,D, T4;
Class I, Zone O, AEx ia IIC T4 Ga; Ex ia IIC T4 Ga

ATEX: Sira 20ATEX2012X

Ex I M1 Ex ia op is I Ma, $-40^{\circ}\text{C} \leq \text{Tamb} \leq 60^{\circ}\text{C}$ (with IR sensor installed)
Ex II 1G Ex ia op is IIC T4 Ga, $-40^{\circ}\text{C} \leq \text{Tamb} \leq 60^{\circ}\text{C}$ (with IR sensor installed)
Ex I M1 Ex ia I Ma, $-40^{\circ}\text{C} \leq \text{Tamb} \leq 60^{\circ}\text{C}$
Ex II 1G Ex ia IIC T4 Ga, $-40^{\circ}\text{C} \leq \text{Tamb} \leq 60^{\circ}\text{C}$
RED: RE-D Directive 2014/53/EU
EMC: Directive 2014/30/EU
ROHS Directive (EU) 2015/863 amending 2011/65/EU

IP: IP66, IP68 (1.2 meters for 45 minutes)

Contains FCC ID: SU3RMBLED
Contains IC: 20969-RMBLED
CAN ICES-3(A)/NMB-3(A)

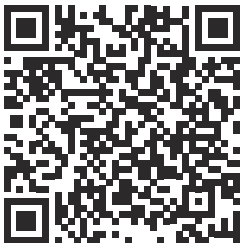

Europe, Middle East, Africa

Life Safety Distribution GmbH
Toll-Free 00800 333 222 44
Middle East +971 4 450 5800
Middle East +971 4 450 5852
(Portable Gas Detection)
gasdetection@honeywell.com

Americas

Honeywell Analytics
Distribution Inc.
Tel: +1 847 955 8200
Toll free: +1 800 538 0363
detectgas@honeywell.com
gasdetection@honeywell.com
www.honeywellanalytics.com

Asia Pacific

Honeywell Analytics Asia Pacific
Tel: +82 (0) 2 6909 0300
India Tel: +91 124 4752700
analytics.ap@honeywell.com

Technical Services

EMEA: HAexpert@honeywell.com
US/CA: ha.us.service@honeywell.com
AP: ha.ap.service@honeywell.com



CAUTION

- The detector is a personal safety device. It is your responsibility to respond properly to the alarm.
- For safety reasons, this equipment must be operated and serviced by qualified personnel only.
- The lithium battery in this product presents a risk of fire, explosion, and chemical burn if misused. Do not disassemble, incinerate, or heat above 212°F (100°C). Batteries exposed to heat at 266°F (130°C) for 10 minutes can cause fire and explosion. Batteries must only be charged in a safe area free of hazardous gas.
- Deactivating the detector by removing the battery pack may cause improper operation and harm the detector.
- Use only Honeywell approved battery chargers such as the vehicle Charger.
- Do not use the apparatus if it is damaged. Inspect the apparatus before use. Look for cracks and missing parts.

THE
FUTURE
IS
WHAT
WE
MAKE IT

Honeywell