


FIBER OPTIC TRANSMITTING MODULE

TOTX170

FIBER OPTIC TRANSMITTING MODULE FOR
SIMPLEX DIGITAL SIGNAL TRANSMISSION

Unit in mm

- Data rate : DC to 6 Mb/s (NRZ code)
- Transmission distance : Up to 1000 m
- TTL interface
- LED is driven by Differential cuicuit

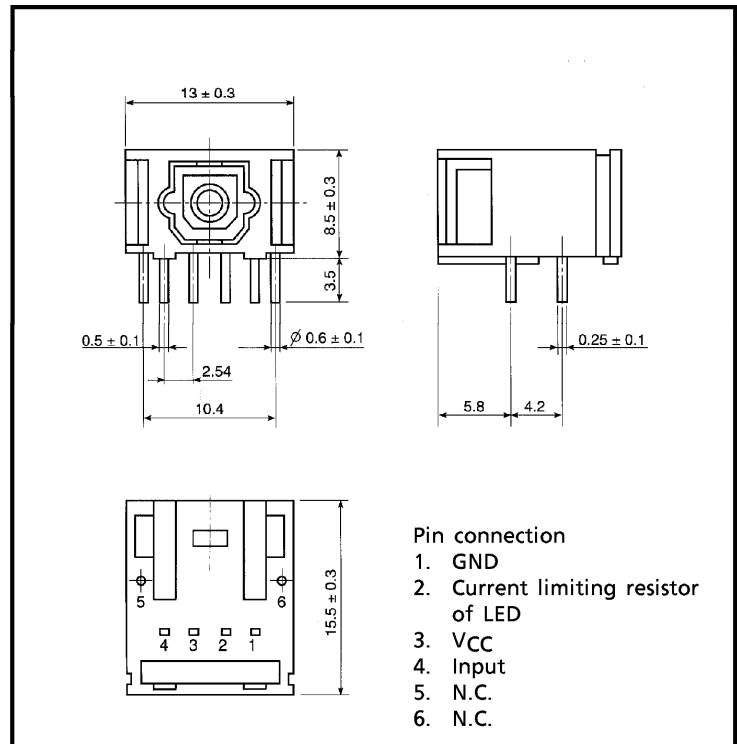

1. Maximum Ratings (Ta = 25°C)

| PARAMETER | SYMBOL | RATING | UNIT |
|-----------------------|------------------|-------------------------------|------|
| Storage Temperature | T _{stg} | -40 to 70 | °C |
| Operating Temperature | T _{opr} | -40 to 70 | °C |
| Supply Voltage | V _{CC} | -0.5 to 7 | V |
| Input Voltage | V _{IN} | -0.5 to V _{CC} + 0.5 | V |
| Soldering Temperature | T _{sol} | 260 ⁽¹⁾ | °C |

Note ⁽¹⁾ Soldering time ≤ 3 s (More than 1 mm apart from the package).

Handling precaution : The LEDs used in this product contain GaAs (Gallium Arsenide). Care must be taken to protect the safety of people and the environment when scrapping or terminal processing.

961001EAC1

- TOSHIBA is continually working to improve the quality and the reliability of its products. Nevertheless, semiconductor devices in general can malfunction or fail due to their inherent electrical sensitivity and vulnerability to physical stress. It is the responsibility of the buyer, when utilizing TOSHIBA products, to observe standards of safety, and to avoid situations in which a malfunction or failure of a TOSHIBA product could cause loss of human life, bodily injury or damage to property. In developing your designs, please ensure that TOSHIBA products are used within specified operating ranges as set forth in the most recent products specifications. Also, please keep in mind the precautions and conditions set forth in the TOSHIBA Semiconductor Reliability Handbook.
- Gallium arsenide (GaAs) is a substance used in the products described in this document. GaAs dust and fumes are toxic. Do not break, cut or pulverize the product, or use chemicals to dissolve them. When disposing of the products, follow the appropriate regulations. Do not dispose of the products with other industrial waste or with domestic garbage.
- The information contained herein is presented only as a guide for the applications of our products. No responsibility is assumed by TOSHIBA CORPORATION for any infringements of intellectual property or other rights of the third parties which may result from its use. No license is granted by implication or otherwise under any intellectual property or other rights of TOSHIBA CORPORATION or others.
- The information contained herein is subject to change without notice.

2. Recommended Operating Conditions

| PARAMETER | SYMBOL | MIN | TYP. | MAX | UNIT |
|--------------------------|----------|------|------|----------|------|
| Supply Voltage | V_{CC} | 4.75 | 5.0 | 5.25 | V |
| High Level Input Voltage | V_{IH} | 2.0 | — | V_{CC} | V |
| Low Level Input Voltage | V_{IL} | 0 | — | 0.8 | V |

3. Electrical and Optical Characteristics ($T_a = 25^\circ\text{C}$, $V_{CC} = 5\text{ V}$)

| PARAMETER | SYMBOL | CONDITION | MIN | TYP. | MAX | UNIT |
|---------------------------------------|-------------|---|-----|------|------|---------------|
| Data Rate | | NRZ Code ⁽²⁾ | DC | — | 6 | Mb/s |
| Transmission Distance | | Using PCF ⁽³⁾ , TORX170 | 0.2 | — | 1000 | m |
| | | Using PCF ⁽⁴⁾ , TORX170 | 0.2 | — | 800 | — |
| Pulse Width Distortion ⁽⁵⁾ | Δtw | Using TORX170 Pulse width 165 ns Pulse cycle 330 ns, $C_L = 10\text{ pF}$ | −55 | — | 55 | ns |
| Fiber Output Power | P_f | PCF 2 m, $R = 0\ \Omega$ ⁽⁶⁾ | −20 | — | −14 | dBm |
| Peak Emission Wavelength | λ_p | | — | 800 | — | nm |
| Current Consumption | I_{CC} | $R = 0\ \Omega$ | — | 67 | 85 | mA |
| High Level Input Voltage | V_{IH} | | 2.0 | — | — | V |
| Low Level Input Voltage | V_{IL} | | — | — | 0.8 | V |
| High Level Input Current | I_{IH} | $V_I = 2.7\text{ V}$ | — | — | 20 | μA |
| Low Level Input Current | I_{IL} | $V_I = 0.4\text{ V}$ | — | — | −0.4 | mA |

⁽²⁾ LED is on when input signal is high level, it is off when low level.

For data rate $> 3\text{ Mb/s}$, the duty factor must be kept 25 to 75%.


⁽³⁾ TOCP100Q-□□B, TOCP150Q-□□B, TOCP100X-□□B, TOCP150X-□□B

⁽⁴⁾ CF-1071 series


⁽⁵⁾ Between input of TOTX170 and output of TORX170.

⁽⁶⁾ Measure with a standard optical fiber with fiber optic connectors. Valued by peak.

4. Example of Typical Characteristics ⁽⁷⁾

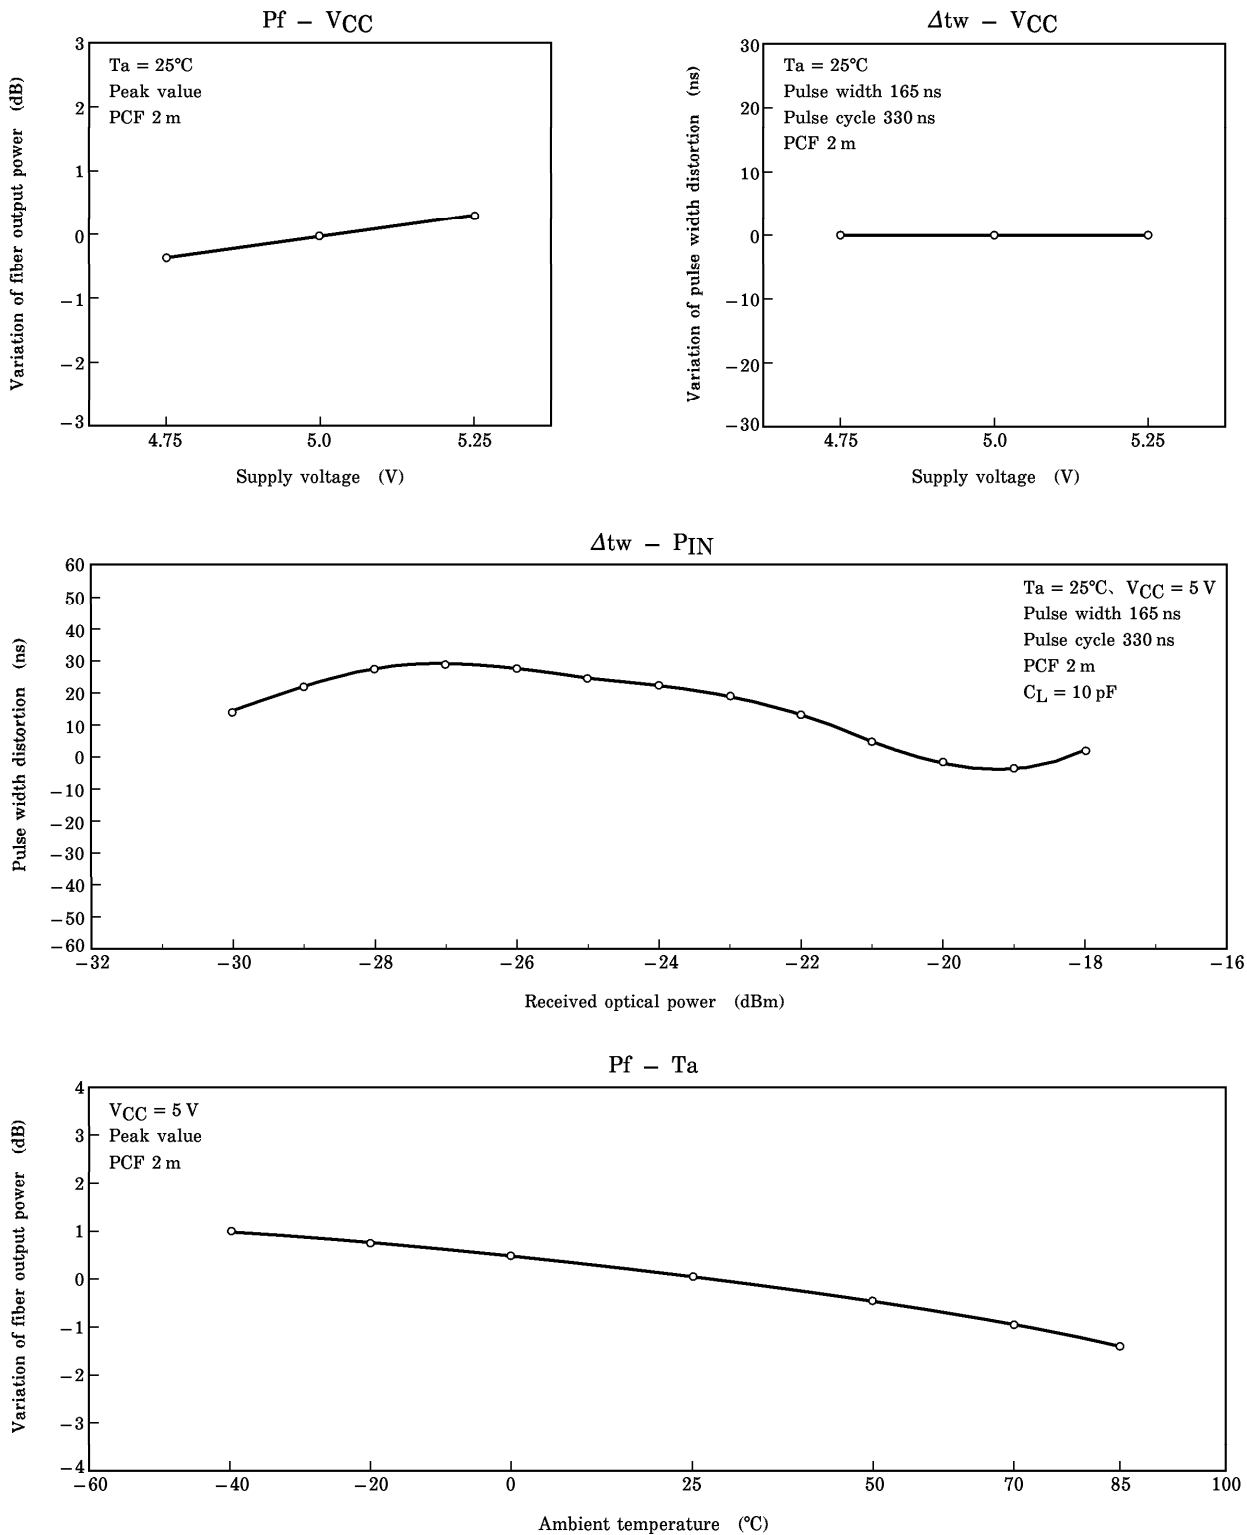


Note. ⁽⁷⁾ There give characteristic examples, and its values are not guaranteed.

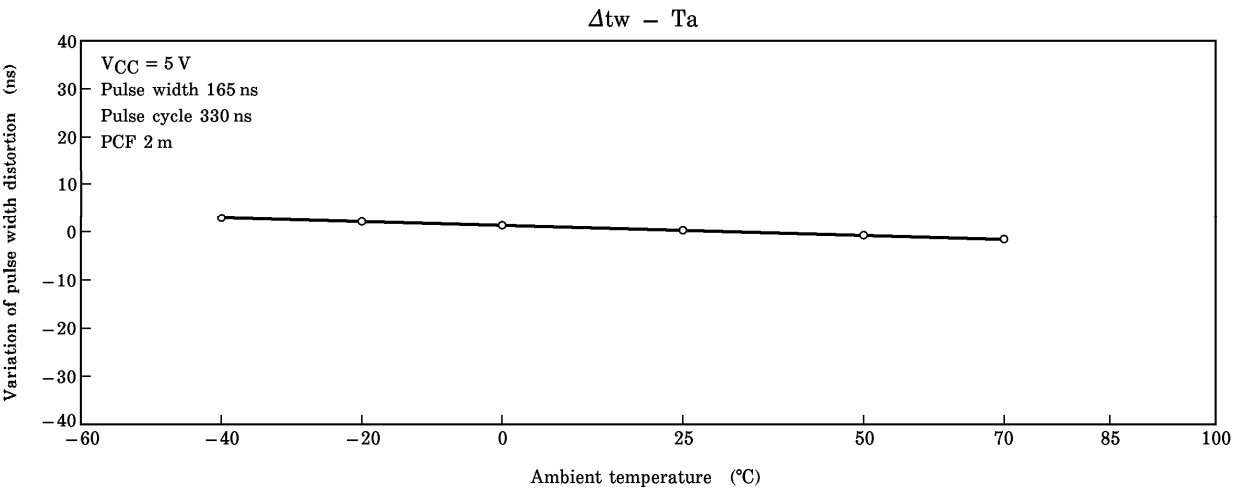

Note. ⁽⁷⁾ There give characteristic examples, and its values are not guaranteed.

5. Application Circuit

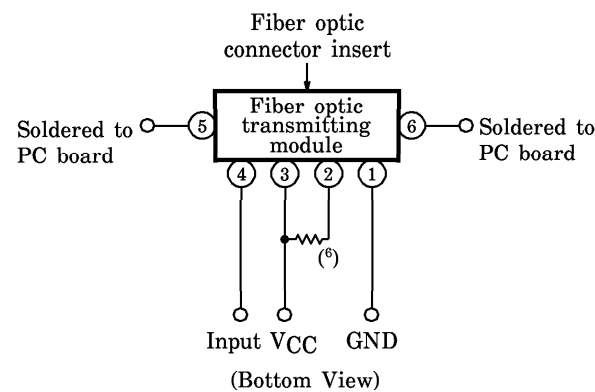

Note (6) Select a resistor value as follows :

| FIBER OPTIC CONNECTOR TYPE NAME | TRANSMISSION DISTANCE (m) | RESISTOR (Ω) |
|--|------------------------------|-----------------|
| TOCP100Q-□□B / 150Q-□□B TOCP100X-□□B / 150X-□□B | 0.2 to 350 | 5.1 k |
| | 350 to 700 | 2.2k |
| | 700 to 1000 | 510 |
| CF-1071 series | 0.2 to 200 | 5.1 k |
| | 200 to 500 | 2.4 k |
| | 500 to 800 | 1.0 k |

6. Applicable Optical Fiber with Fiber Optic Connectors

TOCP100Q-□□B, TOCP150Q-□□B, TOCP100X-□□B, TOCP150X-□□B
CF-1071 series

7. Precaution on Use

(1) Maximum rating

The maximum ratings are the limit values which must not be exceeded during operation of device. None of these rating value must not be exceeded. If the maximum rating value is exceeded, the characteristics of devices may never be restored properly. In extreme cases, the device may be permanently damages.

(2) Lifetime of light emitters

If an optical module is used for a long period of time, degeneration in the characteristics will mostly be due to a lowering of the fiber output power (Pf). This is caused by the degradation of the optical output of the LEDs used as the light source. The cause of degradation of the optical output of the LEDs may be defects in wafer crystallization or mold resin stress. The detailed causes are, however, not clear.

The lifetime of light emitters is greatly influenced by the operating conditions and the environment in which it is used as well as by the lifetime characteristics unique to the device type. Thus, when a light emitting device and its operating conditions determined, Toshiba recommend that lifetime characteristics be checked.

Depending on the environment conditions, Toshiba recommend that maintenance such as regular checks of the amount of optical output in accordance with the condition of operating environment.

(3) Soldering

Optical modules are comprised of internal semiconductor devices. However, in principle, optical modules are optical components. During soldering, ensure that flux does not contact with the emitting surface or the detecting surface. Also ensure that proper flux removal is conducted after soldering.

Some optical modules come with a protective cap. The protective cap is used to avoid malfunction when the optical module is not in use. Note that it is not dust or waterproof. As mentioned before, optical modules are optical components. Thus, in principle, soldering where there may be flux residue and flux removal after soldering is not recommended. Toshiba recommend that soldering be performed without the optical module mounted on the board. Then, after the board has been cleaned, the optical module should be soldered on to the board manually.

If the optical module cannot be soldered manually, use non-halogen (chlorine-free) flux and make sure, without cleaning, there is no residue such as chlorine. This is one of the ways to eliminate the effects of flux. In such a cases, be sure to check the devices' reliability.

(4) Vibration and shock

This module is plastic sealed and has its wire fixed by resin. This structure is relatively resistant to vibration and shock. In actual equipment, there are sometime cases in which vibration, shock, or stress is applied to soldered parts or connected parts, resulting in lines cut. A care must be taken in the design of equipment which will be subject to high levels of vibration.

(5) Attaching the fiber optic transmitting module

Solder the fixed pins (pins 4 and 5) of the fiber optic transmitting module TOTX170 to the printed circuit board in order to fix it to the board.

(6) Solvent

When using solvent for flux removal, do not use a high acid or high alkali solvent. Be careful not to pour solvent in to the optical connector ports. If solvent is inadvertently poured in to them, clean it off using cotton tips.

(7) Protective cap

When the TOTX170 is not in use, attach the protective cap.

(8) Supply voltage

Use the supply voltage within the recommended operating condition ($V_{CC} = 5 \pm 0.25 \text{ V}$). Make sure that supply voltage does not exceed the maximum rating value of 7 V, even for an instant.

(9) Input voltage

If a voltage exceeding the maximum rating value ($V_{CC} + 0.5 \text{ V}$) is applied to the transmitter input, the internal IC may suffer damage. If there is a possibility that excessive voltage due to surges may be added to the input terminal, insert a protective circuit.

(10) Soldering condition

Solder at 260°C or less for no more than three seconds.

(11) Precautions when disposing of devices and packing materials.

When disposing devices and packing materials, follow the procedures stipulated by local regulations in order to protect the environment against contamination.

Compound semiconductors such as GaAs are used as LED materials in this module. When devices are disposed of, worker safety and protection of the environment must be taken into account.

(12) Precautions during use

Toshiba is continually working to improve the quality and the reliability of their products. Nevertheless, semiconductor devices in general can malfunction or fail due to their inherent electrical sensitivity and their vulnerability to physical stress. It is the responsibility of the buyer, when utilizing Toshiba products, to observe standards of safety, and to avoid situations in which the malfunction or failure of a Toshiba product could cause loss of human life, bodily injury or damage to property.

When developing equipment, please ensure that Toshiba products are used within the specified operating ranges set forth in the most recent product specifications. Also, please keep in mind the precautions and conditions set forth in the Toshiba Semiconductor Reliability Handbook.