LZ2363B/ LZ2364BJ

1/3-type CCD Area Sensors with 470 k Pixels

DESCRIPTION

The LZ2363B/LZ2364BJ are 1/3-type (6.0 mm) solid-state image sensors that consist of PN photodiodes and CCDs (charge-coupled devices). With approximately 470 000 pixels (795 horizontal x 595 vertical), the sensor provides a stable high-resolution color (LZ2363B)/B/W (LZ2364BJ) image.

FEATURES

• Number of effective pixels: 752 (H) x 582 (V)

Number of optical black pixels

Horizontal: 3 front and 40 rearVertical: 11 front and 2 rear


 \bullet Pixel pitch : 6.5 μm (H) x 6.3 μm (V)

- Mg, G, Cy, and Ye complementary color filters (For LZ2363B)
- · Low fixed-pattern noise and lag
- · No burn-in and no image distortion
- · Blooming suppression structure
- Built-in output amplifier
- Variable electronic shutter (1/50 to 1/10 000 s)
- Compatible with PAL standard (LZ2363B)/ CCIR standard (LZ2364BJ)
- Package :

16-pin half-pitch WDIP [Ceramic] (WDIP016-N-0450)

Row space: 11.43 mm

PIN CONNECTIONS

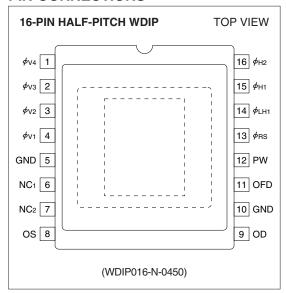

PRECAUTIONS

- The exit pupil position of lens should be more than 25 mm (LZ2363B)/20 mm (LZ2364BJ) from the top surface of the CCD.
- Refer to "PRECAUTIONS FOR CCD AREA SENSORS" for details.

COMPARISON TABLE

	LZ2363B	LZ2364BJ				
TV standard	PAL standard (Color)	CCIR standard (B/W)				
Characteristics	Refer to each following specification.					

PIN DESCRIPTION

SYMBOL	PIN NAME
OD	Output transistor drain
OS	Output signals
∮ RS	Reset transistor clock
φν1, φν2, φν3, φν4	Vertical shift register clock
φH1, φH2	Horizontal shift register clock
ϕ LH1	Horizontal shift register final stage clock
OFD	Overflow drain
PW	P-well
GND	Ground
NC1, NC2	No connection

ABSOLUTE MAXIMUM RATINGS

 $(TA = +25 \, ^{\circ}C)$

PARAMETER	SYMBOL	RATING	UNIT	NOTE
Output transistor drain voltage	Vod	0 to +18	V	
Overflow drain voltage	Vofd	0 to +55	V	
Reset gate clock voltage	V∳RS	-0.3 to +18	V	
Vertical shift register clock voltage	V_{ϕ} V	V _{PW} to +18	V	
Horizontal shift register clock voltage	V∳H	-0.3 to +18	V	
Horizontal shift register final stage clock voltage	V∳LH	-0.3 to +18	V	
Voltage difference between P-well and vertical clock	V PW -V ∮V	-28 to 0	V	1
Storage temperature	Тѕтс	-40 to +85	°C	
Ambient operating temperature	Topr	−20 to +70	°C	

NOTE:

^{1.} The OFD clock ϕ OFD is excluded.

RECOMMENDED OPERATING CONDITIONS

P.	ARAMETER	SYMBOL	MIN.	TYP.	MAX.	UNIT	NOTE
Ambient operating	g temperature	Topr		25.0		°C	
Output transistor	drain voltage	Vod	14.5	15.0	16.0	V	
Overflow drain	When DC is applied	Vofd	5.0		19.0	V	1
voltage	When pulse is applied p-p level	V∳OFD	21.5			V	2
Ground		GND		0.0		V	
P-well voltage		VPW	-10.0		V∳VL	V	
	LOW level	Vøv1L, Vøv2L Vøv3L, Vøv4L	-9.5	-9.0	-7.5	٧	
Vertical shift register clock	INTERMEDIATE level	VøV11, VøV21 VøV31, VøV41		0.0		V	
	HIGH level	V∳V1H, V∳V3H	14.5	15.0	17.0	V	
Horizontal shift	LOW level	V∮H1L, V∮H2L	-0.05	0.0	0.05	V	
register clock	HIGH level	V <i>∲</i> H1H, V <i>∲</i> H2H	4.7	5.0	6.0	V	
Horizontal shift register final stage clock	LOW level	V <i>∲</i> LH1L	-0.05	0.0	0.05	V	
	HIGH level	Vø∟н1н	4.7	5.0	6.0	V	
Reset gate clock	LOW level	V∳RSL	0.0		Vod - 14.0	V	
	HIGH level	V∳RSH	Vod – 9.5		10.0	V	
Vertical shift register clock frequency		f∳V1, f∳V2	15.63		kHz		
		f∳V3, f∳V4		15.03		NITZ	
Horizontal shift re	gister clock frequency	føH1, føH2, føLH1		14.18		MHz	
Reset gate clock f	requency	f∮RS		14.18		MHz	

NOTES:

- Connect NC1 and NC2 to GND directly or through a capacitor larger than 0.047 μF.
- 1. When DC voltage is applied, shutter speed is 1/50-second.
- 2. When pulse is applied, shutter speed is less than 1/50-second.
- * To apply power, first connect GND and then turn on VoFD. After turning on VoFD, turn on PW first and then turn on other powers and pulses. Do not connect the device to or disconnect it from the plug socket while power is being applied.

SHARP LZ2363B/LZ2364BJ

CHARACTERISTICS FOR LZ2363B (Drive method : Field accumulation)

(TA = +25 °C, Operating conditions : The typical values specified in "**RECOMMENDED OPERATING CONDITIONS**". Color temperature of light source : 3 200 K, IR cut-off filter (CM-500, 1 mmt) is used.)

PARAMETER	SYMBOL	MIN.	TYP.	MAX.	UNIT	NOTE
Standard output voltage	Vo		150		mV	2
Photo response non-uniformity	PRNU			10	%	3
Saturation output voltage	VSAT	650			mV	4
Dark output voltage	Vdark		0.5	3.0	mV	1, 5
Dark signal non-uniformity	DSNU		0.5	2.0	mV	1, 6
Sensitivity	R	250	330		mV	7
Smear ratio	SMR		-84	-76	dB	8
Image lag	Al			1.0	%	9
Blooming suppression ratio	ABL	500				10
Output transistor drain current	lod		4.0	8.0	mA	
Output impedance	Ro		350		Ω	
Dark noise	Vnoise		0.2	0.3	mV	11
OB difference in level				1.0	mV	1, 12
Vector breakup				7.0	°, %	13
Line crawling				1.5	%	14
Luminance flicker				2.0	%	15

NOTES:

- VOFD should be adjusted to the minimum voltage such that ABL satisfy the specification, or to the value displayed on the device.
- 1. $TA = +60 \, ^{\circ}C$
- The average output voltage under uniform illumination. The standard exposure conditions are defined as when Vo is 150 mV.
- 3. The image area is divided into 10 x 10 segments under the standard exposure conditions. Each segment's voltage is the average output voltage of all pixels within the segment. PRNU is defined by (Vmax – Vmin)/Vo, where Vmax and Vmin are the maximum and minimum values of each segment's voltage respectively.
- 4. The image area is divided into 10 x 10 segments. Each segment's voltage is the average output voltage of all pixels within the segment. VSAT is the minimum segment's voltage under 10 times exposure of the standard exposure conditions.
- The average output voltage under non-exposure conditions.
- The image area is divided into 10 x 10 segments under non-exposure conditions. DSNU is defined by (Vdmax – Vdmin), where Vdmax and Vdmin are the maximum and minimum values of each segment's voltage respectively.
- 7. The average output voltage when a 1 000 lux light source with a 90% reflector is imaged by a lens of F4, f50 mm.

- 8. The sensor is exposed only in the central area of V/10 square with a lens at F4, where V is the vertical image size. SMR is defined by the ratio of the output voltage detected during the vertical blanking period to the maximum output voltage in the V/10 square.
- 9. The sensor is exposed at the exposure level corresponding to the standard conditions. All is defined by the ratio of the output voltage measured at the 1st field during the non-exposure period to the standard output voltage.
- 10. The sensor is exposed only in the central area of V/10 square, where V is the vertical image size. ABL is defined by the ratio of the exposure at the standard conditions to the exposure at a point where blooming is observed.
- The RMS value of the dark noise (after CDS). (100 kHz to 5.0 MHz, SC trap on.)
- The difference of the average output voltage between the effective area and the OB area under non-exposure conditions.
- Observed with a vector scope when the color bar chart is imaged under the standard exposure conditions.
- 14. The difference between the average output voltage of the (Mg + Ye), (G + Cy) line and that of the (Mg + Cy), (G + Ye) line under the standard exposure conditions.
- 15. The difference between the average output voltage of the odd field and that of the even field under the standard exposure conditions.

CHARACTERISTICS FOR LZ2364BJ (Drive method : Field accumulation)

 $(TA = +25 \, ^{\circ}C, Operating conditions : The typical values specified in "RECOMMENDED OPERATING CONDITIONS". Color temperature of light source : 3 200 K, IR cut-off filter (CM-500, 1 mmt) is used.)$

PARAMETER	SYMBOL	MIN.	TYP.	MAX.	UNIT	NOTE
Standard output voltage	Vo		150		mV	2
Photo response non-uniformity	PRNU			10	%	3
Saturation output voltage	VSAT	650			mV	4
Dark output voltage	Vdark		0.5	3.0	mV	1, 5
Dark signal non-uniformity	DSNU		0.5	2.0	mV	1, 6
Sensitivity	R	370	500		mV	7
Gamma	γ		1			
Smear ratio	SMR		-84	-76	dB	8
Image lag	Al			1.0	%	9
Blooming suppression ratio	ABL	1 000				10
Output transistor drain current	lod		4.0	8.0	mA	
Output impedance	Ro		350		Ω	
Dark noise	VNOISE		0.2	0.3	mV	11
OB difference in level				1.0	mV	1, 12


NOTES:

- VOFD should be adjusted to the minimum voltage such that ABL satisfy the specification, or to the value displayed on the device.
- 1. $TA = +60 \, ^{\circ}C$
- The average output voltage under uniform illumination. The standard exposure conditions are defined as when Vo is 150 mV.
- 3. The image area is divided into 10 x 10 segments under the standard exposure conditions. Each segment's voltage is the average output voltage of all pixels within the segment. PRNU is defined by (Vmax – Vmin)/Vo, where Vmax and Vmin are the maximum and minimum values of each segment's voltage respectively.
- 4. The image area is divided into 10 x 10 segments. Each segment's voltage is the average output voltage of all pixels within the segment. VSAT is the minimum segment's voltage under 10 times exposure of the standard exposure conditions.
- The average output voltage under non-exposure conditions.
- The image area is divided into 10 x 10 segments under non-exposure conditions. DSNU is defined by (Vdmax – Vdmin), where Vdmax and Vdmin are the maximum and minimum values of each segment's voltage respectively.


- The average output voltage when a 1 000 lux light source with a 90% reflector is imaged by a lens of F4, f50 mm.
- 8. The sensor is exposed only in the central area of V/10 square with a lens at F4, where V is the vertical image size. SMR is defined by the ratio of the output voltage detected during the vertical blanking period to the maximum output voltage in the V/10 square.
- 9. The sensor is exposed at the exposure level corresponding to the standard conditions. All is defined by the ratio of the output voltage measured at the 1st field during the non-exposure period to the standard output voltage.
- 10. The sensor is exposed only in the central area of V/10 square, where V is the vertical image size. ABL is defined by the ratio of the exposure at the standard conditions to the exposure at a point where blooming is observed.
- 11. The RMS value of the dark noise after CDS. (100 kHz to 5.0 MHz, SC trap on.)
- The difference between the average output voltage of the effective area and that of the OB area under nonexposure conditions.

SHARP LZ2363B/LZ2364BJ


PIXEL STRUCTURE

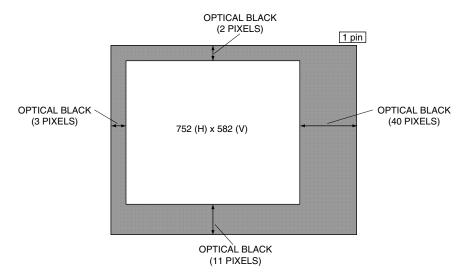


COLOR FILTER ARRAY (FOR LZ2363B)

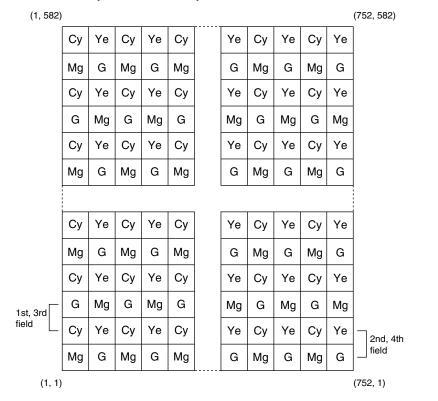


TIMING CHART

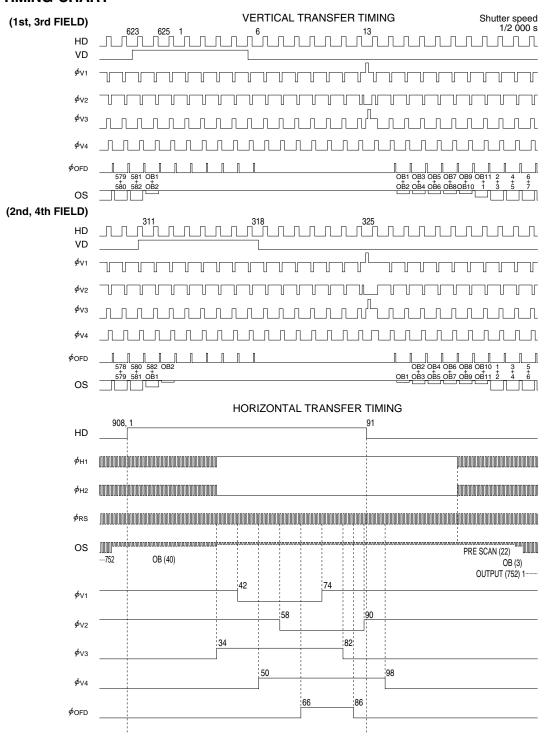


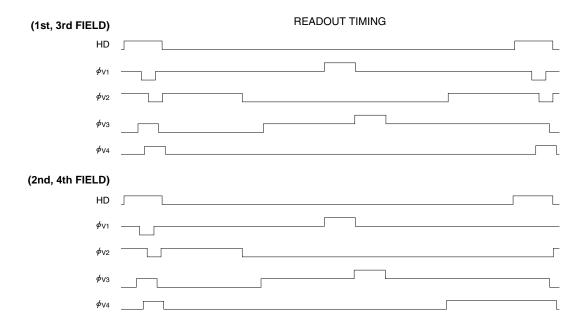

SYSTEM CONFIGURATION EXAMPLE

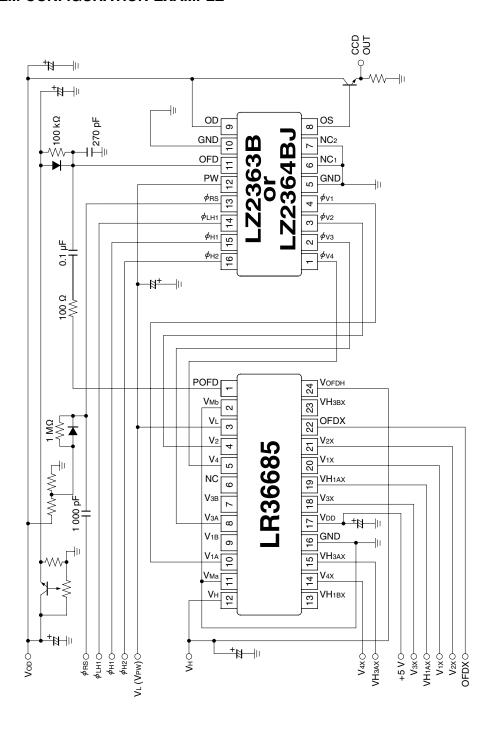

PACKAGE (Unit: mm)

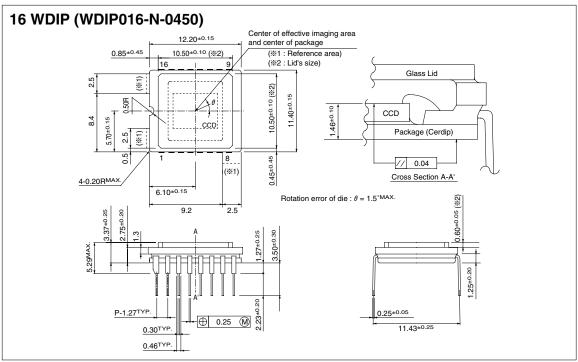

PRECAUTIONS FOR CCD AREA SENSORS


1. Package Breakage

In order to prevent the package from being broken, observe the following instructions:

- The CCD is a precise optical component and the package material is ceramic or plastic. Therefore,
 - Take care not to drop the device when mounting, handling, or transporting.
 - Avoid giving a shock to the package.
 Especially when leads are fixed to the socket or the circuit board, small shock could break the package more easily than when the package isn't fixed.
- 2) When applying force for mounting the device or any other purposes, fix the leads between a joint and a stand-off, so that no stress will be given to the jointed part of the lead. In addition, when applying force, do it at a point below the stand-off part.


(In the case of ceramic packages)

 The leads of the package are fixed with low melting point glass, so stress added to a lead could cause a crack in the low melting point glass in the jointed part of the lead.

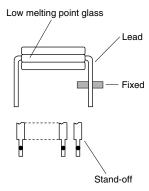

(In the case of plastic packages)

 The leads of the package are fixed with package body (plastic), so stress added to a lead could cause a crack in the package body (plastic) in the jointed part of the lead.

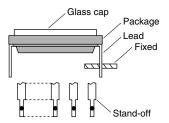

- 3) When mounting the package on the housing, be sure that the package is not bent.
 - If a bent package is forced into place between a hard plate or the like, the package may be broken.
- If any damage or breakage occurs on the surface of the glass cap, its characteristics could deteriorate.

Therefore,

- Do not hit the glass cap.
- Do not give a shock large enough to cause distortion.
- Do not scrub or scratch the glass surface.
- Even a soft cloth or applicator, if dry, could cause dust to scratch the glass.

2. Electrostatic Damage

As compared with general MOS-LSI, CCD has lower ESD. Therefore, take the following anti-static measures when handling the CCD :

- 1) Always discharge static electricity by grounding the human body and the instrument to be used. To ground the human body, provide resistance of about 1 $M\Omega$ between the human body and the ground to be on the safe side.
- When directly handling the device with the fingers, hold the part without leads and do not touch any lead.

- 3) To avoid generating static electricity,
 - a. do not scrub the glass surface with cloth or plastic.
 - b. do not attach any tape or labels.
 - c. do not clean the glass surface with dustcleaning tape.
- 4) When storing or transporting the device, put it in a container of conductive material.

3. Dust and Contamination

Dust or contamination on the glass surface could deteriorate the output characteristics or cause a scar. In order to minimize dust or contamination on the glass surface, take the following precautions:

- Handle the CCD in a clean environment such as a cleaned booth. (The cleanliness level should be, if possible, class 1 000 at least.)
- 2) Do not touch the glass surface with the fingers. If dust or contamination gets on the glass surface, the following cleaning method is recommended:
 - Dust from static electricity should be blown off with an ionized air blower. For antielectrostatic measures, however, ground all the leads on the device before blowing off the dust.

- The contamination on the glass surface should be wiped off with a clean applicator soaked in Isopropyl alcohol. Wipe slowly and gently in one direction only.
- Frequently replace the applicator and do not use the same applicator to clean more than one device.
- Note: In most cases, dust and contamination are unavoidable, even before the device is first used. It is, therefore, recommended that the above procedures should be taken to wipe out dust and contamination before using the device.

4. Other

- Soldering should be manually performed within 5 seconds at 350 °C maximum at soldering iron.
- Avoid using or storing the CCD at high temperature or high humidity as it is a precise optical component. Do not give a mechanical shock to the CCD.
- Do not expose the device to strong light. For the color device, long exposure to strong light will fade the color of the color filters.